


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kentlyn Public School (2285)  
**Region :** South Western Sydney  
**State Electorate :** Campbelltown  
**Local Government Area :** Campbelltown

**Initial Survey :** Noel Arnold & Associates : 01 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Nov - 2016

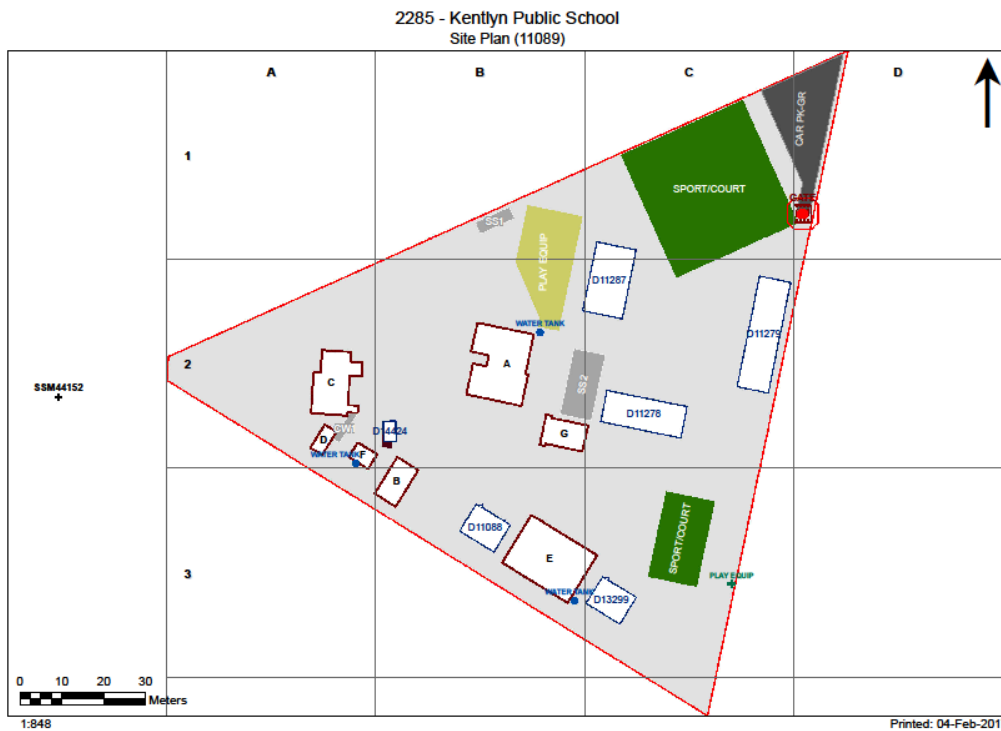

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2285/B00A/Eaves Linings/S3					<b>No Asbestos Detected</b>
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Staff Room Annexe**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2285/B00A/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

**B00A - R0002 - Staff Room Annexe**

No Asbestos

**B00A - R0003 - General Storeroom**

No Asbestos

**B00A - R0004 - Home Base**

No Asbestos

**B00A - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2285/B00A/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

**B00A - R0006 - Covered Outdoor Learning Area**

No Asbestos

**B00A - R0007 - Covered Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1950 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Ceiling Voids - Flat Roof	Non Accessible Area - No Voids					
Eaves Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/Eaves Linings/S6					<b>Chrysotile (white asbestos)</b>

**Interior****B00B - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Garden Store**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0006 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0007 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00B/R0003/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration - 1950 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/Eaves Linings/S8					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	AC Fragments/Debris	2m2	North East Corner	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2285/B00C/Underfloor Voids/S9					<b>Chrysotile (white asbestos)</b>

**Interior****B00C - R0001 - Duplicating Workroom**

No Asbestos

**B00C - R0002 - Staff Room**

No Asbestos

**B00C - R0003 - Staff Room Annexe**

No Asbestos

**B00C - R0004 - Principal**

No Asbestos

**B00C - R0005 - Entry Vestibule**

No Asbestos

**B00C - R0006 - Clerical Office**

No Asbestos

**B00C - R0007 - Sick Bay**

No Asbestos

**B00C - R0008 - Interview**

No Asbestos

**B00C - R0009 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/R0009/Wall Linings Internal/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0010 - Movement**

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/R0009/Wall Linings Internal/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0011 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/R0009/Wall Linings Internal/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0012 - Movement**

No Asbestos

**B00C - R0013 - External Movement**

No Asbestos

**B00C - R0014 - External Movement**

No Asbestos

**B00C - R0015 - Movement**

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/R0009/Wall Linings Internal/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00C - R0016 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2285/B00C/R0009/Wall Linings Internal/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0017 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
2285/B00C/R0017/Ceiling Structures/Linings/S1						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Building Services - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids					
Eaves Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00D/Eaves Linings/S10					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Security Store**

No Asbestos

**B00D - R0002 - Cleaning Supplies**

Wall Linings Internal	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2285/B00C/R0009/Wall Linings Internal/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - External Movement**

No Asbestos

**B00E - R0002 - Practical Activities - 1hb**

No Asbestos

**B00E - R0003 - Home Base Store**

No Asbestos

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00E - R0006 - Home Base**

No Asbestos

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Practical Activities - 1hb**

No Asbestos

**B00E - R0009 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 2012 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - No Voids

Ceiling Voids      No Asbestos Found

**Interior**

**B00F - R0001 - Disabled Toilet**

No Asbestos

**B00F - R0002 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities/Staff Facilities - 2013 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Staff Toilet**

No Asbestos

**B00G - R0002 - Toilets - Girls**

No Asbestos

**B00G - R0003 - Toilets - Boys**

No Asbestos

**B00G - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D11088 - Learning Unit - Standard/Withdrawal : Placement Date - 3/12/1999**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

**OS 534 - D11278 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

### Interior

#### R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

#### R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2
---------	---------------	------------------	--	-------

#### R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

#### R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

#### R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

#### R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

#### R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos		54 m2
---------	---------------	------------------	--	-------

#### R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos		14 m2
---------	---------------	------------------	--	-------

**OS 811 - D11279 - FSU/Shelter/Stores : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		31.68 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Interior****R1 - Canteen**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				28 m2

**R2 - Covered Area**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				145 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
---------	---------------	------------------	--	--	--	------

**R4 - Sports Store**

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

**R5 - Garden Store**

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

**R6 - Change Room**

Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
---------	---------------	------------------	--	--	--	------

**R7 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
---------	---------------	------------------	--	--	--	------

**NS 101 - D11287 - Learning Unit - Double Primary/PAA : Placement Date - 30/06/1995****Exterior**

No Asbestos Found.

**Interior****R1 - Home Base**

No Asbestos Found.

**R2 - Home Base**

No Asbestos Found.

**R3 - Entry**

No Asbestos Found.

**R4 - Practical Activity Area**

No Asbestos Found.

**R5 - Home Base Store**

No Asbestos Found.

**R6 - Practical Activity Area**

No Asbestos Found.

**R7 - Entry**

No Asbestos Found.

**OS 602 - D13299 - Learning Unit - Standard With P.A.A. : Placement Date - 9/05/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior****R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 972 - D14424 - Shed - Lightweight Shutter(Garden/Sport) : Placement Date - 30/06/1995****Exterior**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
<b>Interior</b>						
<b>R1 - Garden Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017