


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kentucky Public School (2286)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Uralla

Initial Survey : Noel Arnold & Associates : 14 - Apr - 2008
Reviewed By : AECOM : 29 - Apr - 2016

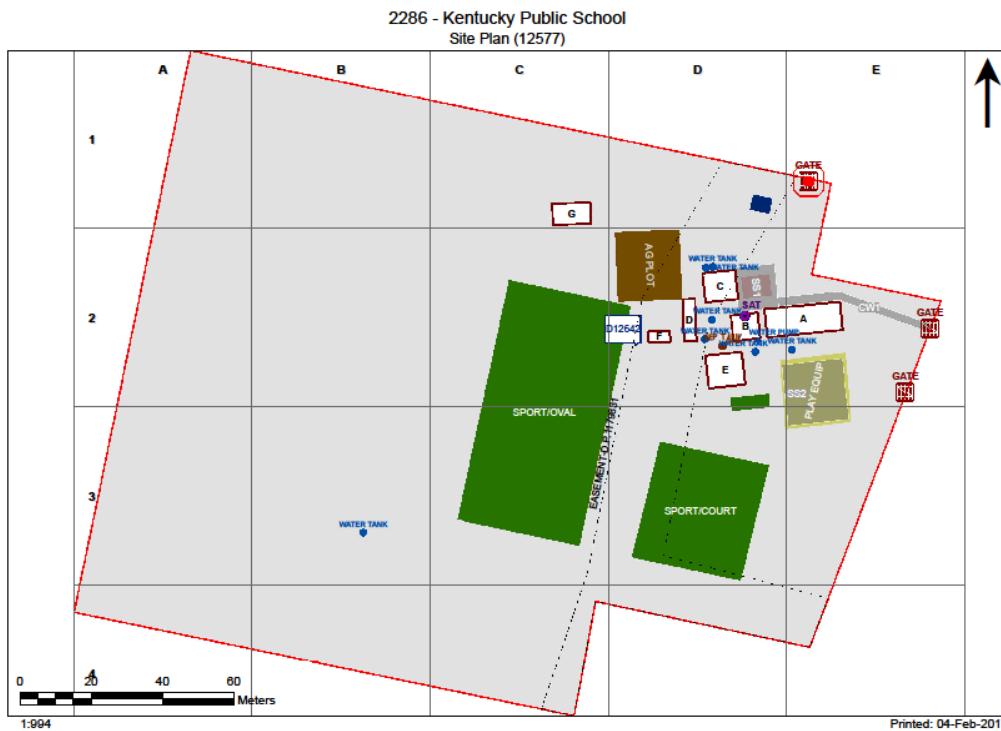

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1911 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction, area inaccessible, 3.2m.					
Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris	6Unit	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2286/B00A/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)

Interior

B00A - R0001 - Principal

Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00A/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0004 - Personal Effects Storage

No Asbestos

B00A - R0005 - Practical Activities - 1hb

No Asbestos

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Home Base Store

No Asbestos

B00A - R0008 - Practical Activities - 1hb

No Asbestos

B00A - R0009 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - Pupil Facilities - 1970 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no access points.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab to ground, no access points.					
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/Eaves Linings/S3					Chrysotile (white asbestos)
Interior						
B00B - R0001 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00B - R0002 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00B - R0003 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00B - R0004 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Incinerator (Goodrid Sanitary Incinerette)	Millboard	1Unit	East	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	2286/B00B/R0004/Incinerator (Goodrid Sanitary Incinerette)/S6					Chrysotile (white asbestos)
B00B - R0005 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0005/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East, Middle portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2286/B00B/R0004/Incinerator (Goodrid Sanitary Incinerette)/S6					Chrysotile (white asbestos)
B00B - R0006 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2286/B00B/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1911 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible, no ceiling space access hatch.					
Eaves Linings	Flat AC Sheeting 2286/B00C/Eaves Linings/S7					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00C - R0003 - Clerical Office/Workroom

No Asbestos

B00C - R0004 - Other

No Asbestos

B00C - R0005 - Staff Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 1926 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible, slab to ground, no access points.

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible, slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Reading Area

No Asbestos

B00E - R0002 - K.L.A. Store

No Asbestos

B00E - R0003 - Practical Activities

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible, slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Storage - 2014 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - General Storeroom

No Asbestos

B00G - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D12642 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 26/05/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017