


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kingsgrove Public School (2307)
Region : Sydney
State Electorate : Kogarah
Local Government Area : Hurstville

Initial Survey : Noel Arnold & Associates : 06 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

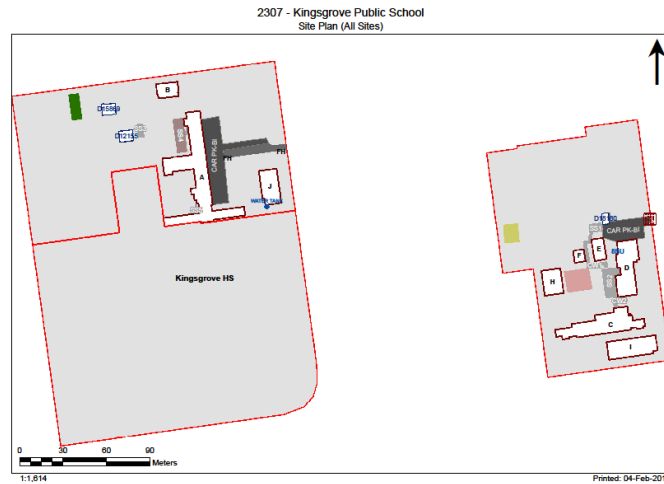

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1954 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/Eaves Linings/S6					Chrysotile (white asbestos)
Electrical Backing Board	Unkown	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - No Access - No key found at school
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2307/B00A/Underfloor Voids/S15					Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2307/B00A/Underfloor Voids/S19					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Void	No Asbestos Found					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Above sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0001/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Duplicating Workroom

No Asbestos

B00A - R0004 - General Storeroom

No Asbestos

B00A - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0034/Ceiling Structures/Linings/S24					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Home Base

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Sick Bay

No Asbestos

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Entry Vestibule

No Asbestos

B00A - R0013 - Clerical Office

No Asbestos

B00A - R0014 - Home Base

No Asbestos

B00A - R0015 - Home Base

No Asbestos

B00A - R0016 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0017 - Movement						
No Asbestos						
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Distribution Board						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	2Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0019/Electrical Mounting Board/S34					Chrysotile (white asbestos)
Door lining	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0019/Door lining/S1					Chrysotile (white asbestos)
B00A - R0020 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0032/Partition Walls (Cubicles)/S4					Insufficient Sample
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0032/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0021 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2307/B00A/R0021/Ceiling Structures/Linings/S23					
B00A - R0022 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0032/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0023 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2307/B00A/R0021/Ceiling Structures/Linings/S23					
B00A - R0024 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0024/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0025 - Main Switch Board						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00A/R0024/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0026 - Staff Toilet						
No Asbestos						
B00A - R0027 - Canteen						
No Asbestos						
B00A - R0030 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2307/B00A/R0030/Ceiling Structures/Linings/S22					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2307/B00A/R0030/Floor Coverings Res/Textile/S33					
B00A - R0031 - Practical Activity Area						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2307/B00A/R0031/Floor Coverings Res/Textile/S3					
B00A - R0032 - Toilets - Boys						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00A/R0032/Partition Walls (Cubicles)/S4				Insufficient Sample		
Ceiling Structures/Linings	Flat AC Sheeting	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00A/R0032/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0033 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00A/R0032/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0034 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00A/R0034/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00A - R0035 - General Storeroom						
No Asbestos						
B00A - R0036 - Staff Toilet						
No Asbestos						
B00A - R0037 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					
2307/B00A/R0021/Ceiling Structures/Linings/S23				No Asbestos Detected		
B00A - R0038 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting					
2307/B00A/R0021/Ceiling Structures/Linings/S23				No Asbestos Detected		
B00A - R0039 - Raised Platform						
No Asbestos						
B00A - R0040 - Communal Space						
No Asbestos						
B00A - R0041 - Duplicating Workroom						
No Asbestos						
B00A - R0042 - Stairs						
No Asbestos						
B00A - R0043 - Stairs						
No Asbestos						
B00A - R0044 - Disabled Shower/Toilet						
No Asbestos						
B00A - R0045 - Movement						
No Asbestos						
B00A - R1001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Above sink	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00A/R0001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		
B00A - R1002 - Duplicating Workroom						
No Asbestos						
B00A - R1003 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting					
2307/B00A/R1016/Ceiling Structures/Linings/S26				No Asbestos Detected		
B00A - R1004 - Home Base						
No Asbestos						
B00A - R1005 - Home Base						
No Asbestos						
B00A - R1006 - Home Base						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R1007 - Sports Store						
Access panel	Flat AC Sheeting		2307/B00A/R1011/Access panel/S30			No Asbestos Detected
B00A - R1008 - Interview						
No Asbestos						
B00A - R1009 - Staff Room Annexe						
No Asbestos						
B00A - R1010 - Staff Room Annexe						
No Asbestos						
B00A - R1011 - General Storeroom						
Access panel	Flat AC Sheeting		2307/B00A/R1011/Access panel/S30			No Asbestos Detected
B00A - R1012 - Home Base						
No Asbestos						
B00A - R1013 - Home Base						
No Asbestos						
B00A - R1014 - Home Base						
No Asbestos						
B00A - R1015 - Special Programs Room						
No Asbestos						
B00A - R1016 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting		2307/B00A/R1016/Ceiling Structures/Linings/S26			No Asbestos Detected
B00A - R1017 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting		2307/B00A/R1016/Ceiling Structures/Linings/S26			No Asbestos Detected
B00A - R1018 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting		2307/B00A/R1016/Ceiling Structures/Linings/S26			No Asbestos Detected
B00A - R1019 - Stairs						
No Asbestos						
B00A - R1020 - Stairs						
No Asbestos						
B00A - R9001 - General Storeroom						
No Asbestos						
B00A - R9002 - General Assistant/Bulk Store						
Floor Coverings Res/Textile	Vinyl Tiles		2307/B00A/R0031/Floor Coverings Res/Textile/S3			No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting		2307/B00A/R9002/Ceiling Structures/Linings/S25			No Asbestos Detected
B00A - R9003 - General Assistant/Bulk Store						
Packing material	Flat AC Sheeting		2307/B00A/R9002/Ceiling Structures/Linings/S25			No Asbestos Detected
B00A - R9004 - General Storeroom						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1954 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2307/B00B/Underfloor Voids/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2307/B00B/Underfloor Voids/S20			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00B/R0004/Wall Linings Internal/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering)					No Asbestos Detected
	2307/B00B/R0001/Floor Coverings Res/Textile/S31					

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00B/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00B/R0002/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00B/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos)		

B00B - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00B/R0004/Wall Linings Internal/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering)					No Asbestos Detected
	2307/B00B/R0001/Floor Coverings Res/Textile/S31					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1954 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - P.E. Store

Ceiling Structures/Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00C/R0008/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00C/R0008/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Home Base

No Asbestos

B00C - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00C/R0008/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0009 - Staff Toilet

No Asbestos

B00C - R0010 - Cleaning Distributed Store

No Asbestos

B00C - R0011 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00C/R0008/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - Movement

No Asbestos

B00C - R0014 - General Storeroom

No Asbestos

B00C - R0015 - Staff Room Annexe

No Asbestos

B00C - R0016 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
2307/B00C/R0016/Floor Coverings Res/Textile/S12					No Asbestos Detected	

B00C - R0017 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting					
2307/B00C/R0017/Ceiling Structures/Linings/S28					No Asbestos Detected	

B00C - R0018 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00C/R0018/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

B00C - R0019 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1954 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2307/B00D/Underfloor Voids/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Outdoor Learning Area

No Asbestos

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Toilets - Boys/Girls

No Asbestos

B00D - R0004 - Home Base

No Asbestos

B00D - R0005 - Practical Activities - 1hb

No Asbestos

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2307/B00D/R0009/Ceiling Structures/Linings/S29			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0010 - Interview

No Asbestos

B00D - R0011 - Staff Toilet

No Asbestos

B00D - R0012 - Cleaning Distributed Store

No Asbestos

B00D - R0013 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles					
	2307/B00D/R0016/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00D - R0014 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2307/B00D/R0016/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00D - R0015 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2307/B00D/R0015/Floor Coverings Res/Textile/S32					No Asbestos Detected

B00D - R0016 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	2307/B00D/R0016/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00D - R0017 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2307/B00D/R0019/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	

B00D - R0018 - Craft Store

No Asbestos

B00D - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

2307/B00D/R0019/Ceiling Structures/Linings/S11 Chrysotile (white asbestos)

B00D - R9001 - General Assistant/Bulk Store

No Asbestos

B00D - R9002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1954 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 2307/B00E/Wall Cladding/S21					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 2307/B00E/Underfloor Voids/S18					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Communal Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1940 - Timber (Timber)

Exterior

Ceiling Void	Non Accessible Area - No Access - No Manhole in Building
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Movement

No Asbestos

B00F - R0002 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Practical Activities - 1hb

No Asbestos

B00H - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Administration/Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00I - R0001 - Entry Vestibule

No Asbestos

B00I - R0002 - Clerical Office

No Asbestos

B00I - R0003 - Sick Bay

No Asbestos

B00I - R0004 - Staff Room

No Asbestos

B00I - R0005 - Staff Room Annexe

No Asbestos

B00I - R0007 - Communications Room

No Asbestos

B00I - R0008 - K.L.A. Store

No Asbestos

B00I - R0009 - Reading Area

No Asbestos

B00I - R0010 - Library Office/Workroom

No Asbestos

B00I - R0011 - Security Store

No Asbestos

B00I - R0012 - Cleaning Distributed Store

No Asbestos

B00I - R0013 - Main Switch Board

No Asbestos

B00I - R0014 - Staff Toilet

No Asbestos

B00I - R0015 - Staff Toilet

No Asbestos

B00I - R0016 - Staff Toilet

No Asbestos

B00I - R0017 - Access Shower/Toilet

No Asbestos

B00I - R0018 - Principal

No Asbestos

B00I - R0019 - Movement

No Asbestos

B00I - R0020 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - External Movement

No Asbestos

B00J - R0002 - Toilet - Lobby

No Asbestos

B00J - R0003 - Toilets-Unisex

No Asbestos

B00J - R0004 - Cleaning Distributed Store

No Asbestos

B00J - R0005 - Reading Area

No Asbestos

B00J - R0006 - K.L.A. Store

No Asbestos

B00J - R0007 - Communications Room

No Asbestos

B00J - R0008 - Library Office/Workroom

No Asbestos

B00J - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12155 - Learning Unit - Standard/Withdrawal : Placement Date - 9/01/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D15869 - Learning Unit - Standard With P.A.A. : Placement Date - 30/09/2009

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 522 - D18180 - Staff Study : Placement Date - 5/08/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Staff Room

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2307_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017