


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kingstown Public School (2310)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Uralla

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : AECOM : 29 - Apr - 2016

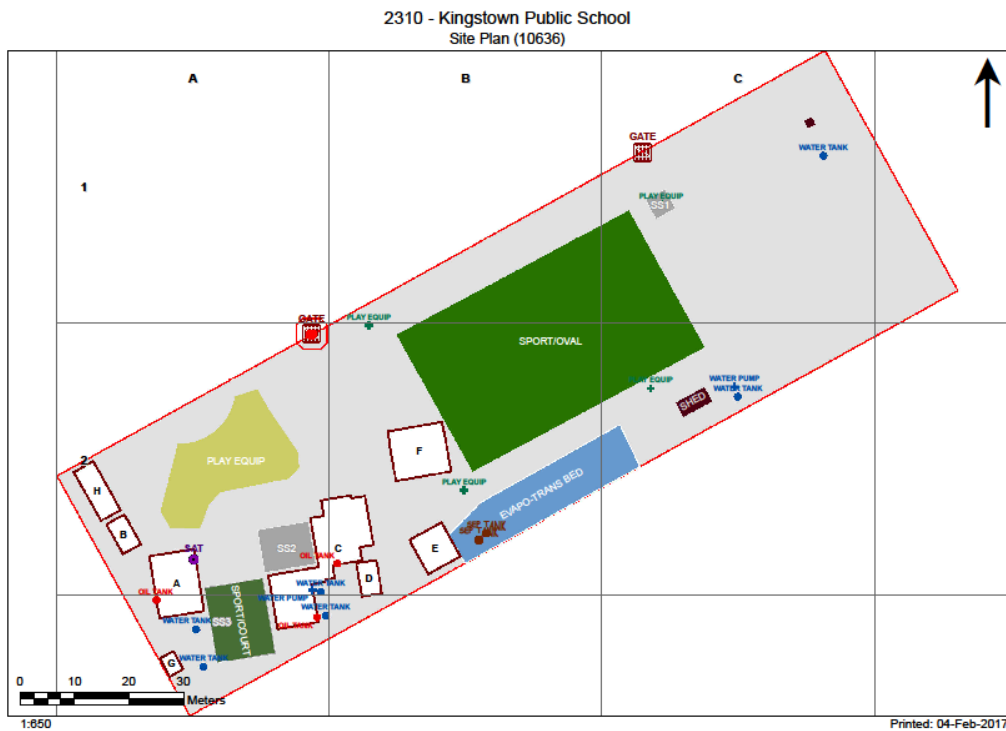

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1913 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction, AR0002 3.62m					

Interior

B00A - R0001 - External Movement

No Asbestos

B00A - R0002 - Reading Area

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected	
2310/B00A/R0002/Floor Coverings Res/Textile/S5							
Vulcan gas heater and flue	Encapsulated Insulation material within unit	1Unit	Assumed throughout unit	Minimal Damage (2)	High (3)	Medium Priority (4-5)	
2310/B00A/R0002/Vulcan gas heater and flue/S6						Chrysotile (white asbestos)	

B00A - R0003 - K.L.A. Store

No Asbestos

B00A - R0004 - Clerical Office

No Asbestos

B00A - R0005 - Principal

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1907 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible slab to ground, no access points.

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1955 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2310/B00C/R0005/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction CR0006 3.4m.					

Interior

B00C - R0001 - Staff Room

No Asbestos

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Home Base

Vulcan gas heater and flue	Encapsulated Insulation material within unit	1Unit	Assumed throughout unit	Minimal Damage (2)	High (3)	Medium Priority (4-5)
	2310/B00A/R0002/Vulcan gas heater and flue/S6			Chrysotile (white asbestos)		

B00C - R0005 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2310/B00C/R0005/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	2310/B00C/R0005/Wall Linings Internal/S3				No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

B00C - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	4m2	South, East, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2310/B00C/R0006/Wall Linings Internal/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Vulcan gas heater and flue	Encapsulated Insulation material within unit	1Unit	Assumed within unit throughout	Minimal Damage (2)	High (3)	Medium Priority (4-5)
	2310/B00A/R0002/Vulcan gas heater and flue/S6			Chrysotile (white asbestos)		

B00C - R0007 - Practical Activities - 1hb

No Asbestos

B00C - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2310/B00C/R0005/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	2310/B00C/R0005/Wall Linings Internal/S3				No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1907 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2310/B00D/Eaves Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1907 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no access points
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible slab to ground, no access points.

Interior

B00E - R0001 - External Movement

No Asbestos

B00E - R0002 - Toilets - Boys

No Asbestos

B00E - R0003 - Toilets - Girls

Incinerette	Encapsulated Insulation material within unit 2310/B00E/R0003/Incinerette/S7	1Unit(s)	South, Middle portion	Friable Asbestos (5)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
-------------	--	----------	-----------------------	----------------------	---------	---

B00E - R0004 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Storage - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible slab to ground, no access points.

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Computer Learning - 2009 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area 2310/B00H/Exterior/Underfloor Voids - Packing to Floor Joists/S8 - Area inaccessible no access points.					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris 2310/B00H/Exterior/Underfloor Voids - Packing to Floor Joists/S8					No Asbestos Detected

Interior

B00H - R0001 - External Movement

No Asbestos

B00H - R0002 - Staff Kitchen

No Asbestos

B00H - R0003 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017