


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kingswood Public School (2312)
Region : Western Sydney
State Electorate : Penrith
Local Government Area : Penrith

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 17 - Jun - 2015

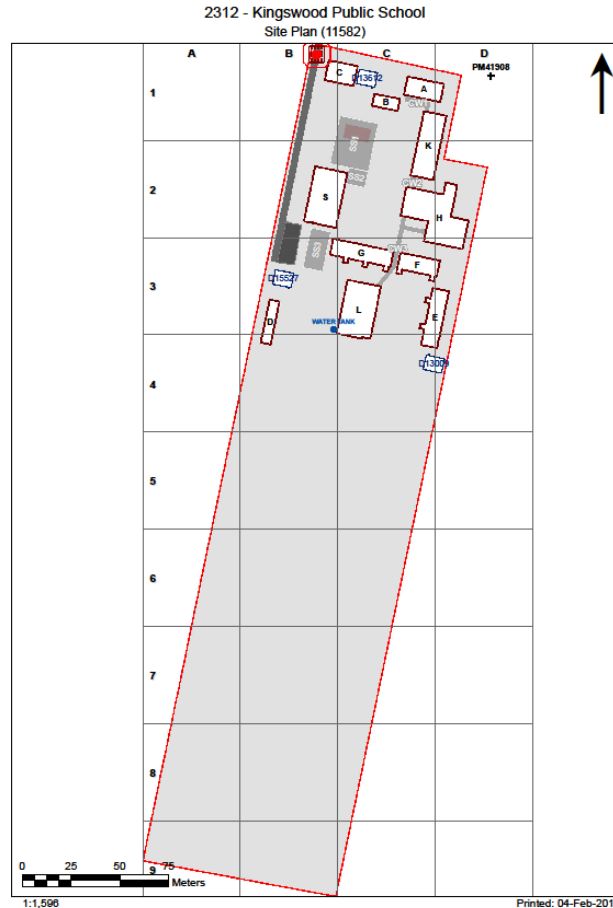

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1959 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - No Manhole - No access possible into ceiling void					

Interior

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Toilets - Boys/Girls

No Asbestos

B00A - R0004 - Home Base Store

No Asbestos

B00A - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00A/R0005/Wall Linings Internal/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0006 - Movement

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - Community Clinic

No Asbestos

B00A - R0010 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1892 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - No Manhole - No access possible into ceiling void					

Interior

B00B - R0001 - Practical Activities - 1hb

No Asbestos

B00B - R0002 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1954 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Movement

No Asbestos

B00C - R0003 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Administration - 1963 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Toilets - Boys

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0003 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1967 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Eaves Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Gable Verge Lining/S12			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2312/B00E/Underfloor Voids - Packing to Floor Joists/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - No manhole - No access into ceiling void possible					

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - External Movement

In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0003 - Home Base

No Asbestos

B00E - R0004 - Home Base Store

No Asbestos

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - External Movement

In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - Home Base Store

No Asbestos

B00E - R0008 - Home Base

No Asbestos

B00E - R9001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Eaves Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Gable Verge Lining/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Interview**

No Asbestos

B00F - R0002 - Personal Effects Storage

No Asbestos

B00F - R0003 - Movement

No Asbestos

B00F - R0004 - External Movement

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0005 - Home Base Store

No Asbestos

B00F - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/R0006/Wall Linings Internal/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0007 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/R0006/Wall Linings Internal/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0008 - Home Base Store

No Asbestos

B00F - R0009 - Personal Effects Storage

No Asbestos

B00F - R0010 - Movement

No Asbestos

B00F - R0011 - External Movement

In-fill-panel	Flat AC Sheeting	4m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Eaves Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00F/Gable Verge Lining/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00G - R0001 - Interview**

No Asbestos

B00G - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0002/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	

B00G - R0003 - External Movement

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0004 - Home Base

No Asbestos

B00G - R0005 - Home Base Store

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - External Movement

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0008 - Home Base Store

No Asbestos

B00G - R0009 - Home Base

No Asbestos

B00G - R0010 - External Movement

In-fill-panel	Flat AC Sheeting	1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00G/R0010/In-fill-panel/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0011 - Movement

No Asbestos

B00G - R0012 - Personal Effects Storage

No Asbestos

B00G - R0013 - Home Base Store

No Asbestos

B00G - R0014 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration/Library - 1974 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Eaves Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Reading Area**

No Asbestos

B00H - R0002 - Library Office/Workroom

No Asbestos

B00H - R0003 - Seminar/Study

No Asbestos

B00H - R0004 - Toilets - Girls

No Asbestos

B00H - R0005 - Toilets - Boys

No Asbestos

B00H - R0006 - Movement

No Asbestos

B00H - R0008 - Library Office/Workroom

No Asbestos

B00H - R0009 - Library Office/Workroom

No Asbestos

B00H - R0010 - Communications Room

No Asbestos

B00H - R0011 - Movement

No Asbestos

B00H - R0012 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00H - R0013 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0013/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00H - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00H - R0015 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00H - R0016 - Interview

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00H - R0017 - Principal

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00H - R0018 - Deputy Principal

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0019 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0020 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0020/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00H - R0021 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0022 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0023 - Duplicating Workroom						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0024 - Sick Bay						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0025 - Interview						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0026 - Community Clinic						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00H/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00H - R0027 - Staff Toilet						
No Asbestos						
B00H - R0028 - Staff Toilet						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/Eaves Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2312/B00K/Gable Verge Lining/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00K - R0001 - Toilets - Boys/Girls**

No Asbestos

B00K - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/R0005/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00K - R0003 - Home Base

No Asbestos

B00K - R0004 - Home Base

No Asbestos

B00K - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/R0005/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00K - R0006 - Toilets - Boys/Girls

No Asbestos

B00K - R0007 - Main Switch Board

No Asbestos

B00K - R0008 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2312/B00K/R0010/Partition Walls (Cubicles)/S20					

B00K - R0009 - Cleaning Distributed Store

Ceiling Manhole	Flat AC Sheeting	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/R0009/Ceiling Manhole/S19				Chrysotile (white asbestos)	

B00K - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2312/B00K/R0010/Partition Walls (Cubicles)/S20					

B00K - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2312/B00K/R0011/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00L - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Communal Space

No Asbestos

B00L - R0002 - Raised Platform

No Asbestos

B00L - R0003 - Movement

No Asbestos

B00L - R0004 - Movement

No Asbestos

B00L - R0005 - Movement

No Asbestos

B00L - R0006 - Hall Chair Store

No Asbestos

B00L - R0007 - Communal/Performance Store

No Asbestos

B00L - R0008 - P.E. Store

No Asbestos

B00L - R0009 - Toilet - Lobby

No Asbestos

B00L - R0010 - Toilets - Girls

No Asbestos

B00L - R0011 - Sound Cupboard

No Asbestos

B00L - R0012 - Toilet - Lobby

No Asbestos

B00L - R0013 - Toilets - Boys

No Asbestos

B00L - R0014 - Cleaning Distributed Store

No Asbestos

B00L - R0015 - Disabled Shower/Toilet

No Asbestos

B00L - R0016 - Main Switch Board

No Asbestos

B00L - R0017 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Communal Facilities/Pupil Facilities - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00S - R0001 - External Movement

No Asbestos

B00S - R0002 - Communal Space

No Asbestos

B00S - R0003 - Raised Platform

No Asbestos

B00S - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00S/R0004/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00S - R0005 - Movement

No Asbestos

B00S - R0006 - General Storeroom

No Asbestos

B00S - R0007 - Garden Store

No Asbestos

B00S - R0008 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00S/R0004/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00S - R0010 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2312/B00S/R0009/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00S - R0012 - Canteen

No Asbestos

B00S - R0013 - Canteen Office/Store

No Asbestos

B00S - R0014 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

- D11489 - : Placement Date - 21/09/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found.

OS 602 - D13009 - Learning Unit - Standard With P.A.A. : Placement Date - 24/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13612 - Learning Unit - Standard With P.A.A. : Placement Date - 21/03/2014

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15527 - Learning Unit - Standard With P.A.A. : Placement Date - 4/03/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017