


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kogarah Public School (2319)
Region : Sydney
State Electorate : Kogarah
Local Government Area : Kogarah

Initial Survey : Noel Arnold & Associates : 20 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

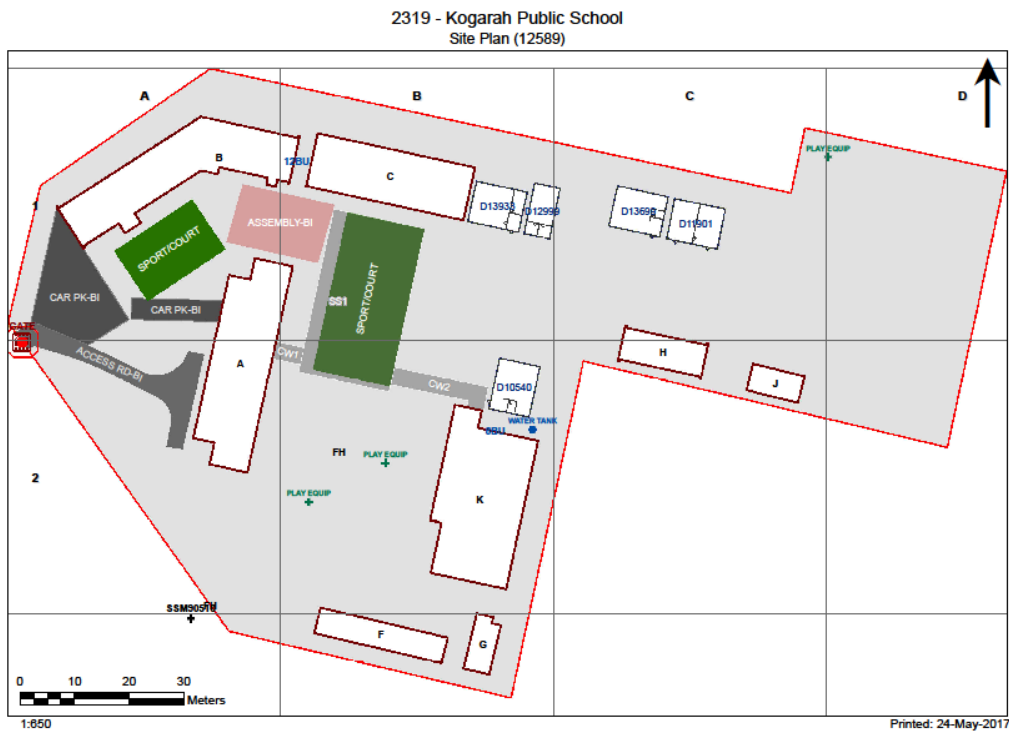

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1950 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00A - R0001 - Cleaning Distributed Store (4.02 m2)**

No Asbestos

B00A - R0002 - External Movement (62.06 m2)

In-fill panels below windows	Flat AC Sheeting	30m2	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0002/In-fill panels below windows/S15					Chrysotile (white asbestos)	

B00A - R0003 - Staff Room (54.76 m2)

Floor Coverings Res/Textile	Vinyl Tiles	55m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	2319/B00A/R0014/Ceiling Structures/Linings/S14		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0004 - Staff Toilet (5.45 m2)

No Asbestos

B00A - R0005 - Cleaning Distributed Store (2.34 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

B00A - R0006 - Staff Toilet (6.3 m2)

No Asbestos

B00A - R0007 - Entry Vestibule (9.03 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	2319/B00A/R0014/Ceiling Structures/Linings/S14		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0008 - Clerical Office (13.69 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	2319/B00A/R0014/Ceiling Structures/Linings/S14		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0009 - Principal (18.18 m2)

Ceiling Structures/Linings	Vermiculite	2319/B00A/R0014/Ceiling Structures/Linings/S14		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0010 - Clerical Office/Workroom (17.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	2319/B00A/R0014/Ceiling Structures/Linings/S14		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0011 - Main Switch Board (5.42 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0011/Electrical Mounting Board/S19				Chrysotile (white asbestos)		
B00A - R0012 - Duplicating Workroom (17.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0013 - Movement (17.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0014 - Movement (25.6 m2)						
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0015 - General Storeroom (17.92 m2)						
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0016 - P.E. Store (4.02 m2)						
No Asbestos						
B00A - R0017 - Canteen (21.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0018 - Canteen Office/Store (2.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0019 - Staff Toilet (4.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0020 - Movement (2.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0013/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0021 - External Stairs (12.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0022 - External Stairs (12.3 m2)

No Asbestos

B00A - R1001 - External Movement (73.15 m2)

In-fill panels below windows	Flat AC Sheeting	20m2	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00A/R0002/In-fill panels below windows/S15					Chrysotile (white asbestos)	

B00A - R1002 - Practical Activities - 1hb (8.27 m2)

Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R1003 - Home Base (65.33 m2)

Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R1004 - Reading Area (146.05 m2)

Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R1005 - Library Office/Workroom (14.52 m2)

Ceiling Structures/Linings	Vermiculite					
2319/B00A/R0014/Ceiling Structures/Linings/S14					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R1006 - Staff Toilet (4.04 m2)

No Asbestos

B00A - R1007 - Cleaning Distributed Store (1.38 m2)

No Asbestos

B00A - R1008 - Staff Toilet (4.04 m2)

No Asbestos

B00A - R1009 - External Stairs (14.46 m2)

No Asbestos

B00A - R1010 - External Stairs (14.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00B/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	Non Accessible Area - No Access - No manhole in Building					
Underfloor Void	No Asbestos Found					

Interior**B00B - R0001 - Interview (19.64 m2)**

No Asbestos

B00B - R0002 - General Storeroom (4.79 m2)

No Asbestos

B00B - R0003 - Movement (8.56 m2)

Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00B/R0003/Electrical Mounting Board/S20					Chrysotile (white asbestos)
Wall panelling to electrical switchboard cupboard	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00B/R0003/Wall panelling to electrical switchboard cupboard/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0004 - Cleaning Distributed Store (5.04 m2)

No Asbestos

B00B - R0005 - External Movement (2.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00B/R0020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0006 - General Storeroom (4.64 m2)

No Asbestos

B00B - R0007 - Home Base (56.46 m2)

No Asbestos

B00B - R0008 - Home Base Store (5.88 m2)

No Asbestos

B00B - R0009 - General Storeroom (3.48 m2)

No Asbestos

B00B - R0010 - Movement (7.48 m2)

No Asbestos

B00B - R0011 - External Movement (3.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00B/R0020/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0012 - Special Programs Room (25.15 m2)

No Asbestos

B00B - R0013 - Personal Effects Storage (3.48 m2)

No Asbestos

B00B - R0014 - Home Base (56.86 m2)

No Asbestos

B00B - R0015 - Home Base Store (5.87 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0016 - Home Base (56.86 m2)						
No Asbestos						
B00B - R0017 - Home Base Store (6.02 m2)						
No Asbestos						
B00B - R0018 - Personal Effects Storage (7.33 m2)						
No Asbestos						
B00B - R0019 - Movement (6.05 m2)						
No Asbestos						
B00B - R0020 - External Movement (6.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2319/B00B/R0020/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0021 - Home Base (59.87 m2)						
No Asbestos						
B00B - R0022 - Home Base Store (6.06 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1950 - Steel (Steel)**Exterior**

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2319/B00C/Underfloor Voids/S17			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00C - R0001 - Home Base (53.58 m2)**

No Asbestos

B00C - R0002 - Home Base Store (5.76 m2)

Wall panelling to electrical switchboard cupboard	Flat AC Sheeting	1m2	North facing	Good Condition 91)	Low (1)	Low Priority (2-3)
	2319/B00B/R0003/Wall panelling to electrical switchboard cupboard/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - External Movement (23.04 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2319/B00C/R0007/Wall Linings Internal/S4					

B00C - R0004 - Home Base (53.07 m2)

No Asbestos

B00C - R0005 - Home Base Store (11.61 m2)

No Asbestos

B00C - R0006 - Home Base (53.14 m2)

No Asbestos

B00C - R0007 - External Movement (22.92 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2319/B00C/R0007/Wall Linings Internal/S4					

B00C - R0008 - Sports Store (5.81 m2)

No Asbestos

B00C - R0009 - Home Base (53.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Building Services - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00F/Eaves Linings/S11				Chrysotile (white asbestos)	
Ceiling Void	AC Fragments/Debris	4m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2319/B00F/Ceiling Void/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B00F - R0001 - Garden Store (41.09 m2)

No Asbestos

B00F - R0002 - General Assistant/Bulk Store (10.88 m2)

No Asbestos

B00F - R0003 - Toilets - Girls (37.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00F/R0003/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0004 - Staff Toilet (7.82 m2)

No Asbestos

B00F - R0005 - Staff Toilet (7.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00F/R0003/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00G/Eaves Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	AC Fragments/Debris	30m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2319/B00G/Ceiling Void/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00G - R0001 - Toilets - Boys (42.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00F/R0003/Ceiling Structures/Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0002 - Cleaning Distributed Store (1.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00F/R0003/Ceiling Structures/Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00H/Eaves Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00H - R0001 - Toilets - Boys (44.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00H/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0002 - Toilets - Girls (35.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00H/R0001/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Shed - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00J/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00J - R0001 - Sports Store (44.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2319/B00J/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - External Movement (113.14 m2)**

No Asbestos

B00K - R0002 - Practical Activities - 1hb (19.51 m2)

No Asbestos

B00K - R0003 - Home Base (59.28 m2)

No Asbestos

B00K - R0004 - Withdrawal Space - 1hb (8.88 m2)

No Asbestos

B00K - R0005 - Home Base Store (5.73 m2)

No Asbestos

B00K - R0006 - Practical Activities - 1hb (19.52 m2)

No Asbestos

B00K - R0007 - Home Base (60.01 m2)

No Asbestos

B00K - R0008 - Home Base Store (5.81 m2)

No Asbestos

B00K - R0009 - Withdrawal Space - 2hb (12.73 m2)

No Asbestos

B00K - R0010 - Practical Activities - 1hb (19.29 m2)

No Asbestos

B00K - R0011 - Home Base (60.47 m2)

No Asbestos

B00K - R0012 - Home Base Store (5.79 m2)

No Asbestos

B00K - R0013 - External Stairs (8.6 m2)

No Asbestos

B00K - R0014 - External Stairs (19.26 m2)

No Asbestos

B00K - R1001 - External Movement (34.7 m2)

No Asbestos

B00K - R1002 - Practical Activities - 1hb (19.29 m2)

No Asbestos

B00K - R1003 - Home Base (60.47 m2)

No Asbestos

B00K - R1004 - Home Base Store (5.8 m2)

No Asbestos

B00K - R1005 - Withdrawal Space - 2hb (12.66 m2)

No Asbestos

B00K - R1006 - Practical Activities - 1hb (18.98 m2)

No Asbestos

B00K - R1007 - Home Base (60.92 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R1008 - Home Base Store (5.79 m2)						
No Asbestos						
B00K - R1009 - External Stairs (31.67 m2)						
No Asbestos						
B00K - R1010 - External Stairs (31.77 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10540 - Learning Unit - Standard With P.A.A. : Placement Date - 8/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 751 - D11901 - Learning Unit - ESL : Placement Date - 12/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

R2 - Esl

No Asbestos Found.

NS 250 - D12999 - Learning Unit - Single E.S.L./Store : Placement Date - 18/12/2013

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

OS 602 - D13699 - Learning Unit - Standard With P.A.A. : Placement Date - 12/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D13933 - Learning Unit - Standard/Withdrawal : Placement Date - 3/05/1996

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017