


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Koorawatha Public School (2326)
Region : Western NSW
State Electorate : Cootamundra
Local Government Area : Young

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Grencap-NAA : 08 - Dec - 2016

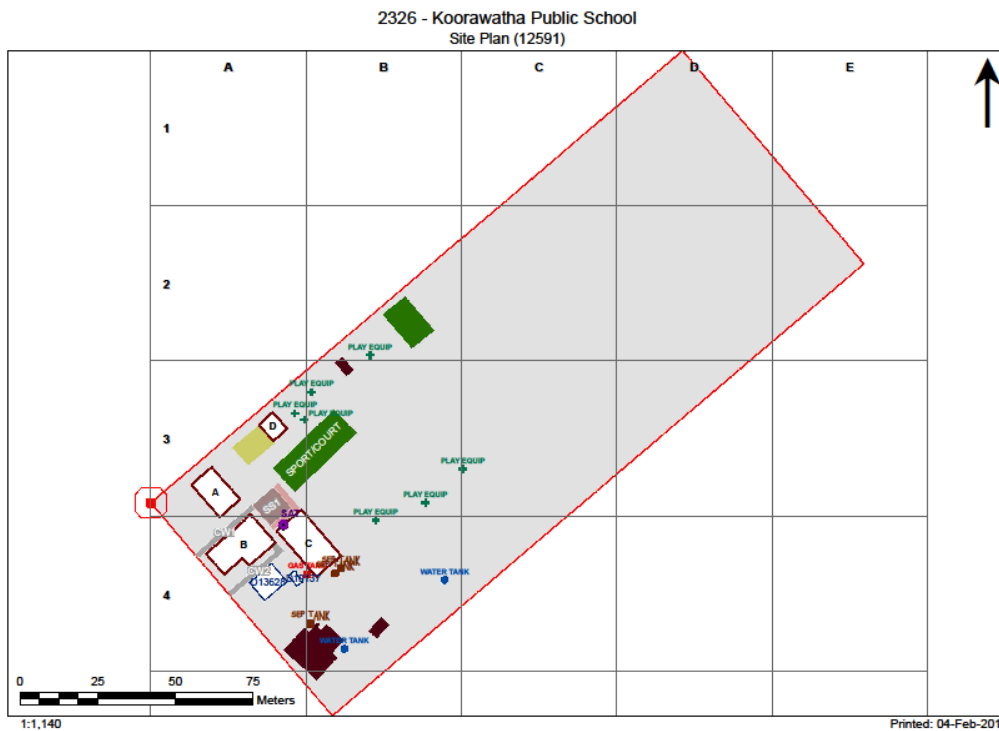

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Special Purpose - 1900 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 2326/B00B/R0008/In-fill-panel/S1	10m2	North, adjacent to Room 1	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole. Ceiling approx 2.5m high.					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Window Beading	Caulking Material 2326/B00B/Window Beading/S7					No Asbestos Detected

Interior**B00A - R0001 - External Movement**

Wall Linings Internal	Flat AC Sheeting 2326/B00A/R0001/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00A - R0002 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting 2326/B00A/R0004/Ceiling Structures/Linings/S2					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00A - R0003 - No Access

No Asbestos

B00A - R0004 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting 2326/B00A/R0004/Ceiling Structures/Linings/S2					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1887 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	Northeast & Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Height Restriction and obstructed							
In-fill-panel	Flat AC Sheeting	6m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)	
2326/B00B/R0008/In-fill-panel/S1					Chrysotile (white asbestos)		
Window Beading	Caulking Material	2326/B00B/Window Beading/S7				No Asbestos Detected	
Underfloor Voids - Packing to Floor Joists	No Asbestos Found						
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Electrical Hazard - Live							
Pitched Roof - Flat Ceiling - Void	No Asbestos Found						
Pitched Roof - Flat Ceiling -Void	Non Accessible Area						
- Main access to ceiling void via BR0002. Cannot access ; height restricte -Approx 5m high. Manhole adjacent wall.							

Interior**B00B - R0001 - Staff Room**

In-fill-panel	Flat AC Sheeting	2m	North	Good Condition (1)	Low (1)	Low Priority (2-3)	
2326/B00B/R0008/In-fill-panel/S1					Chrysotile (white asbestos)		
Window Beading	Caulking Material	2326/B00B/Window Beading/S7				No Asbestos Detected	

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Reading Area

No Asbestos

B00B - R0004 - External Movement

Electrical Mounting Board	Resinous Membrane	1Unit	NE & Above	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard - Live						

B00B - R0005 - Craft Store

Floor Coverings Res/Textile	Blue-green vinyl sheet	2326/B00B/R0005/Floor Coverings Res/Textile/S8				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive under blue-green vinyl sheet	2326/B00B/R0005/Floor Coverings Res/Textile/S9				No Asbestos Detected	

B00B - R0006 - Movement

Window Beading	Caulking Material	2326/B00B/Window Beading/S7				No Asbestos Detected	
----------------	-------------------	-----------------------------	--	--	--	-----------------------------	--

B00B - R0007 - Movement

Window Beading	Caulking Material	2326/B00B/Window Beading/S7				No Asbestos Detected	
----------------	-------------------	-----------------------------	--	--	--	-----------------------------	--

B00B - R0008 - General Storeroom

In-fill-panel	Flat AC Sheeting	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)	
2326/B00B/R0008/In-fill-panel/S1					Chrysotile (white asbestos)		
Window Beading	Caulking Material	2326/B00B/Window Beading/S7				No Asbestos Detected	

B00B - R0009 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R0010 - External Movement

No Asbestos

B00B - R0011 - Extetnal Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities/General Learning - 1968 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		
Underfloor Voids - Slab on Ground	No Asbestos Found					
Pitched Roof - Flat Ceiling	Non Accessible Area - No manhole.					
Gable Verge Lining	Flat AC Sheeting	20m	NW & SE	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/Gable Verge Lining/S10			Chrysotile (white asbestos)		

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	10m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

B00C - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/R0002/Partition Walls (Cubicles)/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

B00C - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/R0002/Partition Walls (Cubicles)/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

B00C - R0004 - Home Base

In-fill-panel	Flat AC Sheeting	4m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

B00C - R0005 - Principal

In-fill-panel	Flat AC Sheeting	2m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

B00C - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00C/R0006/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	1m	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2326/B00B/R0008/In-fill-panel/S1			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Adhesive		2326/B00C/R0006/Floor Coverings Res/Textile/S11			No Asbestos Detected
-----------------------------	----------	--	---	--	--	----------------------

B00C - R0007 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 2000 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - COLA

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00E - R0001 - Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Garden Shed

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00F - R0001 - Storage Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D10137 - Country Toilet - Reltc - Boys/Girls : Placement Date - 7/02/2005

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

OS 505 - D13628 - Admin Staff/Principal/Secure Store : Placement Date - 12/01/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R3 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	20 m2
---------	---------------	------------------	-------

R4 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R5 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017