


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kootingal Public School (2327)
Region : New England
State Electorate : Tamworth
Local Government Area : Tamworth

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Aug - 2016

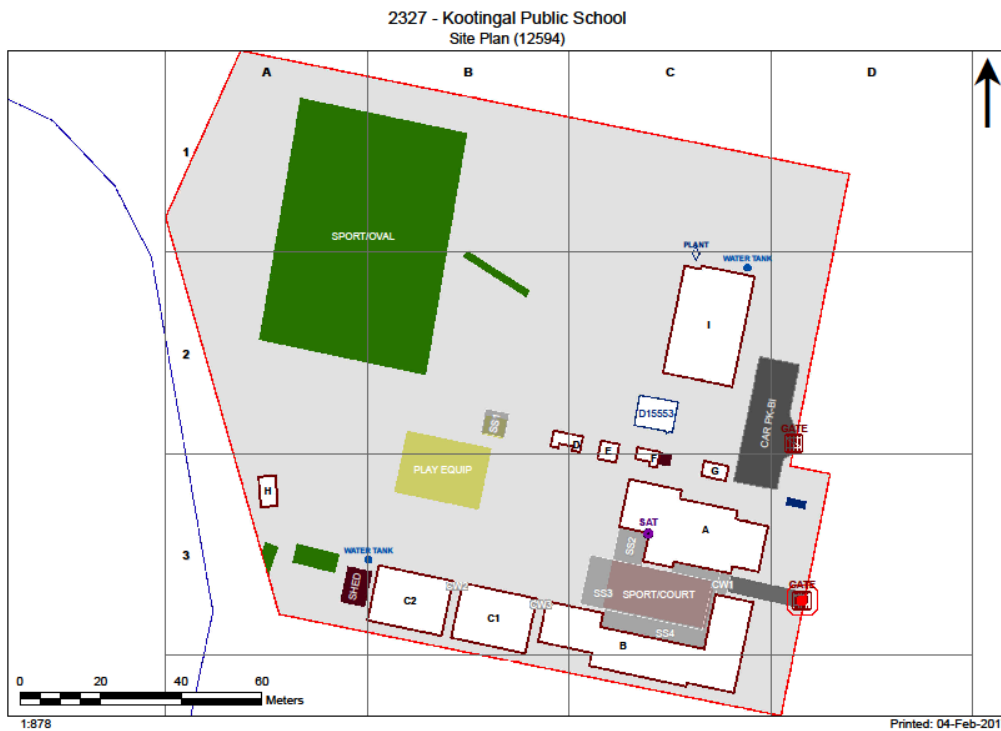

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1982 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	12m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00A - R0001 - Entry Vestibule

No Asbestos

B00A - R0002 - Principal

No Asbestos

B00A - R0003 - Sick Bay

No Asbestos

B00A - R0004 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00A/R0004/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00A - R0005 - Cleaning Distributed Store

No Asbestos

B00A - R0006 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00A/R0004/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00A - R0007 - Interview

No Asbestos

B00A - R0008 - Deputy Principal

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00A/R0009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00A - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00A/R0009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00A - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0015 - Communications Room

No Asbestos

B00A - R0016 - Library Office/Workroom

No Asbestos

B00A - R0017 - Seminar/Study

No Asbestos

B00A - R0018 - Reading Area

No Asbestos

B00A - R0020 - Staff Room

No Asbestos

B00A - R0021 - Uniform Shop

No Asbestos

B00A - R0022 - Disabled Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0023 - Uniform Shop						
No Asbestos						
B00A - R0024 - Duplicating Workroom						
No Asbestos						
B00A - R0025 - Clerical Office						
No Asbestos						
B00A - R0026 - Movement						
No Asbestos						
B00A - R0027 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00A/R0009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0028 - Movement						
No Asbestos						
B00A - R0029 - Reading Area						
No Asbestos						
B00A - R0030 - Special Programs Room						
No Asbestos						
B00A - R0031 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00A/R0032/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0032 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00A/R0032/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R0033 - K.L.A. Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Pupil Facilities - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	70m2	East & South elevations adj BR0023, North elevation adj BR0027	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/Eaves Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Home Base Store

No Asbestos

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb

No Asbestos

B00B - R0004 - Practical Activities - 1hb

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0008 - Craft Store

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0009 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0010 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0011 - Withdrawal Space - 1hb

No Asbestos

B00B - R0012 - Home Base

No Asbestos

B00B - R0013 - Home Base

No Asbestos

B00B - R0014 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00B - R0015 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0016 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00B - R0017 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00B - R0018 - Craft Store						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00B - R0019 - Cleaning Distributed Store						
No Asbestos						
B00B - R0020 - Cleaning Supplies						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00B - R0021 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00A/R0004/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)		
B00B - R0022 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00A/R0004/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)		
B00B - R0023 - Home Base						
Wall Linings Internal	Flat AC Sheeting	70m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0023/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0023/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		
B00B - R0024 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0024/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00B - R0025 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0025/Wall Linings Internal/S10				Chrysotile (white asbestos)		
B00B - R0026 - Movement						
No Asbestos						
B00B - R0027 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00B/R0027/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1948 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00D - R0001 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting	40m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					2327/B00D/R0001/Wall Linings Internal/S11	
					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1948 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00E - R0001 - Drinking Facilities

No Asbestos

B00E - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1948 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting	40m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2327/B00D/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1948 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - Sports Store

Floor Coverings Res/Textile	Vinyl Sheet	16m2	All surfaces	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)
2327/B00G/R0001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

B00G - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00I - R0001 - Communal Space

No Asbestos

B00I - R0002 - Raised Platform

No Asbestos

B00I - R0003 - Hall Chair Store

No Asbestos

B00I - R0004 - Communal/Performance Store

No Asbestos

B00I - R0005 - P.E. Store

No Asbestos

B00I - R0006 - Toilet - Lobby

No Asbestos

B00I - R0007 - Toilets - Girls

No Asbestos

B00I - R0008 - Sound Cupboard

No Asbestos

B00I - R0009 - Toilet - Lobby

No Asbestos

B00I - R0010 - Toilets - Boys

No Asbestos

B00I - R0011 - Cleaning Distributed Store

No Asbestos

B00I - R0012 - General Storeroom

No Asbestos

B00I - R0013 - Main Switch Board

No Asbestos

B00I - R0014 - Access Shower/Toilet/Change

No Asbestos

B00I - R0015 - Covered Outdoor Learning Area

No Asbestos

B00I - R0016 - Movement

No Asbestos

B00I - R0017 - Ramp

No Asbestos

B00I - R0018 - Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - General Learning - 1993 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0C1 - R0001 - Movement

No Asbestos

B0C1 - R0002 - Practical Activities - 1hb

No Asbestos

B0C1 - R0003 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C1 - R0004 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C1 - R0005 - Movement

No Asbestos

B0C1 - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C1 - R0007 - Movement

No Asbestos

B0C1 - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C1 - R0009 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C1 - R0010 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C2 - General Learning - 1993 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B0C2 - R0001 - Movement

No Asbestos

B0C2 - R0002 - Practical Activities - 1hb

No Asbestos

B0C2 - R0003 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C2 - R0004 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C2 - R0005 - Movement

No Asbestos

B0C2 - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C2 - R0007 - Movement

No Asbestos

B0C2 - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C2 - R0009 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0C2 - R0010 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 804 - D15553 - FSU : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		54 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		19 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017