


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kororo Public School (2330)
Region : North Coast
State Electorate : Coffs Harbour
Local Government Area : Coffs Harbour

Initial Survey : Noel Arnold & Associates : 09 - May - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Feb - 2017

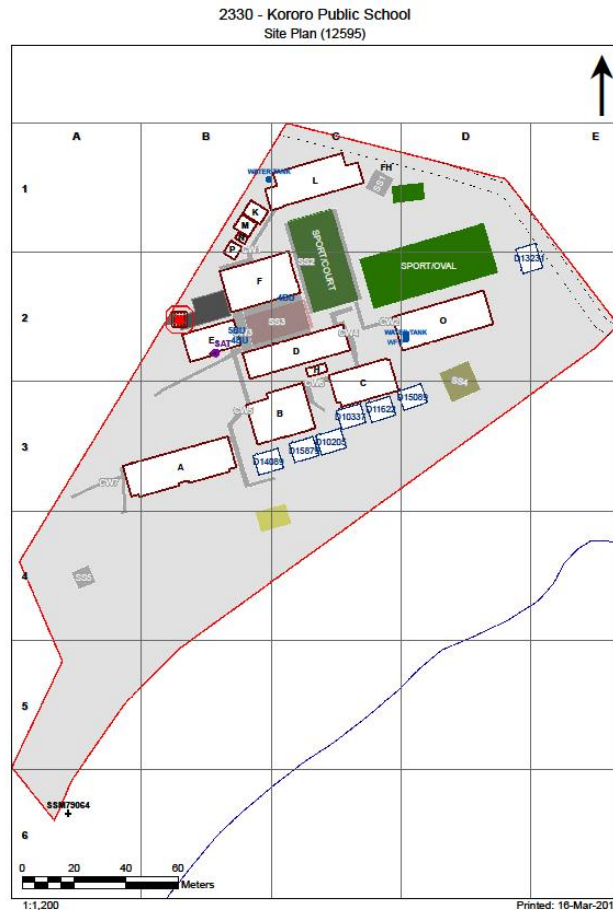

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1991 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00A - R0001 - General Storeroom**

No Asbestos

B00A - R0002 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0003 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0009 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0010 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0014 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0015 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0017 - Garden Store

No Asbestos

B00A - R0018 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0019 - Kiln Room

No Asbestos

B00A - R0020 - Cleaning Distributed Store

No Asbestos

B00A - R0021 - External Movement

No Asbestos

B00A - R0022 - Home Base

No Asbestos

B00A - R0023 - Practical Activities

No Asbestos

B00A - R0024 - Home Base

No Asbestos

B00A - R0025 - Practical Activities

No Asbestos

B00A - R0026 - Home Base

No Asbestos

B00A - R0027 - Practical Activities

No Asbestos

B00A - R0028 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0029 - Practical Activities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1982 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00B - R0004 - Communications Room

No Asbestos

B00B - R0005 - K.L.A. Store

No Asbestos

B00B - R0006 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 2330/B00B/R0008/Ceiling Structures/Linings/S1	No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2330/B00B/R0006/Wall Linings Internal/S3	No Asbestos Detected

B00B - R0007 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2330/B00B/R0008/Ceiling Structures/Linings/S1	No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2330/B00B/R0008/Wall Linings Internal/S2	No Asbestos Detected

B00B - R0011 - K.L.A. Store

No Asbestos

B00B - R0012 - Library Office/Workroom

No Asbestos

B00B - R0013 - Reading Area

No Asbestos

B00B - R0014 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1914 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00C - R0001 - Distribution Board Note: No inspection of live electrical installation.

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Home Base Store

No Asbestos

B00C - R0004 - Withdrawal Space - 1hb

No Asbestos

B00C - R0009 - Withdrawal Space - 1hb

No Asbestos

B00C - R0010 - Home Base Store

No Asbestos

B00C - R0011 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting	
	2330/B00B/R0006/Wall Linings Internal/S3	No Asbestos Detected

B00C - R0013 - Toilets - Boys

No Asbestos

B00C - R0014 - External Movement

No Asbestos

B00C - R0015 - Home Base

No Asbestos

B00C - R0016 - Practical Activities

No Asbestos

B00C - R0017 - Home Base

No Asbestos

B00C - R0018 - Practical Activities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1985 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00H/Eaves Linings/S4					Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet	15m2	South, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/In-fill-panel/S5					Chrysotile (white asbestos) , Amosite (brown Asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00D - R0001 - Cleaning Distributed Store**

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0004 - Special Programs Room

No Asbestos

B00D - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0006 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0007 - Home Base Store

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Home Base

No Asbestos

B00D - R0010 - Home Base Store

No Asbestos

B00D - R0011 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0012 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0013 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0013/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00D - R0015 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/R0013/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00D - R0017 - Main Switch Board

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00D - R0018 - General Storeroom

No Asbestos

B00D - R0019 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0008/Ceiling Structures/Linings/S1					

In-fill-panel	Compressed AC Sheet	12m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00D/In-fill-panel/S5					Chrysotile (white asbestos) , Amosite (brown Asbestos)

B00D - R0020 - Toilet - Lobby

No Asbestos

B00D - R0021 - Staff Toilet

No Asbestos

B00D - R0022 - Toilet - Lobby

No Asbestos

B00D - R0023 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration/Staff Facilities - 1915 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting 2330/B00E/Underfloor Voids/S11					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00E - R0003 - General Storeroom

No Asbestos

B00E - R0004 - Clerical Office

No Asbestos

B00E - R0005 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles 2330/B00E/R0005/Floor Coverings Res/Textile/S10					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00E - R0006 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles 2330/B00E/R0005/Floor Coverings Res/Textile/S10					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00E - R0007 - Principal

No Asbestos

B00E - R0008 - Entry Vestibule

No Asbestos

B00E - R0009 - Movement

No Asbestos

B00E - R0010 - Interview

No Asbestos

B00E - R0011 - Withdrawal Space - 1hb

No Asbestos

B00E - R0012 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2330/B00B/R0008/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00E - R0013 - Staff Study

No Asbestos

B00E - R0014 - Deputy Principal

No Asbestos

B00E - R0015 - Deputy Principal

No Asbestos

B00E - R0016 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00F - R0001 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0002 - Shower/Change

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0003 - Movement

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0004 - Raised Platform

No Asbestos

B00F - R0005 - Movement

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0006 - Cleaning Distributed Store

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0007 - Plant

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0008 - Shower/Change

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0009 - Toilets - Girls

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

Partition Walls (Cubicles) Compressed AC Sheet
2330/B00F/R0009/Partition Walls (Cubicles)/S9 **No Asbestos Detected**

B00F - R0010 - Hall Chair Store

No Asbestos

B00F - R0011 - Communal Space

No Asbestos

B00F - R0012 - Canteen Office/Store

No Asbestos

B00F - R0013 - Canteen Office/Store

No Asbestos

B00F - R0014 - General Storeroom

No Asbestos

B00F - R0015 - P.E. Store

No Asbestos

B00F - R0016 - Disabled Toilet

Wall Linings Internal Flat AC Sheeting
2330/B00F/R0005/Wall Linings Internal/S8 **No Asbestos Detected**

B00F - R0017 - Hall Chair Store

No Asbestos

B00F - R0018 - Toilets - Boys

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2330/B00F/R0005/Wall Linings Internal/S8					
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2330/B00F/R0009/Partition Walls (Cubicles)/S9					
B00F - R0019 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0008/Ceiling Structures/Linings/S1					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0006/Wall Linings Internal/S3					
B00F - R0020 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0008/Ceiling Structures/Linings/S1					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0006/Wall Linings Internal/S3					
B00F - R0021 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0008/Ceiling Structures/Linings/S1					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2330/B00B/R0006/Wall Linings Internal/S3					
B00F - R0022 - Canteen						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1985 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2330/B00H/Eaves Linings/S4				Chrysotile (white asbestos)	
Ceiling Void	Non Accessible Area - No Manhole in building.					

Interior

B00H - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2007 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - Sports Store

No Asbestos

B00K - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - External Movement	No Asbestos
B00L - R0002 - General Storeroom	No Asbestos
B00L - R0003 - External Stairs	No Asbestos
B00L - R0004 - Home Base	No Asbestos
B00L - R0005 - Practical Activities - 1hb	No Asbestos
B00L - R0006 - Withdrawal Space - 1hb	No Asbestos
B00L - R0007 - Home Base Store	No Asbestos
B00L - R0008 - Home Base Store	No Asbestos
B00L - R0009 - Home Base	No Asbestos
B00L - R0010 - Practical Activities - 1hb	No Asbestos
B00L - R0011 - Withdrawal Space - 2hb	No Asbestos
B00L - R0012 - Home Base	No Asbestos
B00L - R0013 - Practical Activities - 1hb	No Asbestos
B00L - R0014 - Home Base Store	No Asbestos
B00L - R0015 - External Stairs	No Asbestos
B00L - R0016 - General Storeroom	No Asbestos
B00L - R0017 - Distribution Board	Note: No inspection of live electrical installation.
B00L - R1001 - External Movement	No Asbestos
B00L - R1002 - External Stairs	No Asbestos
B00L - R1003 - Practical Activities - 1hb	No Asbestos
B00L - R1004 - Home Base	No Asbestos
B00L - R1005 - Home Base Store	No Asbestos
B00L - R1006 - Withdrawal Space - 1hb	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00L - R1007 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R1008 - Practical Activities - 1hb

No Asbestos

B00L - R1009 - Home Base Store

No Asbestos

B00L - R1010 - Home Base

No Asbestos

B00L - R1011 - Withdrawal Space - 2hb

No Asbestos

B00L - R1012 - Home Base

No Asbestos

B00L - R1013 - Practical Activities - 1hb

No Asbestos

B00L - R1014 - Home Base Store

No Asbestos

B00L - R1015 - External Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00M - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B000 - R0001 - Practical Activities - 1hb

No Asbestos

B000 - R0002 - Home Base Store

No Asbestos

B000 - R0003 - Home Base

No Asbestos

B000 - R0004 - Withdrawal Space - 2hb

No Asbestos

B000 - R0005 - Practical Activities - 1hb

No Asbestos

B000 - R0006 - Home Base

No Asbestos

B000 - R0007 - Home Base Store

No Asbestos

B000 - R0008 - Practical Activities - 1hb

No Asbestos

B000 - R0009 - Home Base Store

No Asbestos

B000 - R0010 - Home Base

No Asbestos

B000 - R0011 - Practical Activities - 1hb

No Asbestos

B000 - R0012 - Home Base Store

No Asbestos

B000 - R0013 - Home Base

No Asbestos

B000 - R0014 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0015 - Withdrawal Space - 2hb

No Asbestos

B000 - R0016 - External Movement

No Asbestos

B000 - R9001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 2013 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00P - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10205 - Learning Unit - Standard With P.A.A. : Placement Date - 14/07/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10337 - Learning Unit - Standard With P.A.A. : Placement Date - 6/06/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 602 - D11622 - Learning Unit - Standard With P.A.A. : Placement Date - 13/04/2010

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 602 - D13231 - Learning Unit - Standard With P.A.A. : Placement Date - 10/02/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 510 - D13311 - Staff Common Room : Placement Date - 17/12/2016

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Commonroom/staff room						
No Asbestos Found.						
R2 - Staff Toilet						
No Asbestos Found.						
R3 - Staff Toilet						
No Asbestos Found.						
R4 - Lobby						
No Asbestos Found.						
OS 602 - D14089 - Learning Unit - Standard With P.A.A. : Placement Date - 24/10/2014						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D15089 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 16/03/2007						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D15879 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 24/02/2003						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D17428 - Learning Unit - Standard With P.A.A. : Placement Date - 17/11/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017