


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Krumbach Public School (2333)
Region : North Coast
State Electorate : Myall Lakes
Local Government Area : Greater Taree

Initial Survey : Noel Arnold & Associates : 07 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

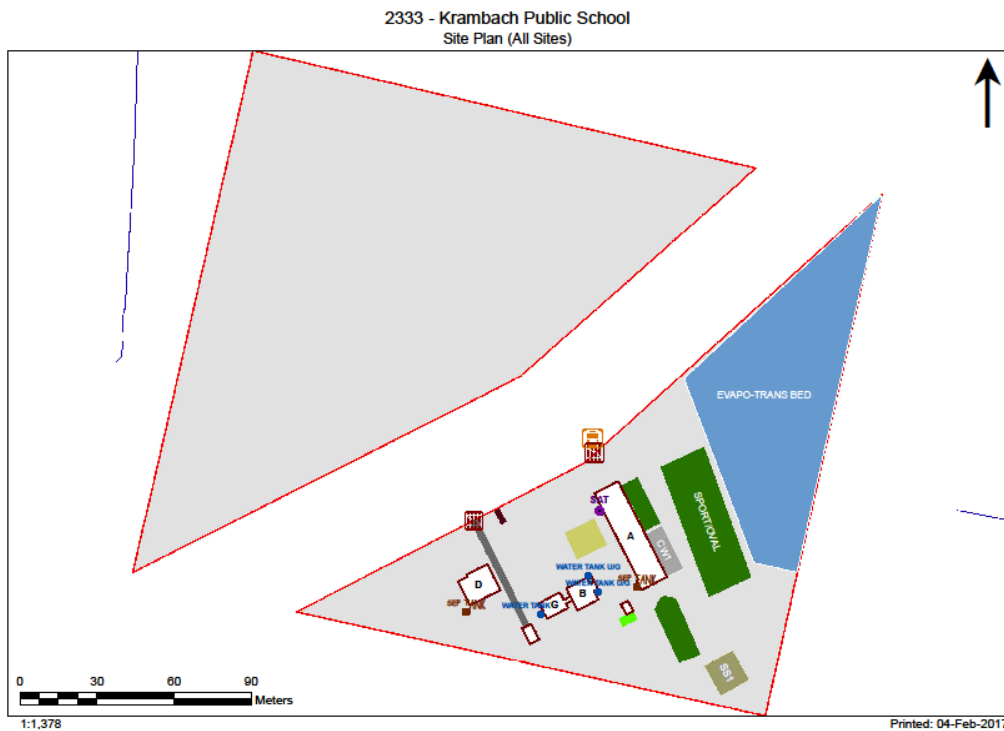

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/Gable Verge Lining/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	8m2	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/In-fill-panel/S6			Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	124m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	1m	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/In-fill-panel/S6			Chrysotile (white asbestos)		

B00A - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos)		

B00A - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos)		

B00A - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos)		

B00A - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos)		

B00A - R0006 - Staff Room

No Asbestos

B00A - R0007 - Movement

In-fill-panel	Flat AC Sheeting	8m	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/In-fill-panel/S6			Chrysotile (white asbestos)		

B00A - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0008/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00A - R0009 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00A/R0008/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00A - R0010 - Home Base

No Asbestos

B00A - R0011 - Home Base

No Asbestos

B00A - R0012 - Home Base Store

No Asbestos

B00A - R0013 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2333/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0014 - Principal						
No Asbestos						
B00A - R0015 - Entry Vestibule						
No Asbestos						
B00A - R0016 - Distribution Board					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board					
2333/B00A/R0016/Electrical Mounting Board/S14					No Asbestos Detected	
B00A - R0017 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2333/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Communal Facilities - 1890 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00B - R0001 - Sports Store

No Asbestos

B00B - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2333/B00B/R0002/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Special Programs Room

No Asbestos

B00B - R0004 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles				
2333/B00B/R0004/Floor Coverings Res/Textile/S8					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1940 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	8m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/Gable Verge Lining/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/Eaves Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2333/B00D/Ceiling Void/S12				Chrysotile (white asbestos)	
Underfloor Void	No Asbestos Found					

Interior**B00D - R0001 - Clerical Office**

No Asbestos

B00D - R0002 - Staff Kitchen

No Asbestos

B00D - R0003 - Duplicating Workroom

No Asbestos

B00D - R0004 - Cleaning Distributed Store

No Asbestos

B00D - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0005/In-fill-panel/S2				Chrysotile (white asbestos)	

B00D - R0006 - Staff Room

Manhole cover	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0010/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

B00D - R0007 - Store

No Asbestos

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - Staff Toilet

No Asbestos

B00D - R0010 - Staff Shower/Change

Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2333/B00D/R0010/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	

B00D - R0011 - Sick Bay

No Asbestos

B00D - R0012 - K.L.A. Store

No Asbestos

B00D - R0013 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2333/B00D/R0005/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Storage - 2005 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00F - R0003 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - Movement

No Asbestos

B00G - R0002 - Home Base

No Asbestos

B00G - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2009 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

B00H - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017