


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kulnura Public School (2334)
Region : Hunter/Central Coast
State Electorate : Gosford
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 28 - May - 2008
Register Issue Date : 22 - Mar - 2017

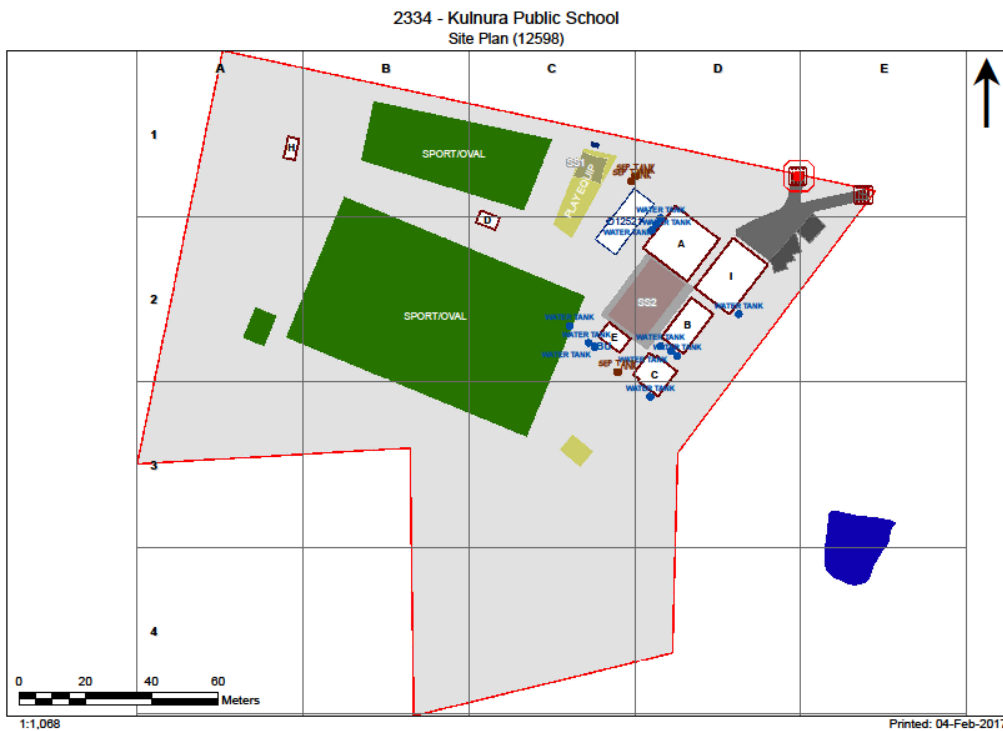

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00A - General Learning - 1986 - Brick/Veneer (Brick/Veneer)**Exterior**

Wall Cladding	Flat AC Sheeting 2334/B00A/R0001/Wall Cladding/S10					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00A - R0001 - External Movement**

Wall Cladding	Flat AC Sheeting 2334/B00A/R0001/Wall Cladding/S10					No Asbestos Detected
---------------	---	--	--	--	--	----------------------

B00A - R0002 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting 2334/B00A/R0002/Wall Linings Internal/S11					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2334/B00A/R0002/Ceiling Structures/Linings/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 2334/B00A/R0002/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00A - R0003 - Home Base Store

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - External Movement

Wall Cladding	Flat AC Sheeting 2334/B00A/R0001/Wall Cladding/S10					No Asbestos Detected
---------------	---	--	--	--	--	----------------------

B00A - R0006 - Withdrawal Space - 1hb

No Asbestos

B00A - R0007 - External Movement

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Sheet 2334/B00A/R0002/Floor Coverings Res/Textile/S13					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00A - R0010 - Home Base Store

No Asbestos

B00A - R0011 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1959 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00B - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2334/B00B/R0001/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	

B00B - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2334/B00B/R0001/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	Around sink	Good Condition (1)	Low (1)	Low Priority (2-3)
2334/B00B/R0002/Infill Panel Around kitchen Sink/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Home Base

Chalk Board	Flat AC Sheeting					
2334/B00B/R0003/Chalk Board/S9					No Asbestos Detected	

B00B - R0004 - External Movement

No Asbestos

B00B - R9001 - Cleaning Distributed Store

No Asbestos

B00B - R9002 - Sports Store

No Asbestos

B00B - R9003 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1959 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2334/B00C/Eaves Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00C - R0001 - Home Base

Chalk Board	Flat AC Sheeting					
	2334/B00C/R0001/Chalk Board/S4				No Asbestos Detected	

B00C - R0002 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2334/B00C/R0002/Wall Linings Internal/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting					
	2334/B00C/R0002/Ceiling Structures/Linings/S6				No Asbestos Detected	

B00C - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	2334/B00C/R0003/Ceiling Structures/Linings/S2				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1967 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1930 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior**B00E - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

2334/B00E/R0001/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)**B00E - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

2334/B00E/R0001/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00H - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - General Learning/Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior**B00I - R0001 - External Movement**

No Asbestos

B00I - R0002 - Reading Area

No Asbestos

B00I - R0003 - Library Office/Workroom

No Asbestos

B00I - R0004 - Communications Room

No Asbestos

B00I - R0005 - K.L.A. Store

No Asbestos

B00I - R0006 - Practical Activities - 1hb

No Asbestos

B00I - R0007 - Home Base

No Asbestos

B00I - R0008 - Home Base Store

No Asbestos

B00I - R0009 - Withdrawal Space - 1hb

No Asbestos

B00I - R0010 - Main Switch Board Cupboard

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 503 - D12521 - Admin Lib Staff/Principal/Clerk/Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	24 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R4 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R5 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2
---------	---------------	------------------	-------

R6 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R7 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	27 m2
---------	---------------	------------------	-------

R8 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	6 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017