


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kurrajong East Public School (2343)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 16 - May - 2008
Reviewed By : Grencap-NAA : 10 - Jun - 2015

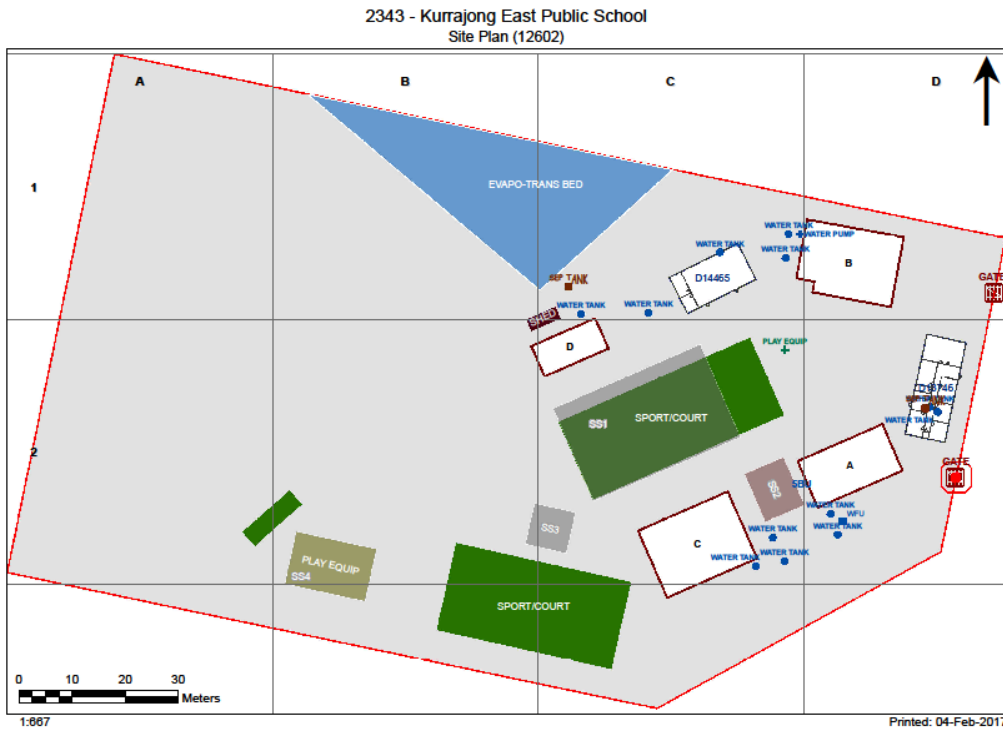

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Pupil Facilities - 1927 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - M0001 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - M0002 - Stairs

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - R0001 - Canteen Office/Store

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - R0002 - Canteen

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - R0003 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - R0007 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00A - R0008 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		
B00A - R0009 - Movement						
Wall Linings Internal	Flat AC Sheeting	4m2	O/S canteen entry at EDB	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	22m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00A - R0010 - Canteen						
Wall Linings Internal	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0011 - Stairs						
Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0010/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2343/B00A/R0002/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0004 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0006 - Practical Activities - 1hb

No Asbestos

B00B - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0008 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00C - R0001 - Practical Activities - 1hb

No Asbestos

B00C - R0002 - Practical Activities - 1hb

No Asbestos

B00C - R0003 - Withdrawal Space - 2hb

No Asbestos

B00C - R0004 - Home Base Store

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Home Base Store

No Asbestos

B00C - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 2013 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Toilets - Girls

No Asbestos

B00D - R0003 - Disabled Shower/Toilet

No Asbestos

B00D - R0004 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 502 - D13746 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 15/07/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2

R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
---------	---------------	------------------	--	--	--	------

R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2

OS 532 - D14465 - Library : Placement Date - 26/08/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2

Interior

R1 - Reading Area

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2

R2 - Library Office/Workroom

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

R3 - Communications Room

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017