


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kurrajong North Public School (2344)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

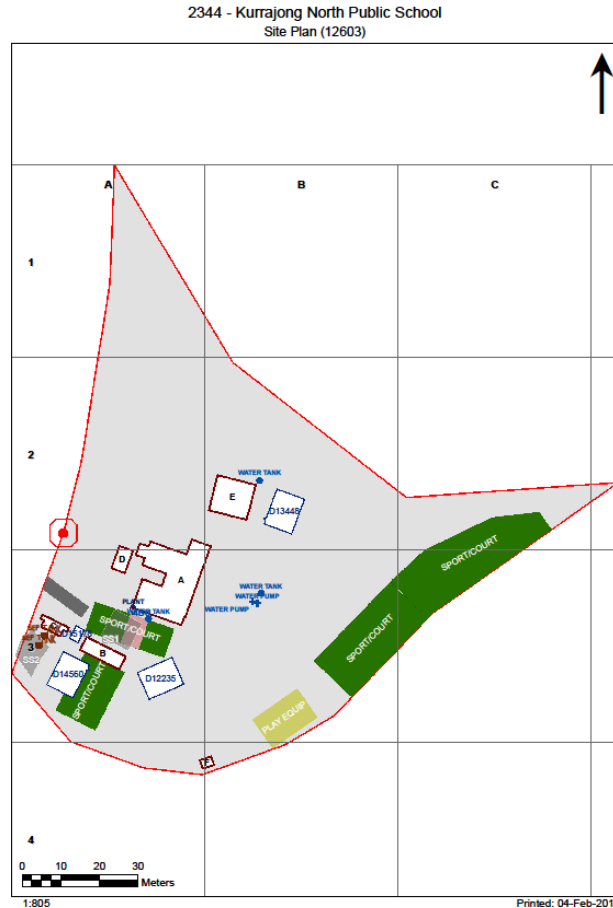

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1881 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00A/Wall Cladding/S2				Chrysotile (White asbestos) , Amosite (Brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Personal Effects Storage**

No Asbestos

B00A - R0002 - Home Base Store

No Asbestos

B00A - R0003 - K.L.A. Store

No Asbestos

B00A - R0004 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00A/R0004/Floor Coverings Res/Textile/S1				Chrysotile (White asbestos)	

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Sick Bay

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - Entry Vestibule

No Asbestos

B00A - R0011 - Clerical Office

No Asbestos

B00A - R0012 - Principal

No Asbestos

B00A - R0013 - Staff Kitchen

No Asbestos

B00A - R0014 - Staff Room

No Asbestos

B00A - R0015 - Staff Toilet

Wall Linings Internal	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00A/Wall Cladding/S2				Chrysotile (White asbestos) , Amosite (Brown asbestos)	

B00A - R0016 - Movement

Wall Linings Internal	Vinyl Tiles	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00A/Wall Cladding/S2				Chrysotile (White asbestos) , Amosite (Brown asbestos)	

B00A - R0017 - General Assistant/Bulk Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1920 - Timber (Timber)

Exterior

Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2344/B00B/Underfloor Voids/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	AC Fragments/Debris					No Asbestos Detected
	2344/B00B/Underfloor Voids/S6					
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1920 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2344/B00C/Eaves Linings/S3					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior

B00C - R0003 - Toilets - Girls

No Asbestos

B00C - R0004 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1920 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00A/Wall Cladding/S2			Chrysotile (White asbestos) , Amosite (Brown asbestos)		
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2344/B00D/Eaves Linings/S4			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Staff Kitchen

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - 2012 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12235 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D13448 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 18/01/2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 531 - D13764 - Library : Placement Date - 11/04/2016

Exterior

No Asbestos Found.

Interior

R1 - Entry/classroom

No Asbestos Found.

R2 - Reading Area/workroom

No Asbestos Found.

OS 601 - D14560 - Learning Unit - Standard/Withdrawal : Placement Date - 13/06/2002

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 844 - D15178 - Country Toilet - Reltc - Boys/Girls : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Interior						
R1 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2
R2 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017