


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Kyogle Public School (2349)
Region : North Coast
State Electorate : Lismore
Local Government Area : Kyogle

Initial Survey : Noel Arnold & Associates : 10 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Oct - 2015

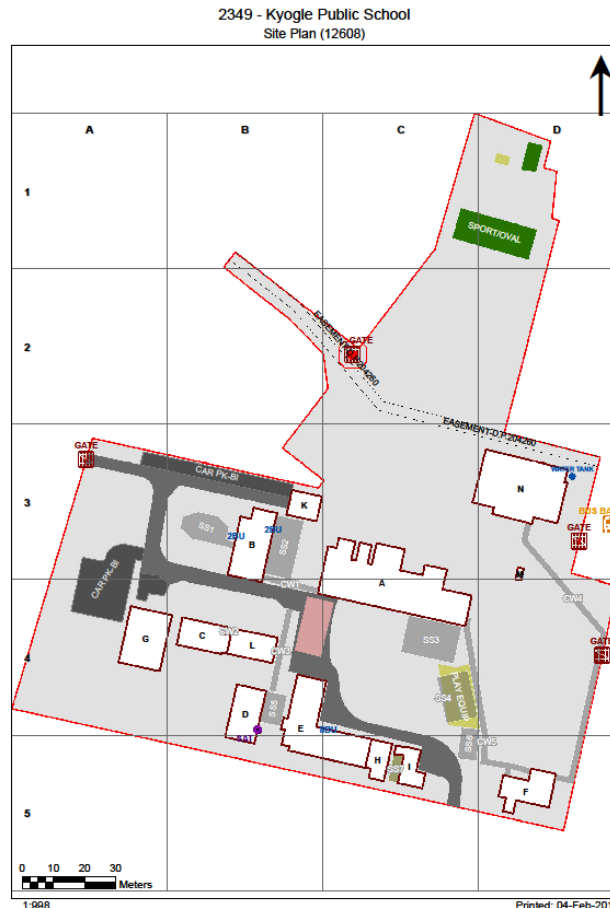

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1906 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	2349/B00A/Underfloor Voids - Packing to Floor Joists/S8					No Asbestos Detected

Interior

B00A - R0001 - Home Base (93.02 m2)

No Asbestos

B00A - R0002 - Withdrawal Space - 1hb (7.48 m2)

No Asbestos

B00A - R0003 - General Storeroom (10.68 m2)

No Asbestos

B00A - R0004 - Staff Room (49.42 m2)

No Asbestos

B00A - R0005 - Seminar/Study (46.63 m2)

No Asbestos

B00A - R0006 - Reading Area (72.4 m2)

No Asbestos

B00A - R0007 - Library Office/Workroom (21.34 m2)

No Asbestos

B00A - R0008 - External Movement (129.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	2349/B00A/R0008/Ceiling Structures/Linings/S3					No Asbestos Detected

B00A - R0010 - Clerical Office (29.85 m2)

No Asbestos

B00A - R0013 - Security Store (20.34 m2)

No Asbestos

B00A - R0014 - Principal (15.69 m2)

No Asbestos

B00A - R0015 - Deputy Principal (14.21 m2)

No Asbestos

B00A - R0016 - Staff Toilet (4.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2349/B00A/R0016/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0017 - Staff Toilet (4.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2349/B00A/R0016/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0018 - External Movement (2.48 m2)

No Asbestos

B00A - R0019 - Movement (4.63 m2)

No Asbestos

B00A - R0020 - Sick Bay (10.16 m2)

No Asbestos

B00A - R0021 - Sick Bay - Shower/Toilet (5.37 m2)

No Asbestos

B00A - R0022 - Interview (18.67 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0023 - Movement (80.43 m2)						
No Asbestos						
B00A - R0024 - Movement (34.97 m2)						
No Asbestos						
B00A - R9001 - Cleaning Distributed Store (3.48 m2)						
No Asbestos						
B00A - R9002 - General Assistant/Bulk Store (31.37 m2)						
No Asbestos						
B00A - R9003 - Garden Store (7.02 m2)						
No Asbestos						
B00A - R9004 - Cleaning Distributed Store (4.13 m2)						
No Asbestos						
B00A - R9005 - General Assistant/Bulk Store (7.24 m2)						
No Asbestos						
B00A - R9006 - Movement (3.03 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	24m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00B/Eaves Linings/S9					Chrysotile (white asbestos)

Interior**B00B - R0001 - External Movement (9.56 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2349/B00B/R0007/Ceiling Structures/Linings/S6					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0002 - Distribution Board (1.01 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Canteen (23.91 m2)

No Asbestos

B00B - R0004 - Staff Toilet (5.17 m2)

No Asbestos

B00B - R0005 - Canteen Office/Store (3.98 m2)

No Asbestos

B00B - R0008 - Performance Store (39.74 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2349/B00B/R0007/Ceiling Structures/Linings/S6					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0009 - Movement (104.68 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2349/B00B/R0009/Ceiling Structures/Linings/S35					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0010 - Movement (9.34 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2349/B00B/R0009/Ceiling Structures/Linings/S35					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0011 - External Stairs (0.63 m2)

No Asbestos

B00B - R1001 - External Movement (50.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00B/R1001/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)

B00B - R1002 - Home Base (55.73 m2)

No Asbestos

B00B - R1003 - Practical Activities - 1hb (19.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2349/B00B/R1003/Floor Coverings Res/Textile/S5					

B00B - R1004 - Practical Activities - 1hb (19.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2349/B00B/R1003/Floor Coverings Res/Textile/S5					

B00B - R1005 - Home Base (55.49 m2)

No Asbestos

B00B - R1006 - External Stairs (13.97 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R9001 - Main Switch Board (12.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1951 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	2349/B00C/Underfloor Voids - Packing to Floor Joists/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	Debris - Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2349/B00C/Underfloor Voids/S10			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00C - R0001 - Practical Activities - 1hb (16.87 m2)

No Asbestos

B00C - R0002 - Home Base (43.87 m2)

No Asbestos

B00C - R0003 - Practical Activities - 1hb (16.69 m2)

No Asbestos

B00C - R0004 - Home Base (43.73 m2)

No Asbestos

B00C - R0005 - Personal Effects Storage (10.07 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1928 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids	Debris - Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2349/B00D/Underfloor Voids/S12			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00D - R0001 - Seminar/Study (14.45 m2)

No Asbestos

B00D - R0002 - External Movement (6.47 m2)

No Asbestos

B00D - R0003 - Home Base Store (7.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles				
	2349/B00A/R0016/Floor Coverings Res/Textile/S4	No Asbestos Detected			

B00D - R0004 - Movement (6.63 m2)

No Asbestos

B00D - R0005 - Toilets - Boys/Girls (4.81 m2)

No Asbestos

B00D - R0006 - Practical Activities - 1hb (5 m2)

No Asbestos

B00D - R0007 - Home Base (74.76 m2)

No Asbestos

B00D - R0008 - Home Base (31.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1928 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids	Debris - Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2349/B00E/Underfloor Voids/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00E - R0001 - Movement (47.02 m2)

No Asbestos

B00E - R0002 - Withdrawal Space - 1hb (13.37 m2)

No Asbestos

B00E - R0003 - External Movement (4.03 m2)

No Asbestos

B00E - R0004 - Home Base (45.89 m2)

No Asbestos

B00E - R0006 - Home Base (47.23 m2)

No Asbestos

B00E - R0007 - Deputy Principal (12.78 m2)

No Asbestos

B00E - R0008 - Home Base (47.01 m2)

No Asbestos

B00E - R0009 - Interview (11.02 m2)

No Asbestos

B00E - R0010 - Home Base (47.13 m2)

No Asbestos

B00E - R0011 - Movement (47.8 m2)

No Asbestos

B00E - R0012 - Withdrawal Space - 1hb (23.44 m2)

No Asbestos

B00E - R0013 - Withdrawal Space - 1hb (22.85 m2)

No Asbestos

B00E - R9001 - General Storeroom (4.58 m2)

No Asbestos

B00E - R9002 - Cleaning Distributed Store (199.6 m2)

New Interior



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1928 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	>1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	2349/B00F/Underfloor Voids - Packing to Floor Joists/S14				Chrysotile (white asbestos)	

Interior

B00F - R0001 - Practical Activities - 1hb (9.78 m2)

No Asbestos

B00F - R0002 - Home Base (81.78 m2)

No Asbestos

B00F - R0003 - Staff Room Annexe (6.77 m2)

No Asbestos

B00F - R0004 - Toilets - Boys/Girls (2.71 m2)

No Asbestos

B00F - R0005 - Cleaning Supplies (12.98 m2)

No Asbestos

B00F - R0006 - External Movement (5.54 m2)

No Asbestos

B00F - R9001 - Special Programs Room (52.5 m2)

No Asbestos

B00F - R9002 - External Movement (32.52 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1993 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - External Movement (32.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2349/B00G/R0001/Ceiling Structures/Linings/S21	No Asbestos Detected
----------------------------	--	----------------------

B00G - R0002 - Practical Activities - 1hb (14.21 m2)

No Asbestos

B00G - R0003 - Home Base (59.86 m2)

No Asbestos

B00G - R0004 - Movement (14.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2349/B00G/R0004/Ceiling Structures/Linings/S22	No Asbestos Detected
----------------------------	--	----------------------

B00G - R0005 - Withdrawal Space - 1hb (11.51 m2)

No Asbestos

B00G - R0006 - Home Base Store (5.38 m2)

No Asbestos

B00G - R0007 - Home Base Store (5.4 m2)

No Asbestos

B00G - R0008 - Practical Activities - 1hb (14.18 m2)

No Asbestos

B00G - R0009 - Home Base (59.89 m2)

No Asbestos

B00G - R0010 - Movement (14.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2349/B00G/R0010/Ceiling Structures/Linings/S23	No Asbestos Detected
----------------------------	--	----------------------

B00G - R0011 - Distribution Board (0.3 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1951 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/Eaves Linings/S15			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00H - R0001 - Toilets - Boys (27.77 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2349/B00H/R0001/Partition Walls (Cubicles)/S1					
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2349/B00H/R0001/Ceiling Structures/Linings/S24					

B00H - R0002 - Toilets - Girls (28.56 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2349/B00H/R0001/Partition Walls (Cubicles)/S1					
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2349/B00H/R0002/Ceiling Structures/Linings/S25					

B00H - R0003 - External Movement (17.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2349/B00H/R0003/Ceiling Structures/Linings/S26					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - Building Services - 1951 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B001 - R0002 - General Storeroom (15.87 m2)**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/R0002/Ceiling Structures/Linings/S27			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0003 - General Storeroom (2.83 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	North, East, West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/R0003/Ceiling Structures/Linings/S28			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0004 - General Storeroom (1.31 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	North, East, West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/R0004/Ceiling Structures/Linings/S29			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0009 - Sports Store (7.77 m2)

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/R0009/Ceiling Structures/Linings/S30			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0010 - Sports Store (3.61 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B00H/R0001/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2349/B001/R0010/Ceiling Structures/Linings/S31			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B001 - R0011 - Special Programs Room (36 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2349/B00H/R0001/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2349/B00I/R0011/Ceiling Structures/Linings/S32				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00I - R0012 - External Movement (8.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2349/B00K/Eaves Linings/S17					Chrysotile (white asbestos)	

Interior

B00K - R0001 - Toilets - Boys (26.22 m2)

No Asbestos

B00K - R0002 - Toilets - Girls (26.28 m2)

No Asbestos

B00K - R0003 - External Movement (14.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2349/B00K/R0003/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1930 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	2349/B00L/Underfloor Voids - Packing to Floor Joists/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor voids	Debris - Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2349/B00L/Underfloor voids/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00L - R0002 - Home Base (46.84 m2)

No Asbestos

B00L - R0003 - Practical Activities - 1hb (11.07 m2)

No Asbestos

B00L - R0004 - Home Base (46.84 m2)

No Asbestos

B00L - R0005 - Movement (8.05 m2)

No Asbestos

B00L - R0007 - Toilet - Lobby (1.49 m2)

Wall Linings Internal	Flat AC Sheeting	2349/B00L/R0007/Wall Linings Internal/S34				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00L - R0008 - Staff Toilet (2.07 m2)

Wall Linings Internal	Flat AC Sheeting	2349/B00L/R0007/Wall Linings Internal/S34				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - No Access (6.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00N - R0001 - Communal Space (237.99 m2)

No Asbestos

B00N - R0002 - Hall Chair Store (9.53 m2)

No Asbestos

B00N - R0003 - Communal/Performance Store (9.53 m2)

No Asbestos

B00N - R0004 - P.E. Store (13.05 m2)

No Asbestos

B00N - R0005 - Toilet - Lobby (2.34 m2)

No Asbestos

B00N - R0006 - Toilets - Girls (7.27 m2)

No Asbestos

B00N - R0007 - Sound Cupboard (2.06 m2)

No Asbestos

B00N - R0008 - Toilet - Lobby (3.35 m2)

No Asbestos

B00N - R0009 - Toilets - Boys (5.76 m2)

No Asbestos

B00N - R0010 - Cleaning Distributed Store (3.56 m2)

No Asbestos

B00N - R0011 - Plant (1.61 m2)

No Asbestos

B00N - R0012 - Distribution Board (3.37 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0013 - Access Shower/Toilet (6.72 m2)

No Asbestos

B00N - R0014 - Covered Outdoor Learning Area (151.37 m2)

No Asbestos

B00N - R0015 - External Movement (27.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2349_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017