


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kahibah Public School (3874)
Region : Hunter/Central Coast
State Electorate : Charlestown
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 28 - May - 2008
Reviewed By : Greencap-NAA : 24 - Jun - 2015

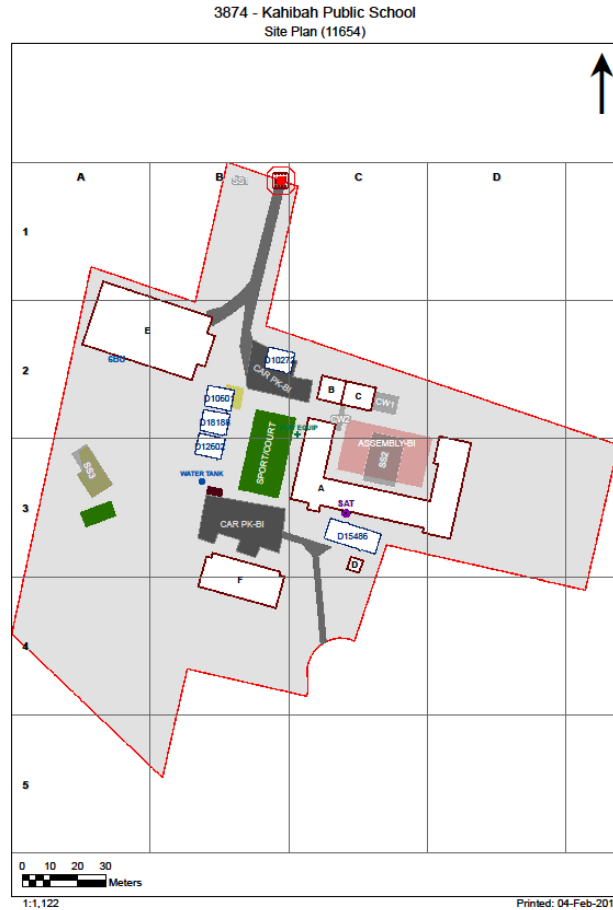

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Administration - 1956 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/Eaves Linings/S2					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3874/B00A/Underfloor Voids/S20					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Millboard					
	3874/B00A/Underfloor Voids/S21					No Asbestos Detected

Interior**B00A - R0001 - Home Base Store**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0002 - Practical Activities - 1hb

No Asbestos

B00A - R0003 - Home Base

Heater Surround	Flat AC Sheeting	1Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0042/In-fill-panel/S3					Chrysotile (white asbestos)

B00A - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	3874/B00A/R0005/Partition Walls (Cubicles)/S15					

B00A - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	3874/B00A/R0005/Partition Walls (Cubicles)/S15					

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	28m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00A - R0007 - Home Base

Wall Linings Internal	Flat AC Sheeting	10m2	South, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)

Heater Surround	Flat AC Sheeting	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0042/In-fill-panel/S3					Chrysotile (white asbestos)

B00A - R0008 - Home Base

Wall Linings Internal	Flat AC Sheeting	25m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)

Heater Surround	Flat AC Sheeting	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0042/In-fill-panel/S3					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0009 - Home Base						
Heater Surround	Flat AC Sheeting	2Unit(s)	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0042/In-fill-panel/S3					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)
B00A - R0010 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3874/B00A/R0010/Wall Linings Internal/S14					
B00A - R0011 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)
Infil panel	Flat AC Sheeting					No Asbestos Detected
	3874/B00A/R0011/Infil panel/S22					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3874/B00A/R0011/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	3874/B00A/R0011/Floor Coverings Res/Textile/S24					
B00A - R0012 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
B00A - R0013 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3874/B00A/R0022/Floor Coverings Res/Textile/S8					
B00A - R0014 - Staff Room Annexe						
Wall Linings Internal	Flat AC Sheeting	20m2	North, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0015 - Home Base Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6			Chrysotile (white asbestos)		
B00A - R0016 - Home Base						
Wall Linings Internal	Flat AC Sheeting	60m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
B00A - R0017 - Home Base						
Wall Linings Internal	Flat AC Sheeting	60m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
B00A - R0018 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0019 - Library Office/Workroom						
Floor Coverings Res/Textile	Vinyl Sheet					
	3874/B00A/R0022/Floor Coverings Res/Textile/S8			No Asbestos Detected		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
B00A - R0020 - Home Base						
Wall Linings Internal	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
B00A - R0021 - K.L.A. Store						
Wall Linings Internal	Flat AC Sheeting	20m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
B00A - R0022 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Sheet					
	3874/B00A/R0022/Floor Coverings Res/Textile/S8			No Asbestos Detected		
Wall Linings Internal	Flat AC Sheeting	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
B00A - R0023 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	3874/B00A/R0040/Floor Coverings Res/Textile/S4				No Asbestos Detected	
B00A - R0024 - Clerical Office						
Wall Linings Internal	Flat AC Sheeting	20m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0023/Wall Linings Internal/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00A - R0025 - Entry Vestibule						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3874/B00A/R0011/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	3874/B00A/R0011/Floor Coverings Res/Textile/S24				No Asbestos Detected	
B00A - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0026/Wall Linings Internal/S6				Chrysotile (white asbestos)	
B00A - R0027 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	3874/B00A/R0011/Floor Coverings Res/Textile/S24				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3874/B00A/R0011/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)	
B00A - R0028 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3874/B00A/R0040/Floor Coverings Res/Textile/S4				No Asbestos Detected	
B00A - R0029 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	3874/B00A/R0034/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0030 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
	3874/B00A/R0034/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0031 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
	3874/B00A/R0034/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0032 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3874/B00A/R0040/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0033 - Deputy Principal						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3874/B00A/R0040/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0034 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
	3874/B00A/R0034/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R0035 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0036 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0037 - Home Base						
No Asbestos						
B00A - R0038 - Home Base Store						
No Asbestos						
B00A - R0039 - General Storeroom						
No Asbestos						
B00A - R0040 - Movement						
Floor Coverings Res/Textile	Vinyl Sheet					
	3874/B00A/R0040/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0041 - Home Base Store						
No Asbestos						
B00A - R0042 - Home Base						
No Asbestos						
B00A - R0043 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R0036/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0044 - Distribution Board						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R9001 - Special Programs Room						
Ceiling Structures/Linings	Flat AC Sheeting	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00A/R9001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
B00A - R9002 - Craft Store						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R9003 - Kiln Room						
No Asbestos						
B00A - R9005 - General Storeroom						
No Asbestos						
B00A - R9006 - Sports Store						
No Asbestos						
B00A - R9008 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00B/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00B/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00B - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0003 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0004 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00B/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00C - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0003/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

B00C - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3874/B00C/R0003/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1954 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3874/B00D/Eaves Linings/S18					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 3874/B00D/Wall Cladding/S19					No Asbestos Detected
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 2003 - Concrete (Concrete)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - Movement**

No Asbestos

B00E - R0002 - Laundry - Type 2

No Asbestos

B00E - R0003 - Canteen

No Asbestos

B00E - R0004 - Disabled Toilet

No Asbestos

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Toilets - Girls

No Asbestos

B00E - R0007 - Toilets - Boys

No Asbestos

B00E - R0008 - Movement

No Asbestos

B00E - R0009 - Communal Space

No Asbestos

B00E - R0010 - Raised Platform

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - Movement

No Asbestos

B00F - R0003 - Staff Toilet

No Asbestos

B00F - R0004 - Cleaning Distributed Store

No Asbestos

B00F - R0005 - Main Switch Board

No Asbestos

B00F - R0006 - Reading Area

No Asbestos

B00F - R0007 - K.L.A. Store

No Asbestos

B00F - R0008 - Communications Room

No Asbestos

B00F - R0009 - Library Office/Workroom

No Asbestos

B00F - R0010 - Special Programs Room

No Asbestos

B00F - R0011 - Special Programs Store

No Asbestos

B00F - R9001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10272 - Learning Unit - Standard/Withdrawal : Placement Date - 16/02/2000

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D10601 - Learning Unit - Standard With P.A.A. : Placement Date - 19/01/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D12602 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 8/11/2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store


No Asbestos Found.

OS 502 - D15486 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 20/04/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

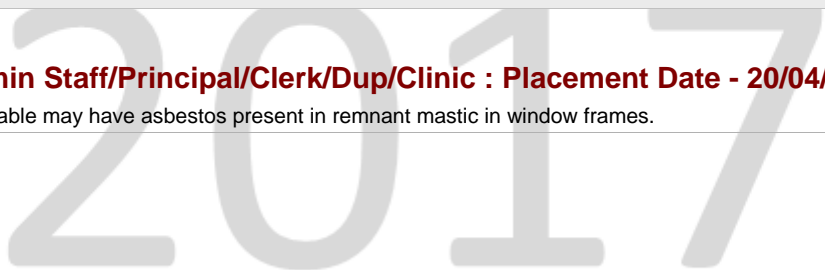

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Clerical Office						
No Asbestos Found.						
R10 - Store						
No Asbestos Found.						
R2 - Security Store						
No Asbestos Found.						
R3 - Duplicating Wookroom						
No Asbestos Found.						
R4 - Clinic-Waiting						
No Asbestos Found.						
R5 - Staff Room						
No Asbestos Found.						
R6 - Principal						
No Asbestos Found.						
R7 - Staff Toilet						
No Asbestos Found.						
R8 - Staff Toilet						
No Asbestos Found.						
R9 - Entry						
No Asbestos Found.						
OS 603 - D18188 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 7/12/2005						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3874_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017