


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kapooka Public School (3923)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Wagga Wagga

Initial Survey : Noel Arnold & Associates : 01 - May - 2008
Reviewed By : Grencap-NAA : 02 - Sep - 2016

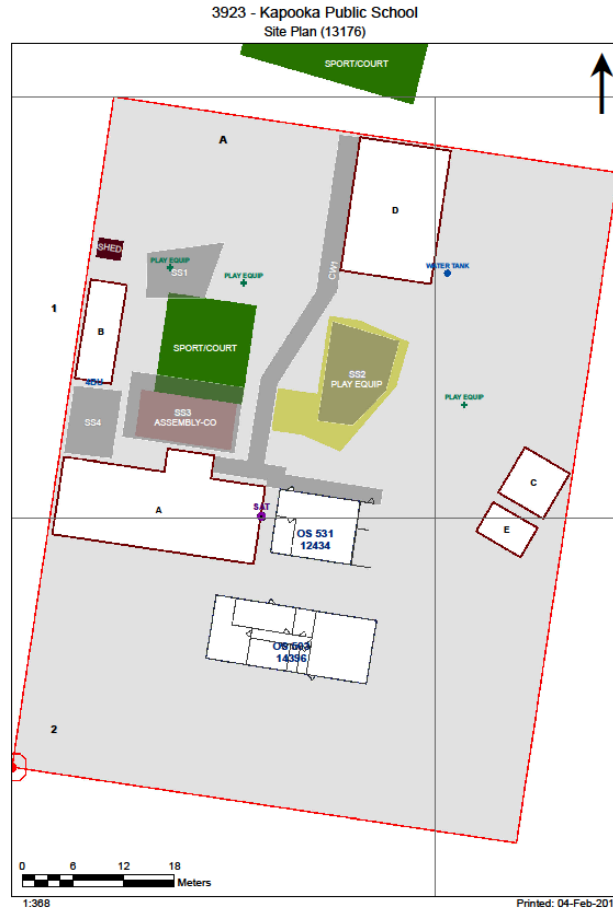

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1962 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/Eaves Linings/S6					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Home Base**

Heater Surround	Compressed AC Sheet	1Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0001/Backing to heater/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Resinous Membrane	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00A - R0002 - Home Base Store

Flue	Fibre Cement Pipe	3m	Stored	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0002/Old heater flu. (not in use)/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0003 - Home Base Store

No Asbestos

B00A - R0004 - Home Base

Heater Surround	Compressed AC Sheet	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0001/Backing to heater/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Clerical Office

Floor Coverings Res/Textile	Adhesive	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Resinous Membrane	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00A - R0007 - Staff Toilet

No Asbestos

B00A - R0008 - Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3923/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Resinous Membrane	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00A - R0009 - Entry Vestibule						
Floor Coverings Res/Textile	Adhesive	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Resinous Membrane	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00A - R0010 - Movement						
No Asbestos						
B00A - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0011/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00A - R0012 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Resinous Membrane	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3923/B00A/R0008/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1962 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3923/B00B/Eaves Linings/S9	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Encapsulated Insulation material within unit 3923/B00B/Ceiling Voids/S8					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3923/B00B/Gable Verge Lining/S10	20m	North & South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00B - R0001 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 3923/B00B/R0001/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--------------------------------------------------------------	--	--	--	--	-----------------------------

B00B - R0002 - Movement

Wall Linings Internal	Flat AC Sheeting 3923/B00B/R0001/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--------------------------------------------------------------	--	--	--	--	-----------------------------

B00B - R0003 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 3923/B00B/R0001/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--------------------------------------------------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Shed - 1962 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00C - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0002 - Library Office/Workroom

No Asbestos

B00D - R0003 - Communications Room

No Asbestos

B00D - R0004 - K.L.A. Store

No Asbestos

B00D - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - P.E. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 531 - D12434 - Library : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry/classroom

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		63 m2

R2 - Reading Area/workroom

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

OS 503 - D14396 - Admin Lib Staff/Principal/Clerk/Store : Placement Date - 23/01/1996

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		24 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R4 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R5 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2
---------	---------------	------------------	--	-------

R6 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R7 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		27 m2
---------	---------------	------------------	--	-------

R8 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		6 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017