

# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kingscliff Public School (4054)


**Region :** North Coast

**State Electorate :** Tweed

**Local Government Area :** Tweed

**Initial Survey :** Noel Arnold & Associates : 27 - May - 2008

**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

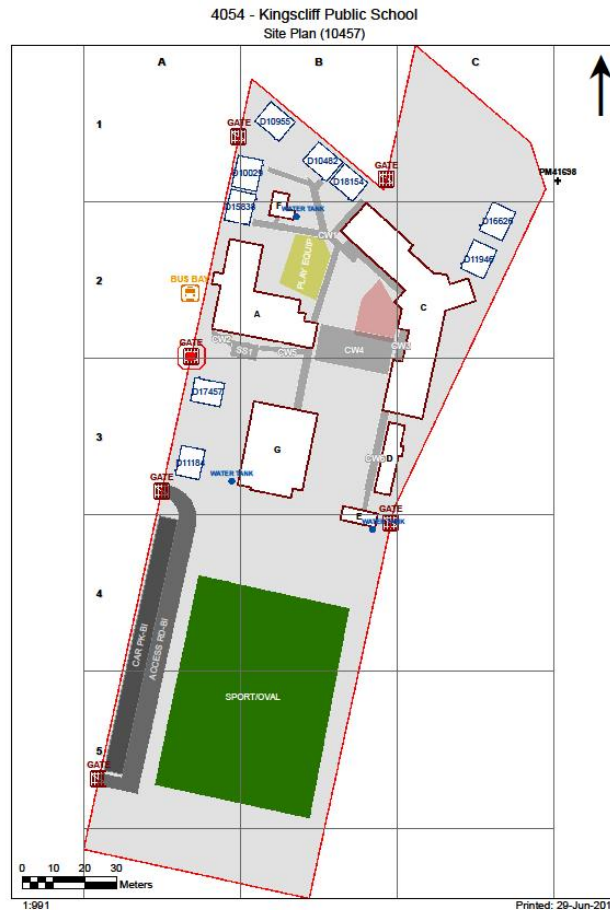

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1957 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	70m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4054/B00A/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
Infill panel under windows	Flat AC Sheeting	60m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4054/B00A/Infill panel under windows/S10					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00A - R0001 - Duplicating Workroom (31.88 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0002 - Sick Bay (10.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00A/R0002/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>

**B00A - R0003 - Movement (10.33 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0004 - Clerical Office (19.31 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0005 - Distribution Board (1.78 m2)** Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4054/B00A/R0005/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Security Store (7.34 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00A/R0002/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>

**B00A - R0007 - Security Store (4.24 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0008 - Entry Vestibule (17.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	4054/B00A/R0011/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0009 - Movement (53.33 m2)**

Infill panels under windows	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4054/B00A/R0009/Infill panels under windows/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0010 - Principal (18.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0011 - Movement (3.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0012 - General Storeroom (11.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0013 - Interview (20.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0014 - Staff Toilet (3.98 m2)</b>						
No Asbestos						
<b>B00A - R0015 - Entry Vestibule (7.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0016 - Cleaning Distributed Store (4.61 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Movement (60.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0018 - Interview (12.86 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Deputy Principal (12.89 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Deputy Principal (12.82 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Staff Toilet (6.44 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Staff Toilet (6.41 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Movement (17.24 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Sports Store (16.81 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Practical Activities - 1hb (20.16 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Home Base (60.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0027 - Staff Room (56.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite		4054/B00A/R0011/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0028 - Garden Store (4.24 m2)</b>						
No Asbestos						
<b>B00A - R0029 - External Movement (10.74 m2)</b>						
Wall lining to Front Entrance Sign	Flat AC Sheeting					
4054/B00A/R0029/Wall lining to Front Entrance Sign/S13					<b>No Asbestos Detected</b>	
<b>B00A - R0030 - Stairs (1.96 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Stairs (3.98 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Home Base (56.92 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Movement (56.5 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4054/B00A/R1002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
Infill panels under windows	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4054/B00A/R1002/Infill panels under windows/S14					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R1003 - Home Base Store (5.78 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Distribution Board (1.17 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1005 - Practical Activities - 1hb (14.08 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Home Base Store (7.82 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Home Base (57.18 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Toilets - Boys (4.74 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Toilets - Girls (4.18 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Cleaning Distributed Store (2.58 m2)</b>						
No Asbestos						
<b>B00A - R1014 - Library Office/Workroom (23.98 m2)</b>						
No Asbestos						
<b>B00A - R1015 - K.L.A. Store (14.72 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4054/B00A/R1002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1016 - Movement (13.17 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4054/B00A/R1002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1017 - Movement (6.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4054/B00A/R1002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1018 - Special Programs Room (42.86 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1019 - Reading Area (139.17 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00A/R1019/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1020 - Stairs (9.01 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4054/B00A/R1021/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1021 - Stairs (12.73 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4054/B00A/R1021/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1957 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	240m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4054/B00C/Eaves Linings/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00C - R0001 - General Storeroom (16.71 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected

**B00C - R0002 - Music Store (9.97 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected

**B00C - R0003 - Practical Activities - 1hb (17.74 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	4054/B00C/R0003/Floor Coverings Res/Textile/S7				No Asbestos Detected

**B00C - R0004 - Home Base (53.58 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected

**B00C - R0005 - Practical Activities - 1hb (17.79 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	4054/B00C/R0003/Floor Coverings Res/Textile/S7				No Asbestos Detected

**B00C - R0006 - Home Base (53.51 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected

**B00C - R0007 - Movement (23.95 m2)**

No Asbestos

**B00C - R0008 - Practical Activities - 1hb (17.81 m2)**

Wall Linings Internal	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4054/B00C/R0001/Wall Linings Internal/S6				No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00C/R0003/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00C - R0009 - Home Base (53.66 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R0010 - Practical Activities - 1hb (13.5 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00C/R0003/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00C - R0011 - Home Base (53.58 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R0012 - Practical Activities - 1hb (16.81 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00C/R0003/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00C - R0013 - Movement (18.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4054/B00C/R0003/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
<b>B00C - R0014 - Cleaning Distributed Store (2.81 m2)</b>						
No Asbestos						
<b>B00C - R0015 - Home Base (51.97 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R0016 - Home Base Store (4.88 m2)</b>						
No Asbestos						
<b>B00C - R0017 - General Storeroom (7.33 m2)</b>						
No Asbestos						
<b>B00C - R0018 - Special Programs Room (45.03 m2)</b>						
No Asbestos						
<b>B00C - R0019 - Toilets - Boys/Girls (3.22 m2)</b>						
No Asbestos						
<b>B00C - R0020 - Personal Effects Storage (9.93 m2)</b>						
No Asbestos						
<b>B00C - R0021 - Home Base (66.68 m2)</b>						
No Asbestos						
<b>B00C - R0022 - Practical Activities - 1hb (25.69 m2)</b>						
No Asbestos						
<b>B00C - R0023 - Home Base (58.62 m2)</b>						
No Asbestos						
<b>B00C - R0024 - Practical Activities - 1hb (18.68 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0025 - Home Base Store (4.41 m2)</b>						
No Asbestos						
<b>B00C - R0026 - Home Base Store (4.38 m2)</b>						
No Asbestos						
<b>B00C - R0027 - General Storeroom (18 m2)</b>						
No Asbestos						
<b>B00C - R0028 - Movement (8.75 m2)</b>						
No Asbestos						
<b>B00C - R0029 - Movement (62.54 m2)</b>						
No Asbestos						
<b>B00C - R0030 - Home Base (57.17 m2)</b>						
No Asbestos						
<b>B00C - R0031 - Practical Activities - 1hb (18.29 m2)</b>						
No Asbestos						
<b>B00C - R0032 - Movement (39.25 m2)</b>						
No Asbestos						
<b>B00C - R0033 - Distribution Board (0.96 m2)</b>					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R0034 - Movement (10.69 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R0035 - Stairs (6.6 m2)</b>						
No Asbestos						
<b>B00C - R9001 - Craft Store (6.59 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R9002 - Craft Store (19.98 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R9003 - Special Programs Room (71.94 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4054/B00C/R0001/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B00C - R9004 - Movement (9.4 m2)</b>						
No Asbestos						
<b>B00C - R9005 - General Assistant/Bulk Store (181.74 m2)</b>						
No Asbestos						
<b>B00C - R9006 - General Storeroom (13.05 m2)</b>						
No Asbestos						
<b>B00C - R9007 - General Storeroom (12.62 m2)</b>						
No Asbestos						
<b>B00C - R9008 - Movement (24.16 m2)</b>						
No Asbestos						
<b>B00C - R9009 - Stairs (6.53 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 2008 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00D - R0001 - External Movement (5.1 m2)**

No Asbestos

**B00D - R0002 - Cleaning Distributed Store (5.86 m2)**

No Asbestos

**B00D - R0003 - Disabled Toilet (5.84 m2)**

No Asbestos

**B00D - R0004 - Toilets - Boys (33.27 m2)**

No Asbestos

**B00D - R0005 - Toilet - Lobby (3.32 m2)**

No Asbestos

**B00D - R0006 - Toilets - Girls (46.2 m2)**

No Asbestos

**B00D - R0007 - Toilet - Lobby (3.08 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Storage - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00E - R0001 - General Assistant/Bulk Store (12.67 m2)**

No Asbestos

**B00E - R0002 - General Assistant/Bulk Store (15.76 m2)**

No Asbestos

**B00E - R0003 - General Storeroom (12.67 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Special Purpose - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00F - R0001 - Special Programs Room (32.01 m2)**

No Asbestos

**B00F - R0002 - General Storeroom (6.46 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00G - R0001 - Communal Space (147.11 m2)**

No Asbestos

**B00G - R0002 - Raised Platform (61.49 m2)**

No Asbestos

**B00G - R0003 - Hall Chair Store (9.53 m2)**

No Asbestos

**B00G - R0004 - Communal/Performance Store (9.55 m2)**

No Asbestos

**B00G - R0005 - P.E. Store (13.08 m2)**

No Asbestos

**B00G - R0006 - Movement (2.34 m2)**

No Asbestos

**B00G - R0007 - Toilets - Girls (7.13 m2)**

No Asbestos

**B00G - R0008 - Communications Cupboard (1.98 m2)**

No Asbestos

**B00G - R0009 - Movement (3.3 m2)**

No Asbestos

**B00G - R0010 - Toilets - Boys (5.69 m2)**

No Asbestos

**B00G - R0011 - Movement (1.64 m2)**

No Asbestos

**B00G - R0012 - Cleaning Distributed Store (4.1 m2)**

No Asbestos

**B00G - R0013 - Access Shower/Toilet (6.2 m2)**

No Asbestos

**B00G - R0014 - Canteen (38.66 m2)**

No Asbestos

**B00G - R0015 - Canteen Office/Store (6 m2)**

No Asbestos

**B00G - R0016 - Movement (5.09 m2)**

No Asbestos

**B00G - R0017 - Movement (11.96 m2)**

No Asbestos

**B00G - R0018 - External Movement (102.03 m2)**

No Asbestos

**B00G - R0019 - Distribution Board (3.5 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0020 - Ramp (10.46 m2)**

No Asbestos

**B00G - R0021 - External Movement (76.4 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - Added Building**

**Exterior**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10029 - Learning Unit - Standard With P.A.A. : Placement Date - 4/12/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 603 - D10439 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 6/02/2002**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D10482 - Learning Unit - Standard With P.A.A. : Placement Date - 15/04/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D10652 - Learning Unit - Standard With P.A.A. : Placement Date - 28/01/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 602 - D10955 - Learning Unit - Standard With P.A.A. : Placement Date - 15/04/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 603 - D11184 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 18/01/2008</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D11946 - Learning Unit - Standard With P.A.A. : Placement Date - 3/02/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D12798 - Learning Unit - Standard With P.A.A. : Placement Date - 30/09/2014</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D15838 - Learning Unit - Standard With P.A.A. : Placement Date - 18/01/2012</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
<b>R2 - Home Base Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
<b>OS 602 - D15952 - Learning Unit - Standard With P.A.A. : Placement Date - 5/01/2017</b>						
<b>Exterior</b>						
No Asbestos Found.						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D16626 - Learning Unit - Standard With P.A.A. : Placement Date - 16/12/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 603 - D17457 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 3/12/2007</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D17913 - Learning Unit - Standard With P.A.A. : Placement Date - 5/01/2017</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D18154 - Learning Unit - Standard With P.A.A. : Placement Date - 10/11/2009</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017