


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kempsey South Public School (4196)
Region : North Coast
State Electorate : Oxley
Local Government Area : Kempsey

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : AECOM : 29 - Oct - 2014

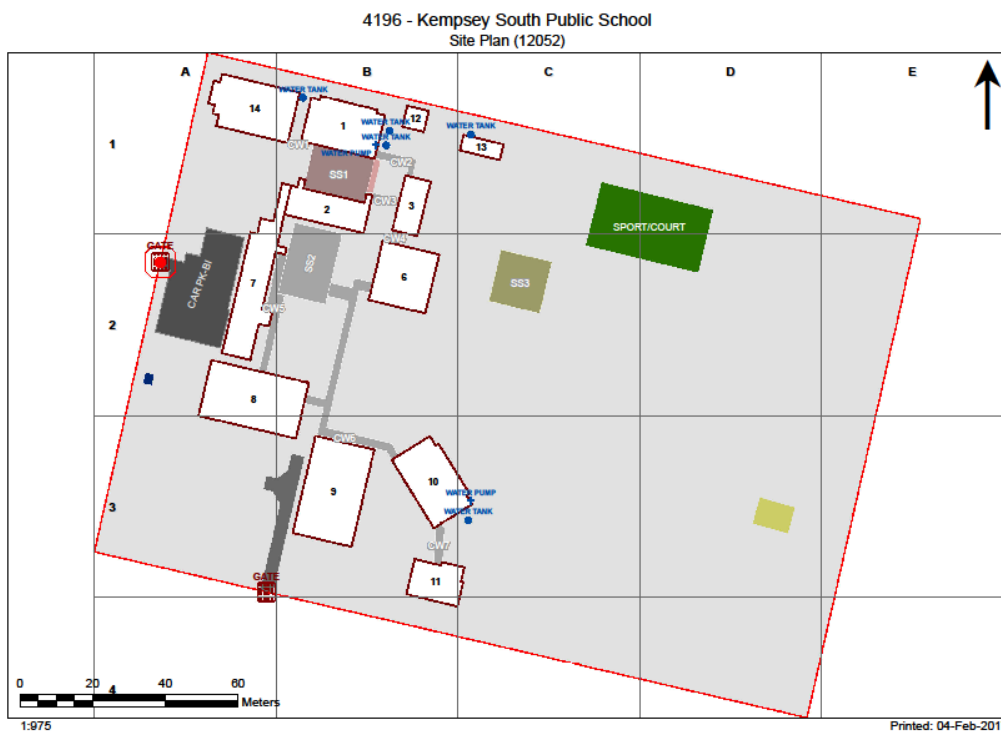

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4196/B001/Eaves Linings/S14					No Asbestos Detected
Underfloor Voids - Slab on Ground						
Ceiling Voids	No Asbestos Found					
Walls and ceiling	Flat AC Sheeting 4196/B001/Walls and ceiling/S26					No Asbestos Detected

Interior

B001 - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0008/Wall Linings Internal/S13					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B001 - R0002 - Home Base Store

No Asbestos

B001 - R0003 - Staff Room Annexe

No Asbestos

B001 - R0004 - Home Base

No Asbestos

B001 - R0005 - Home Base

No Asbestos

B001 - R0006 - Staff Room Annexe

No Asbestos

B001 - R0007 - Home Base Store

No Asbestos

B001 - R0008 - Kiln Room

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0008/Wall Linings Internal/S13					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B001 - R0009 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0009/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B001 - R0010 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0009/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B001 - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Walls and ceiling	Flat AC Sheeting 4196/B001/R0011/Walls and ceiling/S27					No Asbestos Detected
-------------------	---	--	--	--	--	----------------------

B001 - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1961 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B002/R0011/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4196/B002/Underfloor Voids/S28				Chrysotile (white asbestos)	

Interior

B002 - R0001 - Interview

No Asbestos

B002 - R0002 - Movement

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

Wall Linings Internal	Flat AC Sheeting					
	4196/B002/R0004/Wall Linings Internal/S4				No Asbestos Detected	

B002 - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

Wall Linings Internal	Flat AC Sheeting					
	4196/B002/R0004/Wall Linings Internal/S4				No Asbestos Detected	

B002 - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0008 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0009 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting					
	4196/B002/R0009/Ceiling Structures/Linings/S25				No Asbestos Detected	

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B002/R0005/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B002 - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B002/R0011/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - R0011 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B002/R0011/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B003 - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	4196/B003/R0001/Ceiling Structures/Linings/S15				No Asbestos Detected	

B003 - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B003 - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B003 - R0004 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B003 - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

B003 - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
	4196/B003/R0005/Ceiling Structures/Linings/S16				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Ends	Flat AC Sheeting	20m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible, no access was found.					
Underfloor Voids	No Asbestos Found					

Interior

B006 - R0001 - Home Base Store

No Asbestos

B006 - R0002 - Home Base Store

No Asbestos

B006 - R0003 - Practical Activities - 1hb

No Asbestos

B006 - R0004 - Home Base Store

No Asbestos

B006 - R0005 - Home Base Store

No Asbestos

B006 - R0006 - Home Base

No Asbestos

B006 - R0007 - Withdrawal Space - 1hb

No Asbestos

B006 - R0008 - Home Base

No Asbestos

B006 - R0009 - External Movement

Wall Cladding	Flat AC Sheeting 4196/B006/R0010/Wall Cladding/S17					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4196/B006/R0010/Ceiling Structures/Linings/S18					No Asbestos Detected

B006 - R0010 - External Movement

Wall Cladding	Flat AC Sheeting 4196/B006/R0010/Wall Cladding/S17					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4196/B006/R0010/Ceiling Structures/Linings/S18					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - General Learning - 1960 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4196/B002/R0011/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - No access due height and shelving/storage.					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4196/B002/Underfloor Voids/S28					Chrysotile (white asbestos)

Interior

B007 - R0001 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected

B007 - R0003 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	12m2	Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4196/B007/R0007/Wall Linings Internal/S8					Chrysotile (white asbestos)

B007 - R0004 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected

B007 - R0005 - Movement

No Asbestos

B007 - R0006 - Home Base Store

Flooring material below vinyl sheeting	Flat AC Sheeting					
	4196/B007/R0006/Flooring material below vinyl sheeting/S30					No Asbestos Detected

B007 - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	1m2	South, behind heater	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4196/B007/R0007/Wall Linings Internal/S8					Chrysotile (white asbestos)

B007 - R0008 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	4196/B007/R0008/Wall Linings Internal/S7					No Asbestos Detected

B007 - R0009 - Home Base Store

Backing paper below vinyl sheeting	Paper					
	4196/B007/R0009/Backing paper below vinyl sheeting/S31					No Asbestos Detected

B007 - R0010 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected

B007 - R0011 - Movement

No Asbestos

B007 - R0012 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles					
	4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected

B007 - R0013 - Cleaning Supplies

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B007 - R0014 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

4196/B007/R0015/Wall Linings Internal/S5 **Chrysotile (white asbestos)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

4196/B007/R0015/Wall Linings Internal/S5 **Chrysotile (white asbestos)**

B007 - R0015 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	------	------------	--------------------	---------	--------------------

4196/B007/R0015/Wall Linings Internal/S5 **Chrysotile (white asbestos)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

4196/B007/R0015/Wall Linings Internal/S5 **Chrysotile (white asbestos)**

B007 - R0016 - Movement

No Asbestos

B007 - R0017 - Sick Bay

No Asbestos

B007 - R0018 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

4196/B007/R0018/Ceiling Structures/Linings/S20 **Chrysotile (white asbestos)**

B007 - R0019 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
-----------------------------	-------------	--	--	--	--	--

4196/B007/R0010/Floor Coverings Res/Textile/S6 **No Asbestos Detected**

B007 - R0020 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
-----------------------------	-------------	--	--	--	--	--

4196/B007/R0010/Floor Coverings Res/Textile/S6 **No Asbestos Detected**

B007 - R0021 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					
----------------------------	------------------	--	--	--	--	--

4196/B007/R0021/Ceiling Structures/Linings/S32 **No Asbestos Detected**

B007 - Room+1 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

4196/B007/R0018/Ceiling Structures/Linings/S20 **Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Library - 1980 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible, there is no access to the raked ceiling.

Underfloor Voids - Slab on Ground
 No Asbestos Found

Interior

B008 - R0001 - External Movement

No Asbestos

B008 - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B008/R0003/Partition Walls (Cubicles)/S22					Chrysotile (white asbestos)	

B008 - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B008/R0003/Partition Walls (Cubicles)/S22					Chrysotile (white asbestos)	

B008 - R0004 - Communications Room

No Asbestos

B008 - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B008 - R0006 - General Storeroom

No Asbestos

B008 - R0007 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Wall Linings Internal	Flat AC Sheeting	3m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B008/R0007/Wall Linings Internal/S10					Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting	4196/B008/R0007/In-fill-panel/S12				No Asbestos Detected
---------------	------------------	-----------------------------------	--	--	--	-----------------------------

B008 - R0008 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	4196/B008/R0008/Floor Coverings Res/Textile/S11				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	-----------------------------

B008 - R0009 - General Storeroom

No Asbestos

B008 - R0010 - Reading Area

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - Communal Facilities - 1988 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Ends	Flat AC Sheeting	20m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (4-5m)						
Ceiling Voids	Non Accessible Area - Area inaccessible, there is no designated access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B009 - R0001 - External Movement

Wall Cladding	Flat AC Sheeting	4196/B006/R0010/Wall Cladding/S17				No Asbestos Detected
---------------	------------------	-----------------------------------	--	--	--	-----------------------------

B009 - R0002 - Canteen

No Asbestos

B009 - R0003 - General Storeroom

No Asbestos

B009 - R0004 - General Storeroom

No Asbestos

B009 - R0005 - Communal Space

No Asbestos

B009 - R0006 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	4196/B009/R0021/Ceiling Structures/Linings/S33				No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected

B009 - R0007 - P.E. Store

No Asbestos

B009 - R0008 - Raised Platform

No Asbestos

B009 - R0009 - Hall Chair Store

No Asbestos

B009 - R0010 - Hall Chair Store

No Asbestos

B009 - R0011 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B008/R0003/Partition Walls (Cubicles)/S22						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected

B009 - R0012 - Shower/Change

Wall Linings Internal	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B008/R0003/Partition Walls (Cubicles)/S22						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected

B009 - R0013 - Movement

Wall Linings Internal	Flat AC Sheeting	4196/B009/R0013/Wall Linings Internal/S23				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0014 - Distribution Board					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0015 - External Movement						
Wall Cladding	Flat AC Sheeting 4196/B006/R0010/Wall Cladding/S17					No Asbestos Detected
B009 - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0017 - Cleaning Supplies						
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0018 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0019 - Shower/Change						
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4196/B008/R0003/Partition Walls (Cubicles)/S22	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0020 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 4196/B008/R0003/Partition Walls (Cubicles)/S22	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0013/Wall Linings Internal/S23					No Asbestos Detected
B009 - R0021 - Disabled Toilet						
Ceiling Structures/Linings	Flat AC Sheeting 4196/B009/R0021/Ceiling Structures/Linings/S33					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4196/B009/R0021/Ceiling Structures/Linings/S33					No Asbestos Detected
B009 - R0022 - External Movement						
Wall Cladding	Flat AC Sheeting 4196/B006/R0010/Wall Cladding/S17					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - General Learning - 1982 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4196/B001/Eaves Linings/S14					No Asbestos Detected
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	AC Fragments/Debris 4196/B010/Ceiling Voids/S34					No Asbestos Detected

Interior

B010 - R0001 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 4196/B010/R0001/Wall Linings Internal/S19					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B010 - R0002 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 4196/B010/R0001/Wall Linings Internal/S19					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B010 - R0003 - General Storeroom

No Asbestos

B010 - R0004 - Withdrawal Space - 1hb

No Asbestos

B010 - R0005 - Home Base

No Asbestos

B010 - R0006 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0009/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B010 - R0007 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting 4196/B001/R0009/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B010 - R0008 - Home Base

No Asbestos

B010 - R0009 - Withdrawal Space - 1hb

No Asbestos

B010 - R0010 - General Storeroom

No Asbestos

B010 - R0011 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 4196/B010/R0001/Wall Linings Internal/S19					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B010 - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B011 - General Learning - 1960 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting 4196/B011/Wall Cladding/S1					No Asbestos Detected
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (4-5m)						
Ceiling Voids	Flat AC Sheeting 4196/B011/Ceiling Voids/S35	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris 4196/B002/Underfloor Voids/S28	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos)

Interior**B011 - R0001 - Other-Community Use**

Ceiling Structures/Linings	Flat AC Sheeting 4196/B011/R0001/Ceiling Structures/Linings/S2	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	10m2	South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B011 - R0002 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	60m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B011 - R0003 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4196/B007/R0010/Floor Coverings Res/Textile/S6					No Asbestos Detected

B011 - R0004 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B011 - R0005 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	12m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B011 - R0006 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 4196/B011/R0007/Wall Linings Internal/S21	16m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B011/R0007/Wall Linings Internal/S21					Chrysotile (white asbestos)	
B011 - R0007 - Other-Community Use						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B011/R0007/Wall Linings Internal/S21					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4196/B011/R0007/Wall Linings Internal/S21					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B012 - Communal Facilities - 2001 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B012 - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B013 - Storage - 2010 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B013 - R0001 - Sports Store

No Asbestos

B013 - R0002 - General Assistant/Bulk Store

No Asbestos

B013 - R0003 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B014 - Administration - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B014 - R0001 - Entry Vestibule

No Asbestos

B014 - R0002 - Movement

No Asbestos

B014 - R0003 - Interview/Office - Type 3

No Asbestos

B014 - R0004 - Principal

No Asbestos

B014 - R0005 - Staff Toilet

No Asbestos

B014 - R0006 - Staff Toilet

No Asbestos

B014 - R0007 - Staff Toilet

No Asbestos

B014 - R0008 - Cleaning Distributed Store

No Asbestos

B014 - R0009 - Security Store

No Asbestos

B014 - R0010 - Staff Room Annexe

No Asbestos

B014 - R0011 - Staff Room

No Asbestos

B014 - R0012 - Access Shower/Toilet

No Asbestos

B014 - R0013 - Sick Bay

No Asbestos

B014 - R0014 - Clerical Office

No Asbestos

B014 - R0015 - Main Switch Board

No Asbestos

B014 - R0016 - External Movement

No Asbestos

B014 - R0017 - External Movement

No Asbestos

B014 - R0018 - Staff Kitchen

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017