


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kingswood Park Public School (4346)  
**Region :** Western Sydney  
**State Electorate :** Penrith  
**Local Government Area :** Penrith

**Initial Survey :** Noel Arnold & Associates : 19 - May - 2008  
**Reviewed By :** Greencap-NAA : 10 - Jun - 2015

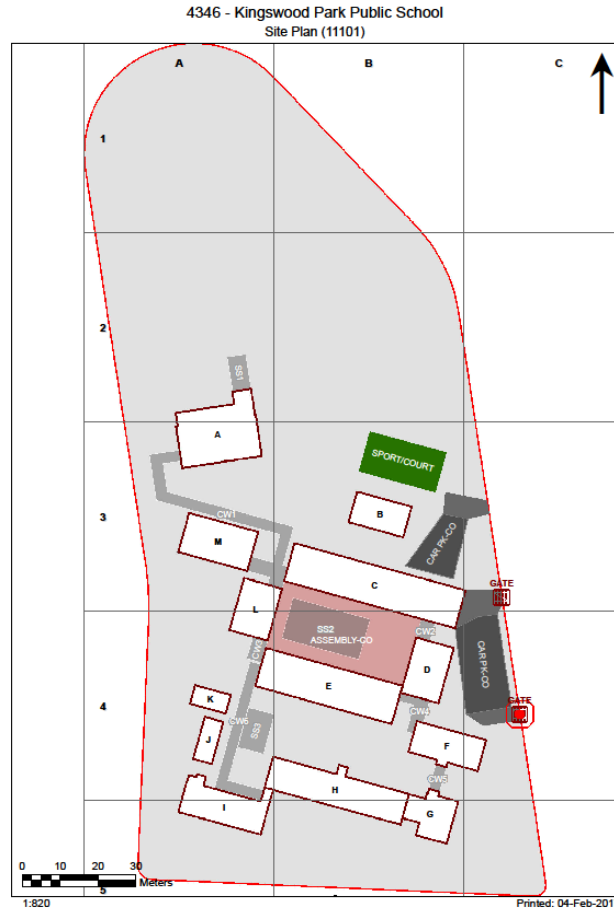

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00A - Pre-School Facilities - 2004 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00A - R0001 - Movement**

No Asbestos

**B00A - R0002 - Entry Vestibule**

No Asbestos

**B00A - R0003 - Security Store**

No Asbestos

**B00A - R0004 - General Storeroom - Pre**

No Asbestos

**B00A - R0005 - Home Base - Pre**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00A - R0006 - Practical Activities - Pre**

No Asbestos

**B00A - R0007 - Toilets - Boys/Girls - Pre**

No Asbestos

**B00A - R0008 - Laundry - Pre**

No Asbestos

**B00A - R0009 - Access Shower/Toilet - Type 2**

No Asbestos

**B00A - R0010 - Cleaning Distributed Store**

No Asbestos

**B00A - R0011 - Kitchen - Pre**

No Asbestos

**B00A - R0012 - Clerical Office - Pre**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00A - R0013 - Clerical Office - Pre**Vinyl Tiles (Under Floor  
Covering/Carpet) No Asbestos Found**B00A - R0014 - General Storeroom - Pre**

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Other-Community Use - 1960 - Timber (Timber)**

**Exterior**

Wall Cladding	Flat AC Sheeting 4346/B00B/Wall Cladding/S8					<b>No Asbestos Detected</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Other-Community Use**

Floor Coverings Res/Textile	Vinyl Tiles  4346/B00B/R0002/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
--------------------------------	--------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00B - R0003 - Other-Community Use**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1969 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	16m2	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0001 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					

**B00C - R0002 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					

**B00C - R0003 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					

**B00C - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	

**B00C - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00C/R0005/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	16m	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Home Base**

No Asbestos

**B00C - R0007 - Home Base Store**

No Asbestos

**B00C - R0008 - Personal Effects Storage**

Electrical Backing Board	Resinous Board	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

**B00C - R0009 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0010 - Home Base</b>						
No Asbestos						
<b>B00C - R0011 - Home Base</b>						
No Asbestos						
<b>B00C - R0012 - Home Base Store</b>						
No Asbestos						
<b>B00C - R0013 - Personal Effects Storage</b>						
No Asbestos						
<b>B00C - R0014 - Home Base Store</b>						
No Asbestos						
<b>B00C - R0015 - Home Base</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Staff Facilities - 1969 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00D/R0004/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00D/R0004/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	8m2	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Stored electrical cabinet	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00D/Underfloor Voids/S19				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00D - R0001 - Staff Room**

No Asbestos

**B00D - R0002 - Interview**

No Asbestos

**B00D - R0003 - Staff Kitchen**

No Asbestos

**B00D - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00D/R0004/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1969 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/R0001/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/R0001/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	20m2	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/R0001/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	14m	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - Home Base**

No Asbestos

**B00E - R0003 - Home Base Store**

No Asbestos

**B00E - R0004 - Movement**

Electrical Backing Board	Resinous Board	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00E - R0005 - Home Base Store**

No Asbestos

**B00E - R0006 - Home Base**

No Asbestos

**B00E - R0007 - Home Base**

No Asbestos

**B00E - R0008 - Home Base Store**

No Asbestos

**B00E - R0009 - Movement**

No Asbestos

**B00E - R0010 - Home Base Store**

No Asbestos

**B00E - R0011 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration - 1967 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0012/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0012/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior****B00F - R0001 - Staff Toilet**

Wall Linings Internal	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0011/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	4346/B00F/R0002/Floor Coverings Res/Textile/S20					

**B00F - R0003 - Clerical Office**

Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	4346/B00F/R0002/Floor Coverings Res/Textile/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00F - R0004 - Clerical Office**

Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	4346/B00F/R0002/Floor Coverings Res/Textile/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00F - R0005 - Principal**

No Asbestos

**B00F - R0006 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	4346/B00F/R0002/Floor Coverings Res/Textile/S20					

**B00F - R0007 - Staff Room Annexe**

Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	4346/B00F/R0002/Floor Coverings Res/Textile/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00F - R0008 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0008/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	4346/B00F/R0002/Floor Coverings Res/Textile/S20				<b>No Asbestos Detected</b>	
<b>B00F - R0009 - Duplicating Workroom</b>						
No Asbestos						
<b>B00F - R0010 - Sick Bay</b>						
No Asbestos						
<b>B00F - R0011 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0011/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0012 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00F/R0012/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Administration - 1967 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Ends	Moulded fibre cement sheeting	14m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Height Restriction****Interior****B00G - R0001 - Deputy Principal**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	4346/B00G/R0007/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	

**B00G - R0002 - Interview**

Floor Coverings Res/Textile	Adhesive					
	4346/B00G/R0007/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>	

**B00G - R0003 - Community Clinic**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0004/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>	

**B00G - R0004 - Community Clinic**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0004/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	15m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0003/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>	

**B00G - R0005 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0005/Wall Linings Internal/S21				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00G - R0006 - Movement**

No Asbestos

**B00G - R0007 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	4346/B00G/R0007/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	
<b>B00G - R0008 - Uniform Shop</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	4346/B00G/R0007/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	
<b>B00G - R0009 - Main Switch Board</b>						
No Asbestos						
<b>B00G - R0011 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	
<b>B00G - R0012 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00G/R0007/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4346/B00H/R0009/Ceiling Structures/Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 4346/B00H/R0009/Ceiling Structures/Linings/S11					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00H - R0001 - Movement**

No Asbestos

**B00H - R0002 - Personal Effects Storage**

No Asbestos

**B00H - R0003 - Home Base Store**

No Asbestos

**B00H - R0004 - Home Base**

No Asbestos

**B00H - R0005 - Home Base**

No Asbestos

**B00H - R0006 - Home Base Store**

No Asbestos

**B00H - R0007 - Personal Effects Storage**

No Asbestos

**B00H - R0008 - Movement**

No Asbestos

**B00H - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4346/B00H/R0009/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	----------------------

**B00H - R0010 - Personal Effects Storage**

No Asbestos

**B00H - R0011 - Home Base Store**

No Asbestos

**B00H - R0012 - Home Base**

No Asbestos

**B00H - R0013 - Home Base**

No Asbestos

**B00H - R0014 - Movement**

No Asbestos

**B00H - R0015 - Personal Effects Storage**

No Asbestos

**B00H - R0016 - Home Base Store**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00I/R0011/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00I/R0011/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Height Restriction					

**Interior**

**B00I - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00I/R0011/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00I - R0002 - Movement**

No Asbestos

**B00I - R0003 - Personal Effects Storage**

No Asbestos

**B00I - R0004 - Home Base Store**

No Asbestos

**B00I - R0007 - Home Base Store**

No Asbestos

**B00I - R0008 - Personal Effects Storage**

No Asbestos

**B00I - R0009 - Movement**

No Asbestos

**B00I - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00I/R0011/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00I - R0011 - Toilets - Boys/Girls**


Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00I/R0011/Ceiling Structures/Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00I - R0012 - Reading Area**

No Asbestos

**B00I - R0013 - Library Office/Workroom**

No Asbestos

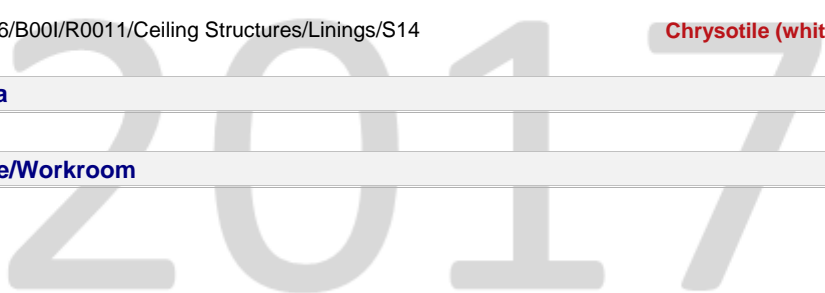

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Pupil Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00J/Eaves Linings/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00J - R0001 - Cleaning Supplies**

No Asbestos

**B00J - R0002 - Sports Store**

No Asbestos

**B00J - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00J/R0003/Partition Walls (Cubicles)/S6				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00K/Eaves Linings/S26				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior**

**B00K - R0001 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00K/R0001/Partition Walls (Cubicles)/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Pupil Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00L/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	25m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00L/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00L - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00L/Eaves Linings/S27					<b>Chrysotile (white asbestos)</b>

**B00L - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet					
	4346/B00L/R0002/Partition Walls (Cubicles)/S5					<b>No Asbestos Detected</b>

**B00L - R0003 - Security Store**

No Asbestos

**B00L - R0004 - Cleaning Distributed Store**

No Asbestos

**B00L - R0005 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet					
	4346/B00L/R0002/Partition Walls (Cubicles)/S5					<b>No Asbestos Detected</b>

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Pupil Facilities/Multi Purpose Facilities - 1969 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00M/R0002/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00M/R0002/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	8m2	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00M - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00M/R0002/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	6m	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	4346/B00E/In-fill-panel/S7				Chrysotile (white asbestos)	

**B00M - R0004 - Communal Space**

No Asbestos

**B00M - R0005 - Raised Platform**

No Asbestos

**B00M - R9001 - General Storeroom**

No Asbestos

**B00M - R9002 - Sports Store**

No Asbestos

**B00M - R9003 - General Storeroom**

No Asbestos

**B00M - R9004 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017