


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Killarney Heights Public School (4386)
Region : Northern Sydney
State Electorate : Wakehurst
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

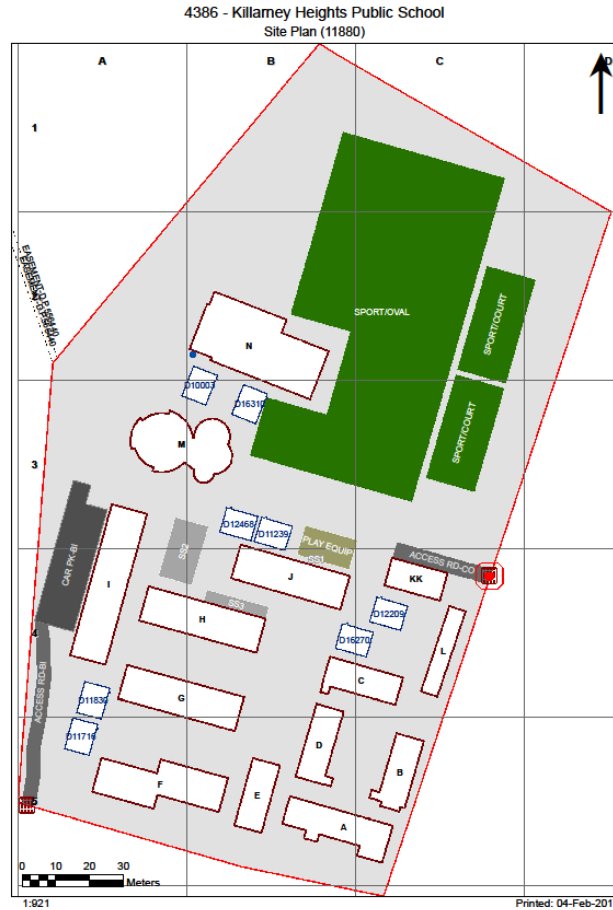

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4386/B00B/Ceiling Voids/S29					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4386/B00H/Underfloor Voids - Packing to Floor Joists/S21	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior

B00A - R0002 - General Storeroom (3.94 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00A/R0002/Wall Linings Internal/S26					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00A - R0003 - Staff Kitchen (12.18 m2)

No Asbestos

B00A - R0004 - Movement (3.56 m2)

No Asbestos

B00A - R0005 - External Movement (1.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00A - R0006 - General Storeroom (3.94 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00A/R0002/Wall Linings Internal/S26					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00A - R0008 - Staff Toilet (3.31 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0009 - External Movement (10.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00J/R0008/Ceiling Structures/Linings/S11	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	9m2	Variable positions	Some Damage / Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos)
-----------------------	--	-----	--------------------	----------------------------	------------	---

B00A - R0010 - Entry Vestibule (16.7 m2)

No Asbestos

B00A - R0012 - External Movement (1.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00A - R0013 - Main Switch Board (3.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4386/B00A/R0014/Floor Coverings Res/Textile/S18	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00A - R0014 - General Storeroom (7.11 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00A/R0014/Floor Coverings Res/Textile/S18	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0015 - Principal (17.48 m2)						
No Asbestos						
B00A - R0016 - Deputy Principal (17.88 m2)						
No Asbestos						
B00A - R0017 - Plant (0.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00A/R0014/Floor Coverings Res/Textile/S18	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0018 - General Storeroom (2.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00A/R0014/Floor Coverings Res/Textile/S18	2.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0019 - Movement (5.76 m2)						
No Asbestos						
B00A - R0020 - Clerical Office (21.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00A/R0014/Floor Coverings Res/Textile/S18	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0021 - Clerical Office/Workroom (12.19 m2)						
No Asbestos						
B00A - R0022 - Sick Bay (5.62 m2)						
No Asbestos						
B00A - R0023 - Clerical/Printing (34.74 m2)						
No Asbestos						
B00A - R0024 - Staff Room (79.21 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4386/B00B/Ceiling Voids/S29					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panels below window	Flat AC Sheeting 4386/B00B/R9003/Wall Linings Internal/S14	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Packing to Floor Joists	Fibrous Membrane 4386/B00E/Underfloor Voids - Packing to Floor Joists/S24					No Asbestos Detected

Interior

B00B - R0001 - External Movement (4.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00B - R0002 - External Movement (1.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00B - R0003 - Practical Activities - 1hb (8.13 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
---------------------------	------------------	-------	-------------	--------------------	---------	---

B00B - R0004 - General Storeroom (4.02 m2)

No Asbestos

B00B - R0005 - Home Base (56.68 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	--------------------	--------------------	---------	---

B00B - R0006 - Home Base (56.68 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	--------------------	--------------------	---------	---

B00B - R0007 - General Storeroom (4.02 m2)

No Asbestos

B00B - R0008 - Practical Activities - 1hb (11.56 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0004/Wall Linings Internal/S19	1m2	Behind sink splashback tiles	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	-----	------------------------------	--------------------	---------	--

B00B - R0009 - Movement (4.3 m2)

No Asbestos

B00B - R0010 - External Movement (1.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00B - R9001 - General Storeroom (4.57 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R9002 - Uniform Shop (52.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00L/R0007/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00B - R9003 - Movement (7.21 m2)						
Wall Linings Internal	Flat AC Sheeting	12m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00B/R9003/Wall Linings Internal/S14					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00E/Eaves Linings/S1					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00H/Gable verge lining/S22					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00C - R0001 - External Movement (4.88 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00B/R0010/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0002 - External Movement (1.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00B/R0010/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Practical Activities - 1hb (6.02 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00C - R0004 - Home Base Store (2.63 m2)

No Asbestos

B00C - R0005 - Toilets - Boys/Girls (3.38 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00E/R0007/Wall Linings Internal/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00E/R0007/Wall Linings Internal/S4					Chrysotile (white asbestos)

B00C - R0006 - Practical Activities - 1hb (28.84 m2)

No Asbestos

B00C - R0007 - Home Base (56.88 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00C - R0008 - Home Base (57.04 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00C - R0009 - General Storeroom (3.99 m2)

No Asbestos

B00C - R0010 - Personal Effects Storage (8.13 m2)

No Asbestos

B00C - R0011 - External Movement (1.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00B/R0010/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4386/B00H/Underfloor Voids - Packing to Floor Joists/S21	1m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Voids	Stored sheeting 4386/B00D/Underfloor Voids/S25	1m2	North West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior**B00D - R0001 - External Movement (1.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00B/R0010/Ceiling Structures/Linings/S5	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00D - R0002 - Personal Effects Storage (5.66 m2)

No Asbestos

B00D - R0003 - General Storeroom (2.95 m2)

No Asbestos

B00D - R0004 - Toilets - Boys/Girls (3.45 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0005 - Practical Activities - 1hb (27.58 m2)

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	---	-------	------	--------------------	---------	---

B00D - R0006 - Home Base (57.92 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	---	-------	-----------------------	--------------------	---------	---

B00D - R0007 - Home Base (56.89 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	---	-------	-----------------------	--------------------	---------	---

B00D - R0008 - Home Base Store (4.38 m2)

No Asbestos

B00D - R0009 - Personal Effects Storage (5.43 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
---------------------------	------------------	-------	--------------	--------------------	---------	---

B00D - R0010 - Movement (2.28 m2)

No Asbestos

B00D - R0011 - External Movement (1.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00B/R0010/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0012 - External Movement (4.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00B/R0010/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R9001 - General Assistant/Bulk Store (44.88 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Administration - 1967 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel below window	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	Fibrous Membrane 4386/B00E/Underfloor Voids - Packing to Floor Joists/S24					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**B00E - R0001 - Practical Activities - 1hb (15.21 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4386/B00E/R0008/Floor Coverings Res/Textile/S3	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)

B00E - R0002 - Staff Room Annexe (17.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00E/R0008/Floor Coverings Res/Textile/S3	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

B00E - R0003 - Staff Toilet (2.24 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	3m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0004 - General Storeroom (0.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4386/B00E/R0008/Floor Coverings Res/Textile/S3	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	---	-----	--------------	--------------------	---------	--

B00E - R0005 - General Storeroom (9.38 m2)

No Asbestos

B00E - R0006 - Staff Toilet (5.77 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	------	--------------	--------------------	---------	--

B00E - R0007 - Staff Toilet (5.77 m2)

Wall Linings Internal	Flat AC Sheeting 4386/B00E/R0007/Wall Linings Internal/S4	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	------	--------------	--------------------	---------	--

B00E - R0008 - General Storeroom (6.69 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4386/B00E/R0008/Floor Coverings Res/Textile/S3	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	---	-----	--------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0009 - Craft Store (14.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00E/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0012 - Distribution Board (1.23 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00E/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0013 - General Storeroom (14.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00E/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R0015 - Home Base (42.9 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						
B00E - R0016 - Practical Activities - 1hb (3.6 m2)						
No Asbestos						
B00E - R0017 - Movement (11.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00E/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	70m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panels below window	Flat AC Sheeting 4386/B00B/R9003/Wall Linings Internal/S14	16m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found 4386/B00F/Gable Verge Lining/S28					No Asbestos Detected

Interior

B00F - R0001 - Home Base (57.19 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	--------------------	--------------------	---------	---

B00F - R0002 - Home Base Store (5.78 m2)

No Asbestos

B00F - R0003 - Craft Store (5.69 m2)

No Asbestos

B00F - R0004 - Personal Effects Storage (9.9 m2)

No Asbestos

B00F - R0005 - Movement (5.8 m2)

No Asbestos

B00F - R0006 - Home Base (57.27 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	--------------------	--------------------	---------	---

B00F - R0007 - External Movement (33.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00J/R0008/Ceiling Structures/Linings/S11	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	8m2	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00F - R0008 - Home Base (57.19 m2)

No Asbestos

B00F - R0009 - Home Base Store (5.57 m2)

No Asbestos

B00F - R0010 - Personal Effects Storage (10.4 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0004/Wall Linings Internal/S19	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00F - R0011 - Movement (5.41 m2)

No Asbestos

B00F - R0012 - Home Base Store (5.64 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

No Asbestos

B00F - R0013 - Home Base (57.35 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00F - R0014 - External Movement (41.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00J/R0008/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	16m2	Variable positions	Some Damage / Unsealed (3)	Medium (2)	Medium Priority (4-5)
4386/B00E/Infill panel below window/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panels below window	Flat AC Sheeting 4386/B00B/R9003/Wall Linings Internal/S14	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4386/B00H/Underfloor Voids - Packing to Floor Joists/S21	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior

B00G - R0001 - Toilets - Girls (60.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00L/R0007/Ceiling Structures/Linings/S7	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 4386/B00L/R0007/Partition Walls (Cubicles)/S8	15m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0002 - K.L.A. Store (8.21 m2)

No Asbestos

B00G - R0003 - K.L.A. Store (5.85 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00G - R0004 - Reading Area (149.46 m2)

No Asbestos

B00G - R0005 - K.L.A. Store (19.5 m2)

No Asbestos

B00G - R0006 - Library Office/Workroom (31.2 m2)

No Asbestos

B00G - R0007 - External Movement (64.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00J/R0008/Ceiling Structures/Linings/S11	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	12m2	Variable positions	Some Damage / Unsealed (3)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos)

B00G - Room+1 - Added Room

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00E/Eaves Linings/S1				Chrysotile (white asbestos)	
Gable verge lining	Flat AC Sheeting	45m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00H/Gable verge lining/S22				Chrysotile (white asbestos)	
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4386/B00H/Underfloor Voids - Packing to Floor Joists/S21				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior

B00H - R0001 - Toilets - Boys (60.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00L/R0007/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4386/B00L/R0007/Partition Walls (Cubicles)/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0002 - Home Base Store (5.72 m2)

No Asbestos

B00H - R0003 - Personal Effects Storage (7.99 m2)

Electrical Backing Board	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00H - R0004 - Home Base (56.88 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00H - R0005 - Home Base (56.95 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00H - R0006 - Personal Effects Storage (10.05 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00I/R0004/Wall Linings Internal/S19				Chrysotile (white asbestos)	

B00H - R0007 - Movement (5.63 m2)

No Asbestos

B00H - R0008 - Home Base Store (5.67 m2)

No Asbestos

B00H - R0009 - Home Base (57.35 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00H - R0010 - Home Base Store (5.7 m2)

No Asbestos

B00H - R0011 - External Movement (63.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00J/R0008/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	12m2	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	60m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00I - R0001 - Home Base (56.88 m2)**

Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00I/R0005/Floor Coverings Res/Textile/S17	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00I - R0002 - Home Base Store (5.47 m2)

Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00I - R0003 - Other-Commercial (0.95 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
AC conduit for HV cable	Fibre Cement Pipe 4386/B00I/R0003/AC conduit for HV cable/S16	1m	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	1m2	Front area of cupboard floor	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00I - R0004 - Other-Commercial (14.17 m2)

Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00I/R0005/Floor Coverings Res/Textile/S17	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0004/Wall Linings Internal/S19	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00I - R0005 - Home Base Store (6.59 m2)

Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00I - R0006 - Home Base (56.72 m2)						
Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00I - R0010 - External Movement (85.05 m2)						
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	4m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R0012 - Communal/Performance Store (16.03 m2)						
Ceiling Structures/Linings	Vermiculite 4386/B00I/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00I - R0013 - Communal Space (161.56 m2)						
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R0014 - Garden Store (36.06 m2)						
Incinerette	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0006/Wall Linings Internal/S20					No Asbestos Detected
B00I - R1001 - Home Base (57.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00I/R0005/Floor Coverings Res/Textile/S17	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1002 - Home Base Store (5.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1003 - Distribution Board (0.94 m2) Note: No inspection of live electrical installation.						
Electrical Mounting Board	Flat AC Sheeting Assumed Asbestos - Electrical Hazard	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1004 - Personal Effects Storage (14.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0004/Wall Linings Internal/S19	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1005 - Home Base Store (6.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1006 - Home Base (56.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4386/B00I/R0005/Floor Coverings Res/Textile/S17	3m2	West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00I - R1007 - Home Base (56.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4386/B00I/R0005/Floor Coverings Res/Textile/S17	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00I - R1008 - Home Base Store (6.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1009 - Personal Effects Storage (13.95 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1010 - Home Base Store (6.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1011 - Home Base (56.72 m2)						
No Asbestos						
B00I - R1012 - Home Base (56.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1013 - Home Base Store (6.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1014 - Home Base Store (6.78 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00I/R0005/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00I - R1015 - Movement (83.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	84m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00B/R0010/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4386/B00E/Infill panel below window/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4386/B00E/Eaves Linings/S1	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4386/B00H/Gable verge lining/S22	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4386/B00H/Underfloor Voids - Packing to Floor Joists/S21	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior

B00J - R0001 - Home Base (57.43 m2)

Thermacon Heater	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	-------	--------------------	---------	---

B00J - R0002 - Home Base Store (6.02 m2)

No Asbestos

B00J - R0003 - Personal Effects Storage (15.09 m2)

Electrical Mounting Board	Flat AC Sheeting	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
---------------------------	------------------	-------	--------------	--------------------	---------	---

Wall Linings Internal	Flat AC Sheeting 4386/B00I/R0004/Wall Linings Internal/S19	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	-----	------------------------------	--------------------	---------	--

B00J - R0004 - Home Base Store (6.09 m2)

No Asbestos

B00J - R0006 - Withdrawal Space - 1hb (21.76 m2)

No Asbestos

B00J - R0007 - Movement (5.79 m2)

No Asbestos

B00J - R0008 - External Movement (60.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4386/B00J/R0008/Ceiling Structures/Linings/S11	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4386/B00E/Infill panel below window/S2	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00J - R0009 - Home Base (86.78 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North & South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	---------------	--------------------	---------	---

B00J - R0010 - Home Base (57.2 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North & South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
------------------	--	-------	---------------	--------------------	---------	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00L/Eaves Linings/S6					Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - No access door fitted					
Ceiling Voids - Flat Roof	Non Accessible Area - No ceiling access panel fitted					

Interior

B00L - R0001 - General Storeroom (8.29 m2)

No Asbestos

B00L - R0002 - Toilets - Boys (33.16 m2)

No Asbestos

B00L - R0003 - General Storeroom (17.03 m2)

No Asbestos

B00L - R0004 - Cleaning Distributed Store (5.39 m2)

No Asbestos

B00L - R0005 - General Storeroom (5.35 m2)

No Asbestos

B00L - R0006 - General Storeroom (17.12 m2)

No Asbestos

B00L - R0007 - Toilets - Girls (28.99 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other-After School Care - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Wall Cladding	Textured waterproof coating to exterior walls 4386/B00M/Wall Cladding/S23					No Asbestos Detected
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - No access panel installed					

Interior

B00M - R0001 - Out Of School Hours Care Centre (6.32 m2)

No Asbestos

B00M - R0002 - Out Of School Hours Care Centre (6.34 m2)

No Asbestos

B00M - R0003 - Out Of School Hours Care Centre (24.13 m2)

No Asbestos

B00M - R0004 - No Access (0.9 m2)

Electrical Backing Board	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	------------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00M - R0005 - Out Of School Hours Care Centre (2.01 m2)

No Asbestos

B00M - R0006 - Out Of School Hours Care Centre (19.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00M/R0006/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00M - R0007 - Out Of School Hours Care Centre (22.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4386/B00M/R0006/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00M - R0008 - Out Of School Hours Care Centre (12.36 m2)

No Asbestos

B00M - R0009 - Out Of School Hours Care Centre (18.15 m2)


No Asbestos

B00M - R0010 - Out Of School Hours Care Centre (17.97 m2)

No Asbestos

B00M - R0011 - Out Of School Hours Care Centre (259.62 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4386/B00M/R0011/Ceiling Structures/Linings/S12					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

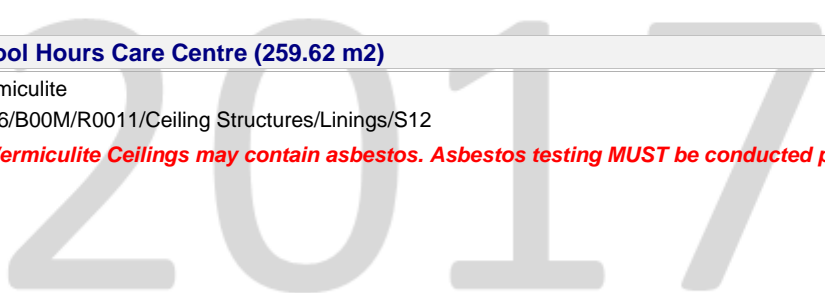

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other/Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restricted - >8m High
Underfloor Voids	Non Accessible Area - No access panel installed
Ceiling Voids	Non Accessible Area - Height Restriction - Height Restricted - >8m High

Interior**B00N - R0001 - Covered Outdoor Learning Area (226.43 m2)**

No Asbestos

B00N - R0002 - External Movement (33.99 m2)

No Asbestos

B00N - R0003 - External Movement (15.97 m2)

No Asbestos

B00N - R0004 - Communal Space (205.45 m2)

No Asbestos

B00N - R0005 - Raised Platform (57.42 m2)

No Asbestos

B00N - R0006 - Main Switch Board (3.32 m2)

No Asbestos

B00N - R0007 - Toilet - P (7.01 m2)

No Asbestos

B00N - R0008 - Cleaning Supplies (5.23 m2)

No Asbestos

B00N - R0009 - Toilet - Lobby (3.53 m2)

No Asbestos

B00N - R0010 - Toilets - Boys (5.63 m2)

No Asbestos

B00N - R0011 - Sound Cupboard (2.06 m2)

No Asbestos

B00N - R0012 - Toilet - Lobby (2.51 m2)

No Asbestos

B00N - R0013 - Toilets - Girls (7.38 m2)

No Asbestos

B00N - R0014 - Sports Store (16.4 m2)

No Asbestos

B00N - R0015 - Communal/Performance Store (10.97 m2)

No Asbestos

B00N - R0016 - Hall Chair Store (11.14 m2)

No Asbestos

B00N - R0017 - Movement (17.23 m2)

No Asbestos

B00N - R0018 - Ramp (10.99 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B0KK - Canteen - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0KK - R0001 - Canteen Covered Area (70.56 m2)

No Asbestos

B0KK - R0002 - Staff Toilet (5.17 m2)

No Asbestos

B0KK - R0003 - Canteen Office/Store (10.62 m2)

No Asbestos

B0KK - R0004 - Canteen (41.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10003 - Learning Unit - Standard With P.A.A. : Placement Date - 15/01/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11239 - Learning Unit - Standard With P.A.A. : Placement Date - 10/12/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11716 - Learning Unit - Standard With P.A.A. : Placement Date - 12/03/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11830 - Learning Unit - Standard With P.A.A. : Placement Date - 21/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12209 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D12468 - Learning Unit - Standard With P.A.A. : Placement Date - 4/12/2013						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D16270 - Learning Unit - Standard With P.A.A. : Placement Date - 1/11/2013						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 602 - D16310 - Learning Unit - Standard With P.A.A. : Placement Date - 15/01/2013						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017