


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Koonawarra Public School (4409)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 06 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

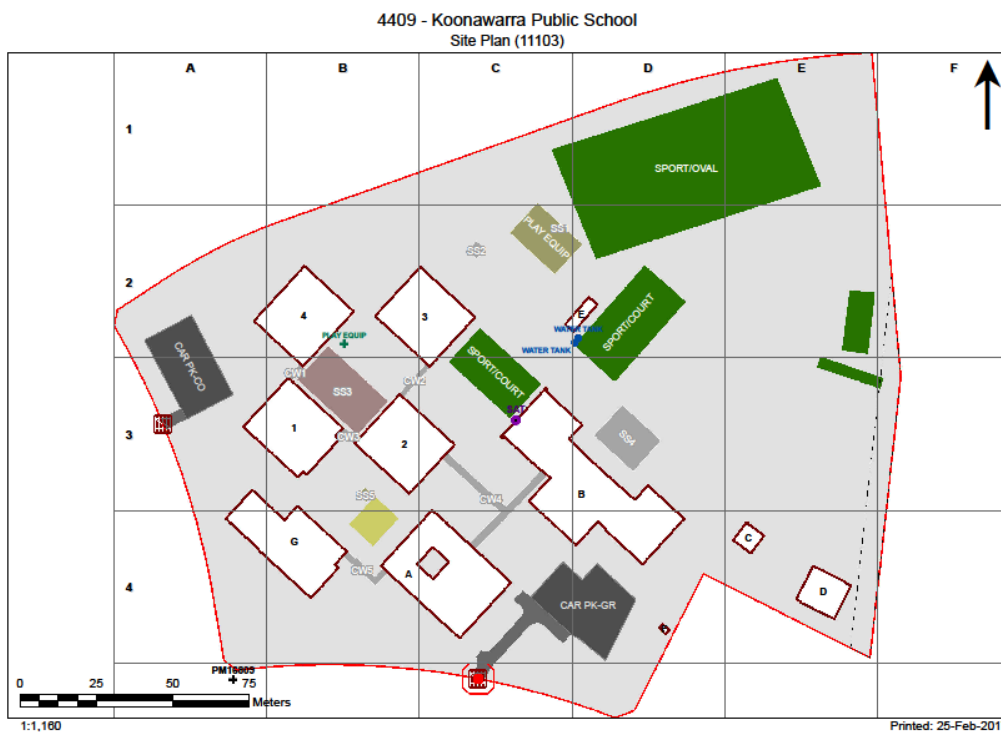

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Pre-School Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B001 - R0001 - Personal Effects Storage (7.56 m2)**

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B001/R0004/Floor Coverings Res/Textile/S13	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B001 - R0002 - Home Base (57.75 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B001 - R0003 - Home Base Store (7.39 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B001/R0004/Floor Coverings Res/Textile/S13	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B001 - R0004 - Personal Effects Storage (7.6 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B001/R0004/Floor Coverings Res/Textile/S13	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B001 - R0005 - Home Base (57.52 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B001 - R0006 - Home Base Store (7.35 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B001/R0004/Floor Coverings Res/Textile/S13	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B001 - R0009 - External Movement (83.98 m2)

No Asbestos

B001 - R0010 - Staff Room - Pre (12.4 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B001 - R0011 - General Storeroom - Pre (14.99 m2)

Ceiling Structures/Linings	Vermiculite 4409/B001/R0004/Ceiling Structures/Linings/S12					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B001 - R0012 - Covered Outdoor Learning Area - Pre (56.06 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R0013 - Home Base - Pre (116.37 m2)

Ceiling Structures/Linings Vermiculite
 4409/B001/R0004/Ceiling Structures/Linings/S12 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B001 - R0014 - General Storeroom - Pre (7.24 m2)

Ceiling Structures/Linings Vermiculite
 4409/B001/R0004/Ceiling Structures/Linings/S12 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4409/B001/R0004/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B001 - R0015 - Personal Effects - Pre (7.6 m2)

Ceiling Structures/Linings Vermiculite
 4409/B001/R0004/Ceiling Structures/Linings/S12 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B001 - R0016 - External Movement (10.38 m2)

No Asbestos

B001 - R0017 - External Movement (3.57 m2)

No Asbestos

B001 - R0018 - Toilets - Boys/Girls - Pre (12.92 m2)

Partition Walls (Cubicles) Compressed AC Sheet 12m2 North, West Good Condition (1) Low (1) Low Priority (2-3)
 4409/B001/R0018/Partition Walls (Cubicles)/S14 **Chrysotile (white asbestos)**

B001 - R0019 - Laundry - Pre (3.25 m2)

No Asbestos

B001 - R0020 - Staff Toilet - Pre (1.07 m2)

No Asbestos

B001 - R0021 - Staff Room - Pre (18.4 m2)

No Asbestos

B001 - R0022 - General Storeroom - Pre (10.88 m2)

Floor Coverings Res/Textile Vinyl Tiles 11m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4409/B001/R0004/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B001 - R0023 - Distribution Board (0.61 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning/Other-Community Use - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids Non Accessible Area
- Area inaccessible

Interior**B002 - R0001 - General Storeroom (7.37 m2)**

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0002 - Special Programs Room (57.1 m2)

Floor Coverings Res/Textile Vinyl Tiles 58m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0003 - Other-Community Use (7.6 m2)

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0004 - Practical Activities - 1hb (56.8 m2)

Floor Coverings Res/Textile Vinyl Tiles 57m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0005 - General Storeroom (7.59 m2)

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0006 - Home Base Store (7.43 m2)

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 4409/B002/R0009/Ceiling Structures/Linings/S10 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B002 - R0007 - Toilets - Girls (37.15 m2)

Partition Walls (Cubicles) Compressed AC Sheet 24m2 West Good Condition (1) Low (1) Low Priority (2-3)
4409/B002/R0007/Partition Walls (Cubicles)/S11 **Chrysotile (white asbestos)**

B002 - R0008 - Staff Toilet (1.19 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B002 - R0009 - General Storeroom (7.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0010 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0011 - Home Base Store (7.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0012 - Kiln Room (7.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0013 - Canteen (56.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0014 - Home Base Store (7.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B002/R0009/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4409/B002/R0009/Ceiling Structures/Linings/S10					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B002 - R0015 - Staff Shower/Change (8.85 m2)						
No Asbestos						
B002 - R0016 - Movement (6.3 m2)						
No Asbestos						
B002 - R0017 - Cleaning Distributed Store (5.94 m2)						
No Asbestos						
B002 - R0018 - Distribution Board (0.58 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B002 - R0019 - External Movement (122.7 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B003 - R0001 - Home Base Store (7.38 m2)**

Ceiling Structures/Linings Vermiculite
4409/B003/R0008/Ceiling Structures/Linings/S19 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0002 - Home Base (57.02 m2)

Ceiling Structures/Linings Vermiculite
4409/B003/R0008/Ceiling Structures/Linings/S19 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B003 - R0003 - General Storeroom (7.56 m2)

Ceiling Structures/Linings Vermiculite
4409/B003/R0008/Ceiling Structures/Linings/S19 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0004 - Movement (3.71 m2)

Floor Coverings Res/Textile Vinyl Tiles 4m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0005 - General Storeroom (7.37 m2)

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0006 - Distribution Board (0.72 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile Vinyl Tiles 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Electrical Hazard

B003 - R0007 - General Storeroom (11.66 m2)

Floor Coverings Res/Textile Vinyl Tiles 12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0008 - Personal Effects Storage (7.56 m2)

Ceiling Structures/Linings Vermiculite
4409/B003/R0008/Ceiling Structures/Linings/S19 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B003/R0008/Floor Coverings Res/Textile/S20 **Chrysotile (white asbestos)**

B003 - R0009 - Home Base (51.94 m2)

Ceiling Structures/Linings Vermiculite
4409/B003/R0008/Ceiling Structures/Linings/S19 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B003 - R0010 - Home Base Store (7.38 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0011 - Withdrawal Space - 1hb (5.08 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B003 - R0012 - Personal Effects Storage (7.55 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0013 - Home Base (57.02 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B003 - R0014 - Home Base Store (7.34 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0015 - Toilets - Boys (34.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4409/B003/R0015/Partition Walls (Cubicles)/S18	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0016 - Staff Toilet (1.19 m2)						
No Asbestos						
B003 - R0017 - Personal Effects Storage (6.51 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0018 - Practical Activities - 1hb (1.03 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B003 - R0019 - Home Base (51.66 m2)						
Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B003 - R0020 - Home Base Store (7.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4409/B003/R0008/Floor Coverings Res/Textile/S20	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B003 - R0021 - Withdrawal Space - 1hb (5.29 m2)

Ceiling Structures/Linings	Vermiculite 4409/B003/R0008/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B003 - R0022 - External Movement (122.73 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B004 - R0001 - Personal Effects Storage (6.32 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B004 - R0002 - Home Base (77.25 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B004 - R0003 - Home Base Store (5.84 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B004 - R0004 - Toilets - Boys/Girls (3.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	------------	--------------------	---------	---

B004 - R0005 - Withdrawal Space - 1hb (8.94 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B004 - R0006 - Home Base (76.48 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B004 - R0007 - Personal Effects Storage (6.3 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B004 - R0008 - Home Base Store (5.83 m2)

Ceiling Structures/Linings	Vermiculite 4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B004 - R0009 - Toilets - Boys/Girls (3.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4409/B004/R0008/Floor Coverings Res/Textile/S15	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	------------	--------------------	---------	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B004 - R0010 - Withdrawal Space - 1hb (9.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B004 - R0011 - Home Base (82.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B004 - R0012 - Toilets - Boys/Girls (3.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B004/R0008/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B004 - R0013 - Home Base Store (6.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B004/R0008/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B004 - R0014 - Personal Effects Storage (6.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B004/R0008/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B004/R0008/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B004 - R0015 - Toilets - Boys (18.69 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B004/R0015/Partition Walls (Cubicles)/S17					Chrysotile (white asbestos)
B004 - R0016 - Toilets - Girls (21.1 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B004/R0015/Partition Walls (Cubicles)/S17					Chrysotile (white asbestos)
B004 - R0017 - Cleaning Distributed Store (2.51 m2)						
No Asbestos						
B004 - R0018 - Distribution Board (0.56 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B004 - R0019 - External Movement (130.72 m2)						
No Asbestos						
B004 - R0020 - Cleaning Distributed Store (8.06 m2)						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00A - R0001 - Library Office/Workroom (15.85 m2)**

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Movement (5.53 m2)

No Asbestos

B00A - R0003 - Clerical Office/Workroom (110.14 m2)

No Asbestos

B00A - R0006 - General Assistant/Bulk Store (12.45 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 13m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0007 - Sick Bay (22.4 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 23m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0008 - Uniform Shop (3.92 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 4m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0009 - Movement (4.72 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0012 - Deputy Principal (13.05 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0015 - Staff Toilet (4 m2)

No Asbestos

B00A - R0016 - Staff Room Annexe (7.68 m2)

Ceiling Structures/Linings Vermiculite
4409/B00A/R0007/Ceiling Structures/Linings/S1
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0017 - Movement (20.77 m2)						
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
4409/B00A/R0007/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0018 - Interview (15.85 m2)						
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
4409/B00A/R0007/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0019 - General Storeroom (6.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0020 - General Storeroom (9.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0021 - General Storeroom (5.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0022 - K.L.A. Store (49.59 m2)						
No Asbestos						
B00A - R0023 - Movement (4.23 m2)						
No Asbestos						
B00A - R0024 - Staff Toilet (6.51 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0024/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0025 - Staff Toilet (6.7 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0024/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00A - R0026 - Cleaning Distributed Store (1.37 m2)						
No Asbestos						
B00A - R0027 - Staff Room (63.61 m2)						
No Asbestos						
B00A - R0028 - External Movement (17.57 m2)						
No Asbestos						
B00A - R0029 - Main Switch Board (10.58 m2)						
No Asbestos						
B00A - R0030 - External Movement (30.32 m2)						
No Asbestos						
B00A - R0031 - Movement (2.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0032 - Canteen Office/Store (2.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4409/B00A/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0033 - Deputy Principal (26.69 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0034 - Canteen Office/Store (4.51 m2)

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0035 - Cleaning Distributed Store (5.59 m2)

No Asbestos

B00A - R0036 - External Movement (141.03 m2)

No Asbestos

B00A - R0037 - Entry Vestibule (23.2 m2)

Ceiling Structures/Linings Vermiculite 4409/B00A/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0038 - Clerical Office (33.65 m2)

Ceiling Structures/Linings Vermiculite 4409/B00A/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0039 - Principal (19.38 m2)

Ceiling Structures/Linings Vermiculite 4409/B00A/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 19m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4409/B00A/R0007/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0040 - Toilet - Lobby (1.22 m2)

No Asbestos

B00A - R0041 - Staff Toilet (1.42 m2)

No Asbestos

B00A - R0042 - Toilet - Lobby (1.23 m2)

No Asbestos

B00A - R0043 - Staff Toilet (1.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1970 - Brick/Block (Brick/Block)**Exterior**

Infill panel	Flat AC Sheeting	80m2	North, South, East, West, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/Infill panel/S8					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00B - R0001 - Home Base (61.99 m2)**

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - Home Base (62.15 m2)

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Home Base (62.15 m2)

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Home Base (62.15 m2)

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0005 - Cleaning Distributed Store (0.45 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0005/Wall Linings Internal/S7					Chrysotile (white asbestos)

B00B - R0006 - Distribution Board (0.77 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0005/Wall Linings Internal/S7					Chrysotile (white asbestos)

B00B - R0007 - Seminar/Study (18.02 m2)

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0007/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00B - R0008 - Movement (33.67 m2)

Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0007/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00B - R0009 - Movement (44.23 m2)

No Asbestos

B00B - R0010 - Hall Chair Store (11.22 m2)

No Asbestos

B00B - R0011 - Cleaning Supplies (10.63 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00B - R0012 - Raised Platform (38.81 m2)						
No Asbestos						
B00B - R0013 - Movement (9.37 m2)						
No Asbestos						
B00B - R0014 - Communal Space (132.36 m2)						
No Asbestos						
B00B - R0015 - Movement (55.53 m2)						
No Asbestos						
B00B - R0016 - Sports Store (10.49 m2)						
No Asbestos						
B00B - R0023 - External Movement (3.87 m2)						
No Asbestos						
B00B - R0024 - Toilets - Boys (100.92 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	4409/B00B/R0024/Partition Walls (Cubicles)/S4					No Asbestos Detected
B00B - R0025 - Cleaning Distributed Store (1.84 m2)						
No Asbestos						
B00B - R0026 - Staff Toilet (2.8 m2)						
No Asbestos						
B00B - R0027 - Garden Store (9.81 m2)						
No Asbestos						
B00B - R0028 - Cleaning Supplies (17.9 m2)						
No Asbestos						
B00B - R0029 - Toilets - Girls (75.52 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	4409/B00B/R0024/Partition Walls (Cubicles)/S4					No Asbestos Detected
B00B - R0030 - Staff Toilet (1.96 m2)						
No Asbestos						
B00B - R0031 - External Movement (10.93 m2)						
No Asbestos						
B00B - R0032 - Distribution Board (0.69 m2)						
				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	0.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R0033 - Stairs (7.97 m2)						
No Asbestos						
B00B - R0034 - Stairs (7.8 m2)						
No Asbestos						
B00B - R0035 - Staff Kitchen (5.43 m2)						
No Asbestos						
B00B - R0036 - Distribution Board Cupboard (0.74 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0005/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00B - R0037 - Cleaning Supplies (0.4 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0005/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00B - R0038 - Library Office/Workroom (18.51 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0039 - K.L.A. Store (18.92 m2)						
No Asbestos						
B00B - R0040 - Reading Area (246.51 m2)						
No Asbestos						
B00B - R0041 - Communications Room (10.73 m2)						
No Asbestos						
B00B - R1001 - Home Base (61.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - Cleaning Distributed Store (0.43 m2)						
No Asbestos						
B00B - R1003 - Staff Room Annexe (18.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0007/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00B - R1004 - Home Base (62 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Home Base (62 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1007 - Home Base (62 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1010 - Home Base (62.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1011 - Home Base (62.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - Home Base (62.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Home Base (61.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1016 - Home Base (61.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1017 - Home Base (61.99 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1018 - General Storeroom (18.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4409/B00B/R0007/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00B - R1019 - Cleaning Distributed Store (0.43 m2)						
No Asbestos						
B00B - R1020 - Home Base (62.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1021 - Home Base (62.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1023 - Stairs (10.92 m2)						
No Asbestos						
B00B - R1024 - Stairs (11 m2)						
No Asbestos						
B00B - R1025 - Movement (211.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	4409/B00B/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Shed - 1970 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - General Storeroom (51.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other-Community Use - 1975 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids Non Accessible Area
- Area inaccessible

Underfloor Voids - Slab No Asbestos Found
on Ground

Interior**B00D - M0009 - Withdrawal - Pre (15.03 m2)**

No Asbestos

B00D - M0010 - General Storeroom - Pre (35.86 m2)

No Asbestos

B00D - M0011 - Stairs (2.36 m2)

No Asbestos

B00D - R0001 - External Movement (22.03 m2)

No Asbestos

B00D - R0002 - Staff Room (24.73 m2)

No Asbestos

B00D - R0003 - Distribution Board (0.1 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0004 - Staff Toilet (1.87 m2)

No Asbestos

B00D - R0005 - Home Base - Pre (61.82 m2)

No Asbestos

B00D - R0006 - General Storeroom - Pre (11.54 m2)

No Asbestos

B00D - R0007 - Toilets - Boys/Girls - Pre (11.83 m2)

No Asbestos

B00D - R0008 - External Movement (22.03 m2)

No Asbestos

B00D - R0009 - Stairs (1.38 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Shed/Administration - 1970 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - General Storeroom (30.72 m2)

No Asbestos

B00E - R0002 - External Movement (9.52 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Electrical Services - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00F - R0001 - Plant (4.22 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00G - R0001 - Communal Space (198.13 m2)**

No Asbestos

B00G - R0002 - Raised Platform (58.25 m2)

No Asbestos

B00G - R0003 - Chair Storeroom (12.71 m2)

No Asbestos

B00G - R0004 - Communal/Performance Store (10.37 m2)

No Asbestos

B00G - R0005 - P.E. Store (16.4 m2)

No Asbestos

B00G - R0006 - Toilet - Lobby (2.68 m2)

No Asbestos

B00G - R0007 - Toilets - Girls (6.89 m2)

No Asbestos

B00G - R0008 - Sound Cupboard (1.85 m2)

No Asbestos

B00G - R0009 - Toilet - Lobby (3.4 m2)

No Asbestos

B00G - R0010 - Toilets - Boys (5.88 m2)

No Asbestos

B00G - R0011 - Cleaning Distributed Store (3.46 m2)

No Asbestos

B00G - R0012 - Plant (1.59 m2)

No Asbestos

B00G - R0013 - Main Switch Board (3.41 m2)

No Asbestos

B00G - R0014 - Access Shower/Toilet/Change (7.05 m2)

No Asbestos

B00G - R0015 - Covered Outdoor Learning Area (184.81 m2)

No Asbestos

B00G - R0016 - Movement (7.18 m2)

No Asbestos

B00G - R0017 - Movement (18.44 m2)

No Asbestos

B00G - R0018 - Ramp (11.72 m2)

No Asbestos

B00G - R0019 - External Movement (44.61 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017