


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : King Park Public School (4467)
Region : South Western Sydney
State Electorate : Fairfield
Local Government Area : Fairfield

Initial Survey : Noel Arnold & Associates : 14 - May - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

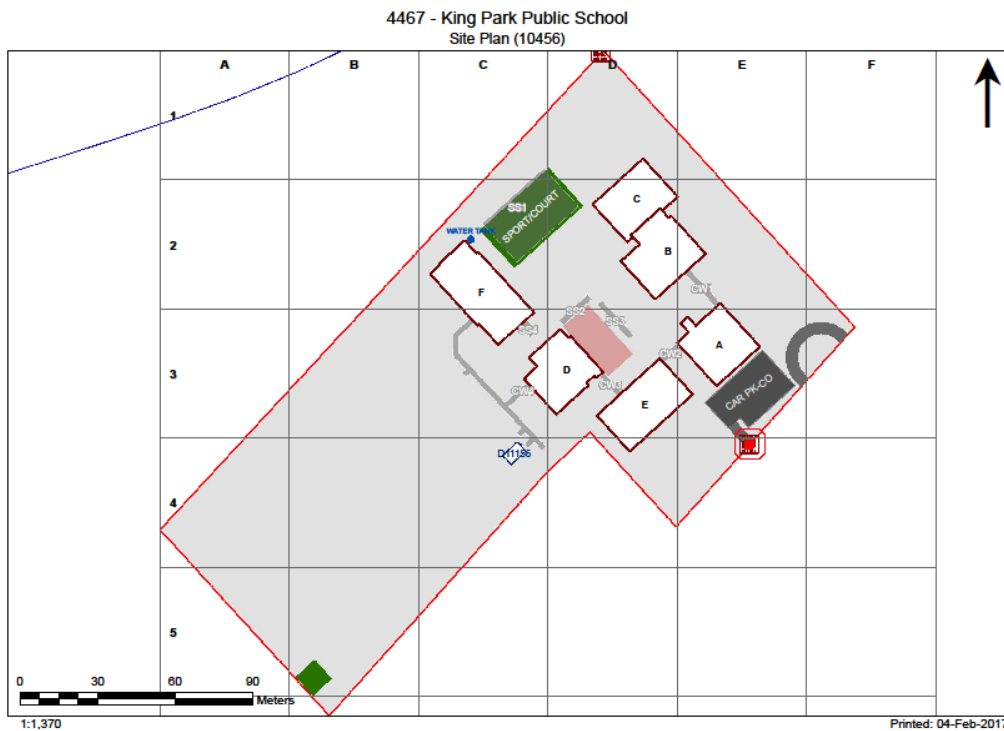

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling
Non Accessible Area
- Ceiling cavity access inaccessible. Height restriction.

Underfloor Voids - Slab on Ground
No Asbestos Found

Interior**B00A - R0001 - Deputy Principal (12.24 m2)**

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
12.24m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

B00A - R0002 - Staff Toilet (4.11 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
3m2 South Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

B00A - R0003 - Security Store (9.26 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

B00A - R0004 - Security Store (9.36 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

B00A - R0005 - Security Store (13.57 m2)

Floor Coverings Res/Textile Vinyl Tiles
14m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Distribution Board (0.72 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
0.72m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2
Chrysotile (White asbestos)

B00A - R0007 - Duplicating Workroom (12.11 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18
Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00A/R0005/Floor Coverings Res/Textile/S2	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Key Safe	Encapsulated Insulation material within unit Assumed Asbestos - Physically cannot sample	2Unit	Southwest wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Vault door	Encapsulated Insulation material within unit Assumed Asbestos - Physically cannot sample.	3.75m2	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00A - R0008 - Clerical Office (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	12.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0009 - Clerical Office/Workroom (12.64 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	12.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0010 - Sick Bay (12.24 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	12.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0011 - Community Clinic (12.55 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	12.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0012 - Movement (6.22 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00A/R0005/Floor Coverings Res/Textile/S2	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0013 - Staff Toilet (3.06 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 4467/B00A/R0013/Partition Walls (Cubicles)/S3	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0014 - Staff Toilet (3.1 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0013/Partition Walls (Cubicles)/S3					Chrysotile (White asbestos)	
B00A - R0015 - Entry Vestibule (23.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)	
B00A - R0016 - Staff Shower/Change (5.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0013/Partition Walls (Cubicles)/S3					Chrysotile (White asbestos)	
B00A - R0017 - Cleaning Distributed Store (1.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	1.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)	
B00A - R0018 - Staff Toilet (1.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0019 - Movement (3.2 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0020 - Staff Toilet (3.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0021 - General Storeroom (2.65 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	2.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)	
B00A - R0022 - Principal (16.2 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)	
B00A - R0023 - Staff Room Annexe (16.2 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0024 - Interview (9.79 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	9.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0025 - Movement (22.01 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	22.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0026 - Staff Kitchen (4.72 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0027 - Movement (5.11 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0028 - Movement (1.34 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0029 - Staff Toilet (4.02 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0030 - Staff Toilet (3.2 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 4467/B00A/R0013/Partition Walls (Cubicles)/S3	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0031 - Movement (3.09 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0032 - Staff Room (58.67 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	58.67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00A - R0033 - Movement (141.29 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1001 - Toilets - Boys (3.16 m2)

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles) Compressed AC Sheet 3m2 West Good Condition (1) Low (1) Low Priority (2-3)
 4467/B00A/R0013/Partition Walls (Cubicles)/S3 **Chrysotile (White asbestos)**

B00A - R1002 - Movement (1.48 m2)

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1003 - Distribution Board (0.86 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1004 - Cleaning Distributed Store (1.51 m2)

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4467/B00A/R0005/Floor Coverings Res/Textile/S2 **Chrysotile (White asbestos)**

B00A - R1005 - Movement (1.26 m2)

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1006 - Toilets - Girls (3.37 m2)

Ceiling Structures/Linings Vermiculite
 4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles) Compressed AC Sheet 3m2 Northwest Good Condition (1) Low (1) Low Priority (2-3)
 4467/B00A/R0013/Partition Walls (Cubicles)/S3 **Chrysotile (White asbestos)**

B00A - R1007 - K.L.A. Store (26.07 m2)

No Asbestos

B00A - R1008 - Reading Area (186.36 m2)

No Asbestos

B00A - R1009 - Reading Area (52.57 m2)

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 52.57m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 4467/B00A/R0005/Floor Coverings Res/Textile/S2 **Chrysotile (White asbestos)**

B00A - R1010 - Library Office/Workroom (6.1 m2)

No Asbestos

B00A - R1011 - Library Office/Workroom (19.49 m2)

No Asbestos

B00A - R1012 - Entry Vestibule (25.78 m2)

No Asbestos

B00A - R1013 - Movement (18.49 m2)

No Asbestos

B00A - Room+1 - Library copy & server

No Asbestos

B00A - Room+2 - Covered walkway Block A to B

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - Room+3 - External stairway

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00B - R0001 - Home Base (91.46 m2)**

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 8m2 North Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 87m2 Northwest Good Condition (1) Low (1) Low Priority (2-3)
4467/B00A/R0005/Floor Coverings Res/Textile/S2 **Chrysotile (White asbestos)**

B00B - R0002 - Toilets - Boys/Girls (3.55 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Personal Effects Storage (5.29 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

B00B - R0004 - Practical Activities - 1hb (1.54 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

B00B - R0005 - Home Base Store (4.69 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

B00B - R0006 - Home Base Store (4.67 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

B00B - R0007 - Practical Activities - 1hb (1.54 m2)

Ceiling Structures/Linings Vermiculite 2m2 Throughout Friable Asbestos (5) Low (1) Low Priority (2-3)
Assumed Asbestos

Floor Coverings Res/Textile Vinyl Tiles 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R1019/Floor Coverings Res/Textile/S5 **Chrysotile (White asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0008 - Personal Effects Storage (5.26 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00B/R1019/Floor Coverings Res/Textile/S5	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00B - R0009 - Toilets - Boys/Girls (3.53 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0010 - Home Base (91.67 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00B/R1019/Floor Coverings Res/Textile/S5	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	88m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00B - R0011 - Garden Store (2.58 m2)						
Internal door lining	Flat AC Sheeting 4467/B00B/R0011/Internal door lining/S19	4m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0012 - Movement (236.16 m2)						
No Asbestos						
B00B - R0013 - Movement (79.13 m2)						
No Asbestos						
B00B - R0014 - Chess shed						
No Asbestos						
B00B - R1001 - Movement (41.02 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1002 - Movement (55.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00A/R0005/Floor Coverings Res/Textile/S2	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1003 - Practical Activities - 1hb (0.86 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1004 - Personal Effects Storage (5.73 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1005 - Home Base Store (7.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00B/R1002/Ceiling Structures/Linings/S15					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1006 - Home Base (63.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)
B00B - R1007 - Home Base (63.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00B/R1002/Ceiling Structures/Linings/S15					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)
B00B - R1008 - Home Base Store (7.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00B/R1002/Ceiling Structures/Linings/S15					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1009 - Personal Effects Storage (5.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00B/R1002/Ceiling Structures/Linings/S15					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive.					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1010 - Practical Activities - 1hb (0.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00B/R1002/Ceiling Structures/Linings/S15					<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1011 - Practical Activities - 1hb (0.86 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1012 - Personal Effects Storage (5.76 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1013 - Home Base Store (7.09 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1014 - Home Base (63.96 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00A/R0005/Floor Coverings Res/Textile/S2	63.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (White asbestos)</i>
B00B - R1015 - Home Base (63.96 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1016 - Home Base Store (7.09 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1017 - Personal Effects Storage (5.78 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1018 - Practical Activities - 1hb (0.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00B/R1002/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive.					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00B - R1019 - Movement (4.17 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids Non Accessible Area
- Ceiling void entrance covered by netting. Thus inaccessible.

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00C - R0001 - Toilets - Boys/Girls (3.48 m2)**

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0002 - Home Base Store (4.23 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00C - R0003 - Personal Effects Storage (10.58 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 11m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00C - R0004 - Practical Activities - 1hb (4.86 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 4.86m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00C - R0005 - Distribution Board (0.83 m2)

Note: No inspection of live electrical installation.

Door linings internal Flat AC Sheeting 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00B/R0011/Internal door lining/S19 **Chrysotile (white asbestos)**

B00C - R0006 - Sports Store (22.87 m2)

No Asbestos

B00C - R0007 - Cleaning Supplies (24.97 m2)

No Asbestos

B00C - R0008 - Personal Effects Storage (9.54 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00C - R0009 - Practical Activities - 1hb (1.97 m2)

Ceiling Structures/Linings Vermiculite
4467/B00A/R0002/Ceiling Structures/Linings/S18 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0010 - Toilets - Boys/Girls (3.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0011 - Home Base Store (6.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
B00C - R0012 - Home Base (92.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	80m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
B00C - R0013 - Home Base (95.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
B00C - R0014 - Toilets - Girls (43.44 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0014/Partition Walls (Cubicles)/S8					Chrysotile (White asbestos)
B00C - R0015 - Toilets - Boys (43.5 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0014/Partition Walls (Cubicles)/S8					Chrysotile (White asbestos)
B00C - R0016 - Movement (79 m2)						
No Asbestos						
B00C - R1001 - Practical Activities - 1hb (0.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					
Floor Coverings Res/Textile	Linoleum adhesive					No Asbestos Detected
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					
B00C - R1002 - Personal Effects Storage (5.74 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1003 - Home Base Store (6.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Ceiling Structures/Linings	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1004 - Home Base (63.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)
B00C - R1005 - Cleaning Distributed Store (0.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00A/R0005/Floor Coverings Res/Textile/S2					Chrysotile (White asbestos)
B00C - R1006 - Personal Effects Storage (6.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1007 - Home Base Store (7.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive					
	4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1008 - Home Base (63.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	4467/B00A/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00C/R0013/Floor Coverings Res/Textile/S7					Chrysotile (White asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1009 - Cleaning Distributed Store (0.31 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4467/B00C/R0013/Floor Coverings Res/Textile/S7	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Wall Linings Internal	Flat AC Sheeting 4467/B00C/R1010/Wall Linings Internal/S9	3m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Door linings internal	Flat AC Sheeting 4467/B00C/R1010/Wall Linings Internal/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00C - R1010 - Distribution Board (0.53 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 4467/B00C/R1010/Wall Linings Internal/S9	3m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Door linings internal	Flat AC Sheeting 4467/B00C/R1010/Wall Linings Internal/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00C - R1011 - General Storeroom (19.75 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	19.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00C - R1012 - Personal Effects Storage (6.8 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1013 - Home Base Store (7 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected
B00C - R1014 - Home Base (63.97 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	63.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - R1015 - Practical Activities - 1hb (0.86 m2)

Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00C - R1016 - Personal Effects Storage (5.73 m2)

Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00C - R1017 - Home Base Store (7.14 m2)


Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 4467/B00B/R1004/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Linoleum adhesive 4467/B00B/R1004/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00C - R1018 - Home Base (63.9 m2)

Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	63.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)

B00C - R1019 - Movement (34.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4467/B00C/R0013/Floor Coverings Res/Textile/S7	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite 4467/B00C/R1019/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

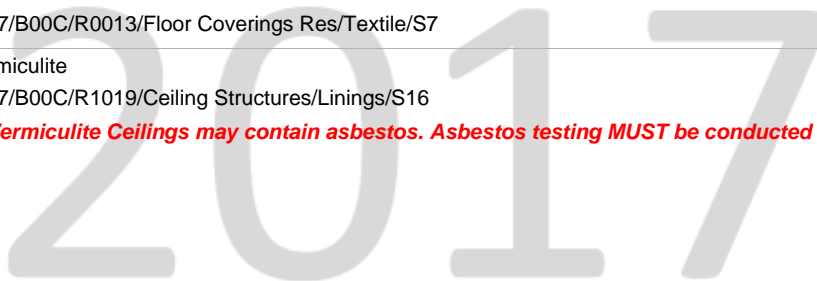

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00D - R0001 - Security Store (6.79 m2)**

Vault door Encapsulated Insulation material within unit 3.75m2 South Friable Asbestos (5) Low (1) Low Priority (2-3)

Assumed Asbestos - Physically unable to sample.

B00D - R0002 - Home Base (66.06 m2)

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 66.06m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00D - R0003 - Home Base (66.25 m2)

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 66.25m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

B00D - R0004 - Personal Effects Storage (32.74 m2)

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - Cleaning Distributed Store (0.38 m2)

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Sheet
4467/B00B/R1004/Floor Coverings Res/Textile/S20 **No Asbestos Detected**

Floor Coverings Res/Textile Linoleum adhesive
4467/B00B/R1004/Floor Coverings Res/Textile/S21 **No Asbestos Detected**

Door lining internal Flat AC Sheeting 2m2 Throughout Minimal Damage (2) Low (1) Low Priority (2-3)
4467/B00D/R0005/Door lining internal/S22 **Chrysotile (white asbestos)**

B00D - R0006 - Distribution Board (0.75 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Wall Linings Internal Flat AC Sheeting 2m2 West Good Condition (1) Low (1) Low Priority (2-3)
4467/B00D/R0006/Wall Linings Internal/S11 **Chrysotile (White asbestos)**

B00D - R0007 - General Storeroom (18.09 m2)

Ceiling Structures/Linings Vermiculite
4467/B00D/R1004/Ceiling Structures/Linings/S17 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 18.09m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4467/B00C/R0013/Floor Coverings Res/Textile/S7 **Chrysotile (White asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0008 - Home Base (65.78 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	65.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00D - R0009 - Home Base (65.95 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	65.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00D - R0010 - Movement (141.58 m2)						
No Asbestos						
B00D - R0011 - Movement Block D-F						
No Asbestos						
B00D - R0012 - Awnings North & NE of BlockD						
No Asbestos						
B00D - R1001 - Home Base (66.25 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	66.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00D - R1002 - Home Base (66.08 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	66.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00D - R1003 - Movement (42.74 m2)						
No Asbestos						
B00D - R1004 - Personal Effects Storage (49.74 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1005 - Home Base (65.76 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0014/Partition Walls (Cubicles)/S8	65.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)
B00D - R1006 - Home Base (65.86 m2)						
Ceiling Structures/Linings	Vermiculite 4467/B00D/R1004/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4467/B00C/R0013/Floor Coverings Res/Textile/S7	65.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (White asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	Non Accessible Area - No visible ceiling void entrance.

Interior**B00E - R0001 - General Assistant/Bulk Store (15.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)	

B00E - R0002 - Main Switch Board (12.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)	

Flat AC sheeting	Flat AC Sheeting	4467/B00E/R0002/Flat AC sheeting/S23				No Asbestos Detected
------------------	------------------	--------------------------------------	--	--	--	-----------------------------

B00E - R0003 - Canteen (34.18 m2)

No Asbestos

B00E - R0004 - Staff Toilet (1.92 m2)

No Asbestos

B00E - R0005 - Canteen Office/Store (2.52 m2)

No Asbestos

B00E - R0006 - Canteen Office/Store (2.66 m2)

No Asbestos

B00E - R0007 - General Storeroom (2.46 m2)

Floor Coverings Res/Textile	Vinyl Sheet	4467/B00E/R0008/Floor Coverings Res/Textile/S24				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	-----------------------------

Floor Coverings Res/Textile	Vinyl sheet adhesive	4467/B00E/R0008/Floor Coverings Res/Textile/S25				No Asbestos Detected
-----------------------------	----------------------	---	--	--	--	-----------------------------

B00E - R0008 - Communal Space (176.57 m2)

Floor Coverings Res/Textile	Vinyl Sheet	4467/B00E/R0008/Floor Coverings Res/Textile/S24				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	-----------------------------

Floor Coverings Res/Textile	Vinyl sheet adhesive	4467/B00E/R0008/Floor Coverings Res/Textile/S25				No Asbestos Detected
-----------------------------	----------------------	---	--	--	--	-----------------------------

B00E - R0009 - P.E. Store (9.59 m2)

No Asbestos

B00E - R0010 - General Assistant/Bulk Store (21.54 m2)

No Asbestos

B00E - R0011 - Toilets - Boys (64.66 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00E/R0014/Partition Walls (Cubicles)/S12					Chrysotile (White asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)	

B00E - R0012 - Out Of School Hours Care Centre (2.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00E/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet Adhesive					
	4467/B00E/R0008/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00E - R0013 - Out Of School Hours Care Centre (2.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	4467/B00E/R0008/Floor Coverings Res/Textile/S24					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl sheet adhesive					
	4467/B00E/R0008/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00E - R0014 - Toilets - Girls (64.61 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00E/R0014/Partition Walls (Cubicles)/S12					Chrysotile (White asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4467/B00E/R0014/Ceiling Structures/Linings/S13					Chrysotile (White asbestos)
B00E - R0015 - Movement (20.16 m2)						
No Asbestos						
B00E - R0016 - Movement (137.34 m2)						
No Asbestos						
B00E - R0017 - Movement Block E-D (including Block D Stairs)						
No Asbestos						
B00E - R0018 - Movement Block A-E						
No Asbestos						
B00E - R0019 - General Assist/Bulk Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Communal Space (201.78 m2)

No Asbestos

B00F - R0002 - Raised Platform (58.42 m2)

No Asbestos

B00F - R0003 - Hall Chair Store (12.64 m2)

No Asbestos

B00F - R0004 - Communal/Performance Store (10.26 m2)

No Asbestos

B00F - R0005 - P.E. Store (16.35 m2)

No Asbestos

B00F - R0006 - Toilet - Lobby (2.47 m2)

No Asbestos

B00F - R0007 - Toilets - Girls (7.26 m2)

No Asbestos

B00F - R0008 - Sound Cupboard (2.15 m2)

No Asbestos

B00F - R0009 - Toilet - Lobby (3.43 m2)

No Asbestos

B00F - R0010 - Toilets - Boys (5.79 m2)

No Asbestos

B00F - R0011 - Cleaning Distributed Store (3.54 m2)

No Asbestos

B00F - R0012 - Plant (1.63 m2)

No Asbestos

B00F - R0013 - Main Switch Board (3.24 m2)

No Asbestos

B00F - R0014 - Access Shower/Toilet (7.03 m2)

No Asbestos

B00F - R0015 - External Movement (57.02 m2)

No Asbestos

B00F - R0016 - Movement (17.7 m2)

No Asbestos

B00F - R0017 - Movement (12.89 m2)

No Asbestos

B00F - R0018 - Movement (4.76 m2)

No Asbestos

B00F - R0019 - External Movement (16.91 m2)

No Asbestos

B00F - R0020 - Covered Outdoor Learning Area (198.36 m2)

No Asbestos

B00F - R0021 - Canteen (41.81 m2)

No Asbestos

B00F - R0022 - Canteen Office/Store (10.19 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00F - R0023 - SE Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Sport/Court

Exterior

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00H - R0001 - Under Awning

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.
OS 750 - D11156 - Learning Unit - ESL : Placement Date - 10/01/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017