


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kareela Public School (4488)  
**Region :** Sydney  
**State Electorate :** Miranda  
**Local Government Area :** Sutherland

**Initial Survey :** Noel Arnold & Associates : 30 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 28 - Sep - 2015

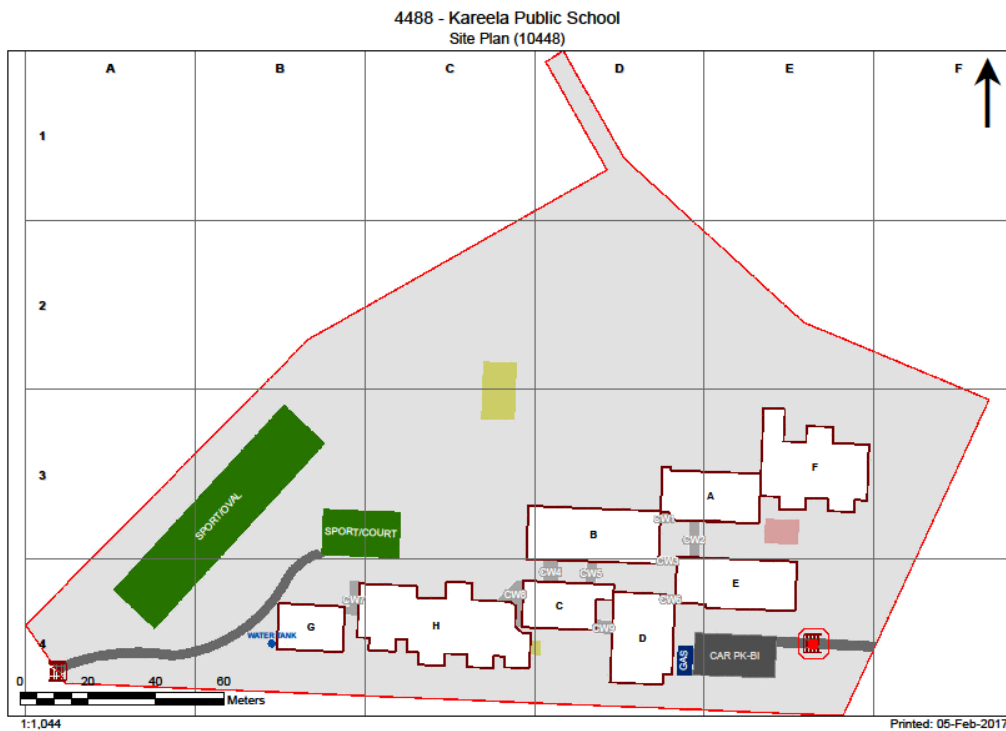

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - General Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/Gable verge lining/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Covered Walkway Ceiling	Flat AC Sheeting	20m2	Between B00A & B00E	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
<b>Interior</b>						
<b>B00A - R0001 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0002 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0009/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0003 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00A - R0004 - Toilets - Boys/Girls</b>						
No Asbestos						
<b>B00A - R0005 - Home Base</b>						
No Asbestos						
<b>B00A - R0006 - Home Base</b>						
No Asbestos						
<b>B00A - R0007 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00A - R0008 - Toilets - Boys/Girls</b>						
No Asbestos						
<b>B00A - R0009 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0009/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0010 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0011 - Distribution Board</b>						
Electrical Backing Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Electrical Hazard</b>
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0012 - General Assistant/Bulk Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0012/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4488/B00A/R0015/Floor Coverings Res/Textile/S23	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Adhesive to vinyl tiles	Adhesive 4488/B00A/R0015/Adhesive to vinyl tiles/S24					<b>No Asbestos Detected</b>
<b>B00A - R0013 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00A - R0014 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0015 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4488/B00A/R0012/Floor Coverings Res/Textile/S4	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4488/B00A/R0015/Floor Coverings Res/Textile/S23	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Adhesive to vinyl tiles	Adhesive 4488/B00A/R0015/Adhesive to vinyl tiles/S24					<b>No Asbestos Detected</b>
<b>B00A - R0016 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4488/B00F/R0001/Ceiling Structures/Linings/S1	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting 4488/B00F/R0001/Ceiling Structures/Linings/S1	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0017 - External Movement</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library/Pupil Facilities - 1989 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Covered Walkway Ceiling	Flat AC Sheeting	15m2	Between B00B and B0E	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Covered Walkway Ceiling	Flat AC Sheeting	15m2	Between B00B and B00C	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

**Interior****B00B - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

**B00B - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0005/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

**B00B - R0005 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0005/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

**B00B - R0006 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

**B00B - R0007 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

**B00B - R0012 - External Movement**

No Asbestos

**B00B - R0013 - Movement**

No Asbestos

**B00B - R0014 - Library Office/Workroom**

No Asbestos

**B00B - R0015 - K.L.A. Store**

No Asbestos

**B00B - R0016 - Reading Area**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00D/Gable Verge Lining/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible. Inaccessible in rooms CR0002 & 0003					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Covered Walkway Ceiling	Flat AC Sheeting	15m2	Between B00B and B00C	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**Interior****B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	4m2	West, upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - General Storeroom**

No Asbestos

**B00C - R0003 - Special Programs Room**

No Asbestos

**B00C - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Toilets - Girls**

No Asbestos

**B00C - R0006 - External Movement**

Wall Linings Internal	Flat AC Sheeting	4488/B00C/R0006/Wall Linings Internal/S22				<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	2m2	West, upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00C - R0007 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00C/R0007/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Adhesive to vinyl tiles	Adhesive	4488/B00C/R0007/Adhesive to vinyl tiles/S21				<b>No Asbestos Detected</b>

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base**

No Asbestos

**B00C - R0010 - Practical Activities - 1hb**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00C/R0007/Floor Coverings Res/Textile/S20				<b>Chrysotile (white asbestos)</b>	
Adhesive to vinyl tiles	Adhesive					
	4488/B00C/R0007/Adhesive to vinyl tiles/S21				<b>No Asbestos Detected</b>	

**B00C - R0011 - Toilets - Boys**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Communal Facilities/Pupil Facilities - 1980 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00D/Gable Verge Lining/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00D - M0001 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00D/M0001/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>

**B00D - M0002 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00D/M0001/Wall Linings Internal/S17					<b>Chrysotile (white asbestos)</b>

**B00D - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0012/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4488/B00D/R0002/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>
Adhesive to Vinyl Floor Tiles (S11)	Adhesive					<b>No Asbestos Detected</b>
	4488/B00D/R0002/Adhesive to Vinyl Floor Tiles (S11)/S12					<b>No Asbestos Detected</b>

**B00D - R0003 - Canteen Office/Store**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0012/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Adhesive to Vinyl Floor Tiles (S11)	Adhesive					<b>No Asbestos Detected</b>
	4488/B00D/R0004/Adhesive to Vinyl Floor Tiles (S11)/S14					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	4488/B00D/R0004/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>

**B00D - R0004 - Canteen Office/Store**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00A/R0012/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	4488/B00D/R0004/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>
Adhesive to Vinyl Floor Tiles (S11)	Adhesive					<b>No Asbestos Detected</b>
	4488/B00D/R0004/Adhesive to Vinyl Floor Tiles (S11)/S14					<b>No Asbestos Detected</b>

**B00D - R0005 - Staff Toilet**

No Asbestos

**B00D - R0006 - Canteen**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Adhesive to Vinyl Floor Tiles (S11)	Adhesive 4488/B00D/R0004/Adhesive to Vinyl Floor Tiles (S11)/S14					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 4488/B00D/R0004/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 4488/B00D/R0004/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 4488/B00A/R0012/Floor Coverings Res/Textile/S4	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00D - R0007 - Distribution Board</b>				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
<b>B00D - R0008 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet 4488/B00D/R0008/Floor Coverings Res/Textile/S15					No Asbestos Detected
Adhesive to Vinyl Sheet	Adhesive 4488/B00D/R0008/Adhesive to Vinyl Sheet/S16					No Asbestos Detected
<b>B00D - R0009 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00D - R0010 - Movement</b>						
No Asbestos						
<b>B00D - R0011 - Hall Chair Store</b>						
No Asbestos						
<b>B00D - R0012 - Communal Space</b>						
No Asbestos						
<b>B00D - R0013 - Hall Chair Store</b>						
No Asbestos						
<b>B00D - R0014 - Raised Platform</b>						
Floor Coverings Res/Textile	Vinyl Sheet 4488/B00D/R0008/Floor Coverings Res/Textile/S15					No Asbestos Detected
Adhesive to Vinyl Sheet	Adhesive 4488/B00D/R0008/Adhesive to Vinyl Sheet/S16					No Asbestos Detected
<b>B00D - R0015 - Movement</b>						
No Asbestos						
<b>B00D - R0016 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00D - R0017 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet 4488/B00D/R0008/Floor Coverings Res/Textile/S15					No Asbestos Detected
Adhesive to Vinyl Sheet	Adhesive 4488/B00D/R0008/Adhesive to Vinyl Sheet/S16					No Asbestos Detected
<b>B00D - R0018 - Sports Store</b>						
No Asbestos						
<b>B00D - R0019 - Movement</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00D/R0008/Floor Coverings Res/Textile/S15					<b>No Asbestos Detected</b>

Adhesive to Vinyl Sheet	Adhesive					
	4488/B00D/R0008/Adhesive to Vinyl Sheet/S16					<b>No Asbestos Detected</b>

**B00D - R0020 - Cleaning Distributed Store**

No Asbestos

**B00D - R0032 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Administration/Staff Facilities - 1962 - Brick/Block (Brick/Block)****Exterior**

Gable verge lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/Gable verge lining/S2					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Covered Walkway Ceiling	Flat AC Sheeting	15m2	Between B00E and B00B	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00B/R0001/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
Covered Walkway Ceiling	Flat AC Sheeting	20m2	Between B00A and B00E	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**Interior****B00E - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00E/R0001/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0002 - Staff Room**

Floor Coverings Res/Textile	Vinyl Tiles					
	4488/B00D/R0004/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>
Adhesive to Vinyl Floor Tiles (S11)	Adhesive					
	4488/B00D/R0004/Adhesive to Vinyl Floor Tiles (S11)/S14					<b>No Asbestos Detected</b>

**B00E - R0003 - Staff Toilet**

No Asbestos

**B00E - R0004 - Cleaning Distributed Store**

No Asbestos

**B00E - R0005 - Staff Toilet**

No Asbestos

**B00E - R0006 - Sick Bay**

No Asbestos

**B00E - R0007 - Staff Room Annexe**

No Asbestos

**B00E - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00E/R0001/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0009 - General Storeroom**

No Asbestos

**B00E - R0010 - Security Store**

Floor Coverings Res/Textile	Vinyl Tiles					
	4488/B00E/R0010/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>
Adhesive to vinyl tiles	Adhesive					
	4488/B00E/R0010/Adhesive to vinyl tiles/S26					<b>No Asbestos Detected</b>
Safe	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible. Tag 'Chubb'</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R0011 - Staff Room Annexe</b>						
No Asbestos						
<b>B00E - R0012 - Movement</b>						
No Asbestos						
<b>B00E - R0013 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4488/B00E/R0001/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00E - R0014 - Main Switch Board</b>						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00E - R0015 - Deputy Principal</b>						
No Asbestos						
<b>B00E - R0016 - Principal</b>						
No Asbestos						
<b>B00E - R0017 - Entry Vestibule</b>						
No Asbestos						
<b>B00E - R0018 - Movement</b>						
No Asbestos						
<b>B00E - R0019 - Clerical Office</b>						
No Asbestos						
<b>B00E - R0020 - Duplicating Workroom</b>						
No Asbestos						
<b>B00E - R0022 - Staff Toilet</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00E/R0023/Floor Coverings Res/Textile/S27					<b>No Asbestos Detected</b>	
<b>B00E - R0023 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00E/R0023/Floor Coverings Res/Textile/S27					<b>No Asbestos Detected</b>	
<b>B00E - R0024 - Interview</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Pupil Facilities - 1982 - Brick/Block (Brick/Block)**

**Exterior**

Gable verge lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/Gable verge lining/S2					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	20m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids	Non Accessible Area					
	- Area inaccessible					

**Interior**

**B00F - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	103m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

**B00F - R0003 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

**B00F - R0004 - Home Base**

No Asbestos

**B00F - R0005 - Home Base Store**

No Asbestos

**B00F - R0006 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0007 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

**B00F - R0008 - Home Base**

No Asbestos

**B00F - R0009 - Home Base Store**

No Asbestos

**B00F - R0010 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0011 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	3Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00F - R0012 - Home Base**

No Asbestos

**B00F - R0013 - Home Base Store**

No Asbestos

**B00F - R0014 - Withdrawal Space - 1hb**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0015 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>
Kiln	Encapsulated Insulation material within unit	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					
<b>B00F - R0016 - Home Base</b>						
No Asbestos						
<b>B00F - R0017 - Home Base Store</b>						
No Asbestos						
<b>B00F - R0018 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>
<b>B00F - R0019 - P.E. Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>
<b>B00F - R0020 - Special Programs Room</b>						
No Asbestos						
<b>B00F - R0021 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00F - R0022 - Toilets - Girls</b>						
No Asbestos						
<b>B00F - R0023 - Toilets - Boys</b>						
No Asbestos						
<b>B00F - R0024 - Staff Toilet</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - External Movement**

No Asbestos

**B00G - R0002 - Home Base Store**

No Asbestos

**B00G - R0003 - Home Base**

No Asbestos

**B00G - R0004 - Withdrawal Space - 1hb**

No Asbestos

**B00G - R0005 - Special Programs Room - Type 2**

No Asbestos

**B00G - R0006 - Special Programs Store**

No Asbestos

**B00G - R0007 - Practical Activities/Movement - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Pupil Facilities - 1976 - Brick/Block (Brick/Block)****Exterior**

Gable verge lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00H/Gable verge lining/S19				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	80m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00H - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	86m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

**B00H - R0002 - Security Store**

No Asbestos

**B00H - R0003 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Hatch cover	Flat AC Sheeting	1m2	Central	Good Condition (1)	Low (1)	Low Priority (2-3)
	4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

**B00H - R0004 - Special Programs Room**

No Asbestos

**B00H - R0005 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00H - R0006 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00H - R0007 - Home Base**

No Asbestos

**B00H - R0008 - Home Base Store**

No Asbestos

**B00H - R0009 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0010 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00H - R0011 - Home Base**

No Asbestos

**B00H - R0012 - Home Base Store**

No Asbestos

**B00H - R0013 - Withdrawal Space - 1hb**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00H - R0014 - Distribution Board</b>				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	3Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Tag 'Lebah'</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4488/B00F/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0015 - Home Base</b>						
No Asbestos						
<b>B00H - R0016 - Home Base Store</b>						
No Asbestos						
<b>B00H - R0017 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00H - R0018 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>		
Kiln	Encapsulated Insulation material within unit	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B00H - R0019 - Home Base Store</b>						
No Asbestos						
<b>B00H - R0020 - Home Base</b>						
No Asbestos						
<b>B00H - R0021 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>		
<b>B00H - R0022 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>		
<b>B00H - R0023 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00D/R0008/Floor Coverings Res/Textile/S15				<b>No Asbestos Detected</b>		
Adhesive to Vinyl Sheet	Adhesive					
4488/B00D/R0008/Adhesive to Vinyl Sheet/S16				<b>No Asbestos Detected</b>		
<b>B00H - R0024 - Home Base</b>						
No Asbestos						
<b>B00H - R0025 - Home Base Store</b>						
No Asbestos						
<b>B00H - R0026 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00H - R0027 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>		
<b>B00H - R0028 - Home Base Store</b>						
No Asbestos						
<b>B00H - R0029 - Home Base</b>						
No Asbestos						
<b>B00H - R0030 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>		



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
<b>B00H - R0031 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
4488/B00H/R0005/Floor Coverings Res/Textile/S10						<b>No Asbestos Detected</b>
<b>B00H - R0032 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4488/B00F/R0001/Ceiling Structures/Linings/S1						<b>Chrysotile (white asbestos)</b>
<b>B00H - R0033 - Toilets - Girls</b>						
No Asbestos						
<b>B00H - R0034 - Toilets - Boys</b>						
No Asbestos						
<b>B00H - R0035 - Staff Toilet</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D12437 - Learning Unit - Standard With P.A.A. : Placement Date - 29/06/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4488\_ASB\_150514\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017