


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kurri Kurri Public School (7422)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Cessnock

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Greencap-NAA : 16 - Jun - 2015

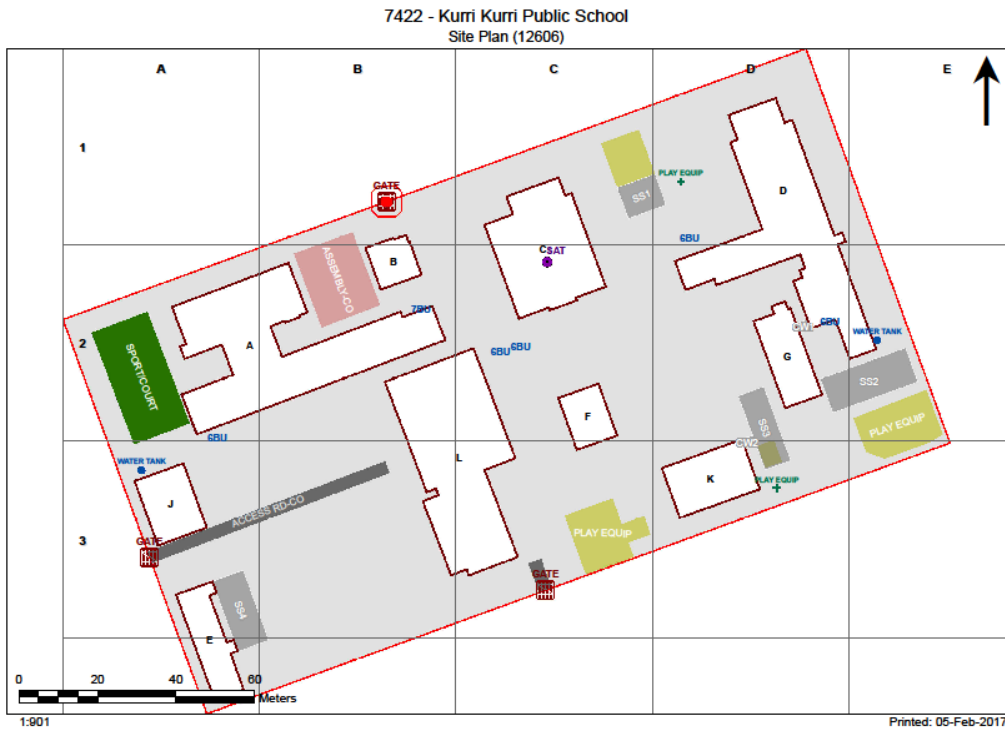

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Communal Facilities - 1904 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South, East, West.	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/Eaves Linings/S15					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	0.1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/Underfloor Voids - Packing to Floor Joists/S20					Chrysotile (white asbestos)

Interior**B00A - R0001 - Movement**

Floor Coverings Res/Textile	Compressed AC Sheet					
	7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00A - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0002/Wall Linings Internal/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0002/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00A - R0003 - Staff Room Annexe

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00A - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00A - R0012 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting					
	7422/B00A/R0012/Wall Linings Internal/S17					No Asbestos Detected
Floor Coverings Res/Textile	Compressed AC Sheet	9.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Compressed fibromunder tiles.**B00A - R0013 - Cleaning Distributed Store**

No Asbestos

B00A - R0014 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0015 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0016 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Staff Toilet						
No Asbestos						
B00A - R0020 - Staff Toilet						
No Asbestos						
B00A - R0021 - Toilets - Girls						
No Asbestos						
B00A - R0022 - Toilets - Boys						
No Asbestos						
B00A - R0025 - Movement						
Floor Coverings Res/Textile	Compressed AC Sheet					
7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected	
B00A - R0026 - Practical Activities - 1hb						
No Asbestos						
B00A - R0027 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0028 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0029 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0030 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0031 - Craft Store						
No Asbestos						
B00A - R0032 - Movement						
No Asbestos						
B00A - R0033 - Toilets - Girls						
No Asbestos						
B00A - R0034 - Toilets - Boys						
No Asbestos						
B00A - R0036 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00A/R0037/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	
B00A - R0037 - Practical Activities - 1hb						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7422/B00A/R0037/Floor Coverings Res/Textile/S16	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0038 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7422/B00A/R0037/Floor Coverings Res/Textile/S16	57.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0039 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7422/B00A/R0037/Floor Coverings Res/Textile/S16	20.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0040 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7422/B00A/R0037/Floor Coverings Res/Textile/S16	60.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R0041 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7422/B00A/R0037/Floor Coverings Res/Textile/S16	9.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
B00A - R9001 - General Assistant/Bulk Store						
No Asbestos						
B00A - R9002 - General Assistant/Bulk Store						
No Asbestos						
B00A - R9003 - General Storeroom						
Wall Linings Internal	Compressed AC Sheet 7422/B00A/R9003/Wall Linings Internal/S19					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration - 1909 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Vinyl Tiles	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
7422/B00B/Underfloor Voids/S10					Chrysotile (white asbestos)	

Interior

B00B - R0001 - External Movement

No Asbestos

B00B - R0002 - General Storeroom

No Asbestos

B00B - R0003 - Staff Toilet

Infill panel	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00B/R0003/Infill panel/S9					Chrysotile (white asbestos)	

B00B - R0004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00B/R0003/Infill panel/S9					Chrysotile (white asbestos)	

B00B - R0005 - Security Store

No Asbestos

B00B - R0006 - Cleaning Distributed Store

No Asbestos

B00B - R0007 - Movement

No Asbestos

B00B - R0008 - Principal

No Asbestos

B00B - R0009 - Clerical Office

No Asbestos

B00B - R0010 - Clerical Office

No Asbestos

B00B - R0011 - Duplicating Workroom

No Asbestos

B00B - R0012 - Entry Vestibule

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Staff Facilities - 1909 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting	8m2	Roof Area	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/In-fill-panel/S4					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/Underfloor Voids/S21					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Window putty.	Putty					No Asbestos Detected
	7422/B00D/Window putty/S31					

Interior**B00C - R0001 - Movement**

Floor Coverings Res/Textile	Compressed AC Sheet					
	7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00C - R0002 - Interview

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00C/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00C/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00C - R0005 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00C/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00C - R0006 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00C/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00C - R0008 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00C/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00C - R0009 - General Storeroom

Chalk Board	Flat AC Sheeting	0.1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/R0009/Chalk Board/S28					Chrysotile (white asbestos)

B00C - R0010 - Seminar/Study

No Asbestos

B00C - R0011 - Seminar/Study

No Asbestos

B00C - R0012 - Reading Area

No Asbestos

B00C - R0013 - Reading Area

No Asbestos

B00C - R0014 - Reading Area

Floor Coverings Res/Textile	Resinous Membrane					
	7422/B00C/R0014/Floor Coverings Res/Textile/S27					No Asbestos Detected

B00C - R0015 - Library Office/Workroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0016 - K.L.A. Store						
No Asbestos						
B00C - R0017 - Communications Room						
No Asbestos						
B00C - R0018 - Distribution Board						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7422/B00C/R0019/Wall Linings Internal/S23					
Electrical Backing Board	Resinous Board	0.2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00C - R0019 - Disabled Toilet						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7422/B00C/R0019/Wall Linings Internal/S23					
B00C - R0020 - Movement						
No Asbestos						
B00C - R0021 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7422/B00C/R0019/Wall Linings Internal/S23					
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/R0021/Partition Walls (Cubicles)/S24					Chrysotile (white asbestos)
B00C - R0022 - Reading Area						
No Asbestos						
B00C - R0023 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7422/B00C/R0023/Floor Coverings Res/Textile/S25					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	7422/B00C/R0019/Wall Linings Internal/S23					
B00C - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/R0024/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00C - R0025 - Movement						
No Asbestos						
B00C - R0026 - Staff Room Annexe						
No Asbestos						
B00C - R0027 - Special Programs Room						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Pupil Facilities - 1917 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Window putty	Putty					No Asbestos Detected
	7422/B00D/Window putty/S31					
Eaves Linings	Flat AC Sheeting	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00D/R0032/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	0.1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	7422/B00D/Underfloor Voids/S32					Chrysotile (white asbestos)

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0004 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0008 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0010 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					

B00D - R0012 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0013 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0014 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0015 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0016 - Movement						
No Asbestos						
B00D - R0017 - Movement						
No Asbestos						
B00D - R0018 - Toilets - Girls						
No Asbestos						
B00D - R0019 - Toilets - Boys						
No Asbestos						
B00D - R0020 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0022 - Movement						
No Asbestos						
B00D - R0023 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0024 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0025 - Movement						
In-fill-panel	Flat AC Sheeting	0.1m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00C/R0024/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
B00D - R0026 - Special Programs Room						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0027 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0028 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R0029 - Sports Store						
Wall Linings Internal	Flat AC Sheeting					
	7422/B00D/R0037/Wall Linings Internal/S30					No Asbestos Detected
B00D - R0030 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos							
B00D - R0031 - General Storeroom							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
7422/B00D/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)			
B00D - R0032 - Movement							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
7422/B00D/R0032/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)			
B00D - R0033 - Toilets - Girls							
No Asbestos							
B00D - R0034 - Toilets - Boys							
No Asbestos							
B00D - R0035 - General Storeroom							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
7422/B00D/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)			
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	
7422/B00D/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)			
B00D - R0036 - Access Shower/Toilet							
Wall Linings Internal	Flat AC Sheeting	7422/B00D/R0037/Wall Linings Internal/S30				No Asbestos Detected	
Fibro under tiles.	Compressed AC Sheet	9.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Area inaccessible							
B00D - R0037 - Movement							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
7422/B00D/R0032/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)			
Wall Linings Internal	Flat AC Sheeting	7422/B00D/R0037/Wall Linings Internal/S30				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1928 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00E/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected	

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Home Base

No Asbestos

B00E - R0004 - Practical Activities - 1hb

Manhole lid	Flat AC Sheeting	0.2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7422/B00E/R0004/Manhole lid/S12					Chrysotile (white asbestos)	

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Movement

No Asbestos

B00E - R0007 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1994 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 7422/B00F/R0001/Ceiling Structures/Linings/S11	No Asbestos Detected
----------------------------	--	-----------------------------

B00F - R0002 - Canteen

No Asbestos

B00F - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 7422/B00F/R0001/Ceiling Structures/Linings/S11	No Asbestos Detected
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Support Unit/General Learning - 1929 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/Eaves Linings/S34				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Window putty.	Putty					
	7422/B00D/Window putty/S31					No Asbestos Detected

Interior**B00G - R0001 - Laundry - S**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00G - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00G - R0003 - Toilet - S

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Compressed AC Sheet	8.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Fibro under tiles.

B00G - R0004 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00G - R0005 - Student Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00G - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00G - R0007 - Home Base - S

Ceiling Structures/Linings	Flat AC Sheeting	47.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00G - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	7422/B00G/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected

B00G - R0009 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	7422/B00G/R0010/Floor Coverings Res/Textile/S33				No Asbestos Detected	
B00G - R0010 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
	7422/B00G/R0010/Floor Coverings Res/Textile/S33				No Asbestos Detected	
B00G - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00G - R0012 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5				No Asbestos Detected	
B00G - R0013 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7422/B00G/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	7422/B00D/R0028/Floor Coverings Res/Textile/S5				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Compressed AC Sheet					
	7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected

Interior

B00J - R0001 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet					
	7422/B00E/R0001/Floor Coverings Res/Textile/S14					No Asbestos Detected

B00J - R0002 - Practical Activities - 1hb

No Asbestos

B00J - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00J - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00J - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00J - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00J - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00J - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior**B00K - R0001 - External Movement**

No Asbestos

B00K - R0002 - Home Base

No Asbestos

B00K - R0003 - Withdrawal Space - 1hb

No Asbestos

B00K - R0004 - Home Base Store

No Asbestos

B00K - R0005 - Practical Activities - 2hb

No Asbestos

B00K - R0006 - Access Shower/Toilet

No Asbestos

B00K - R0007 - General Storeroom

No Asbestos

B00K - R0008 - Laundry - P

No Asbestos

B00K - R0009 - Access Shower/Toilet

No Asbestos

B00K - R0010 - Home Base

No Asbestos

B00K - R0011 - Withdrawal Space - 1hb

No Asbestos

B00K - R0012 - Home Base Store

No Asbestos

B00K - R0013 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00L - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior**B00L - R0001 - Covered Outdoor Learning Area**

No Asbestos

B00L - R0002 - Communal Space

No Asbestos

B00L - R0003 - Movement

No Asbestos

B00L - R0004 - Raised Platform

No Asbestos

B00L - R0005 - Ramp

No Asbestos

B00L - R0006 - Movement

No Asbestos

B00L - R0007 - Hall Chair Store

No Asbestos

B00L - R0008 - Communal/Performance Store

No Asbestos

B00L - R0009 - P.E. Store

No Asbestos

B00L - R0010 - Toilet - Lobby

No Asbestos

B00L - R0011 - Toilets - Girls

No Asbestos

B00L - R0012 - Sound Cupboard

No Asbestos

B00L - R0013 - Toilet - Lobby

No Asbestos

B00L - R0014 - Toilets - Boys

No Asbestos

B00L - R0015 - Cleaning Distributed Store

No Asbestos

B00L - R0016 - General Storeroom

No Asbestos

B00L - R0017 - Main Switch Board

No Asbestos

B00L - R0018 - Access Shower/Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017