


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kiama High School (8171)  
**Region :** Illawarra and South East  
**State Electorate :** Kiama  
**Local Government Area :** Kiama

**Initial Survey :** Noel Arnold & Associates : 04 - May - 2008  
**Reviewed By :** AECOM : 18 - Jun - 2015

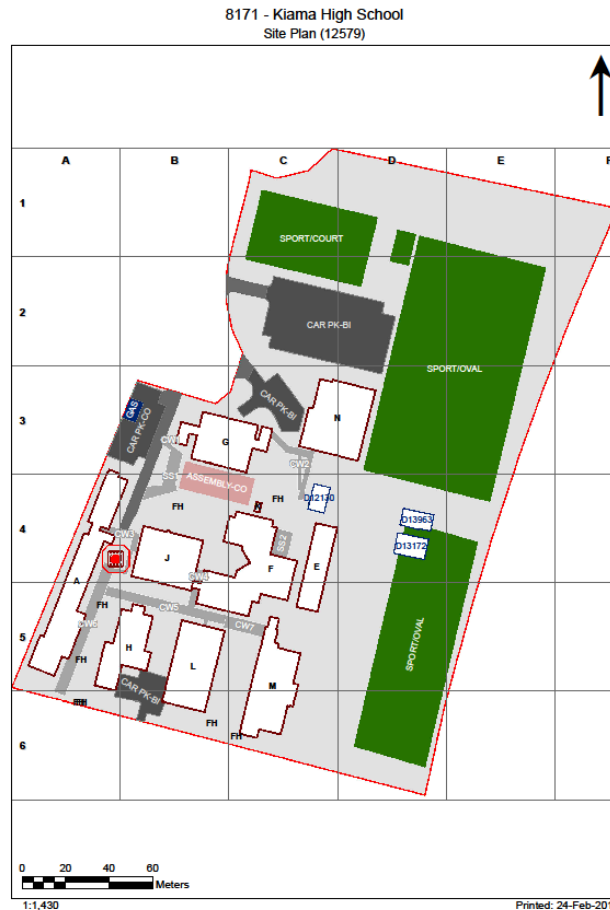

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1967 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00A/Eaves Linings/S15					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0002 - Main Switchroom (8.21 m2)**

No Asbestos

**B00A - R0008 - Distribution Board Cupboard (1.21 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0009 - Cleaning Store - Distributed (6.1 m2)**

No Asbestos

**B00A - R0010 - Toilets-Boys (25.62 m2)**

Ceiling Structures/Linings	Vermiculite	8171/B00A/R1022/Ceiling Structures/Linings/S1	<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

Partition Walls (Cubicles)	Compressed AC Sheet	8171/B00A/R1012/Partition Walls (Cubicles)/S2	<b>No Asbestos Detected</b>
----------------------------	---------------------	---	-----------------------------

**B00A - R0011 - Staff - Toilet (5.6 m2)**

Ceiling Structures/Linings	Vermiculite	8171/B00A/R1022/Ceiling Structures/Linings/S1	<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0012 - Laboratory L.S. (86.02 m2)**

Ceiling Structures/Linings	Vermiculite	8171/B00A/R1022/Ceiling Structures/Linings/S1	<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0013 - Preparation (28.62 m2)**

Ceiling Structures/Linings	Vermiculite	8171/B00A/R1022/Ceiling Structures/Linings/S1	<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0014 - Staff Study (9.59 m2)**

Ceiling Structures/Linings	Vermiculite	8171/B00A/R1022/Ceiling Structures/Linings/S1	<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00A - R0017 - Distribution Board Cupboard (1.29 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0028 - Clinic-Toilets (3.14 m2)**

No Asbestos

**B00A - R0029 - General Storeroom (7.69 m2)**

No Asbestos

**B00A - R0033 - Administration - Clerical (18.72 m2)**

No Asbestos

**B00A - R0034 - Principal Office (23.78 m2)**

No Asbestos

**B00A - R0035 - Movement (7.42 m2)**

No Asbestos

**B00A - R0036 - Interview/Office - Type 1 (17.14 m2)**

No Asbestos

**B00A - R0037 - Interview/Office - Type 1 (17.05 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00A - R0038 - Administration - Clerical (26.29 m2)</b>						
No Asbestos						
<b>B00A - R0039 - Clinic - Girls (13.88 m2)</b>						
No Asbestos						
<b>B00A - R0040 - Clinic-Toilets (3.38 m2)</b>						
No Asbestos						
<b>B00A - R0041 - Clinic - Boys (13.02 m2)</b>						
No Asbestos						
<b>B00A - R0042 - Administration - Clerical (61.85 m2)</b>						
No Asbestos						
<b>B00A - R0043 - Movement (117.05 m2)</b>						
No Asbestos						
<b>B00A - R0044 - External Movement (15.01 m2)</b>						
No Asbestos						
<b>B00A - R0045 - Movement (21.61 m2)</b>						
No Asbestos						
<b>B00A - R0046 - Stairs (2.16 m2)</b>						
No Asbestos						
<b>B00A - R0047 - Administration - Clerical (5.1 m2)</b>						
No Asbestos						
<b>B00A - R0048 - Staff - Toilet (4.67 m2)</b>						
No Asbestos						
<b>B00A - R0049 - Disabled Toilet (5.29 m2)</b>						
No Asbestos						
<b>B00A - R0050 - Staff - Toilet (4.7 m2)</b>						
No Asbestos						
<b>B00A - R0051 - Security Store (11.74 m2)</b>						
No Asbestos						
<b>B00A - R0052 - Movement (51.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00A/R0052/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0053 - Deputy Principal Office (14.74 m2)</b>						
No Asbestos						
<b>B00A - R0054 - Deputy Principal Office (14.91 m2)</b>						
No Asbestos						
<b>B00A - R0055 - Interview/Office - Type 1 (14.85 m2)</b>						
No Asbestos						
<b>B00A - R0056 - Duplicating Workroom (18.9 m2)</b>						
No Asbestos						
<b>B00A - R0057 - External Movement (83.1 m2)</b>						
No Asbestos						
<b>B00A - R0058 - Movement (58.75 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0059 - Apparatus Storage (19.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0060 - Laboratory L.S. (86.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0061 - General Learning Space (44.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1001 - Music Learning Space (52.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1002 - Music Store (6.46 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Music Store (6.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1004 - Music Store (6.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1005 - Music Learning Space (52.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1006 - Music Store (6.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1007 - Music Store (6.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1008 - Staff Study (24.57 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Movement (108.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8171/B00A/R1022/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1010 - Distribution Board Cupboard (1.21 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1011 - General Storeroom (6.04 m2)</b>						
No Asbestos						
<b>B00A - R1012 - Toilets-Girls (25.54 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00A/R1024/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet					
8171/B00A/R1012/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>	
<b>B00A - R1013 - Staff - Toilet (4.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00A/R1024/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1014 - Staff Study (52.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1015 - Staff Study (21.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1016 - General Storeroom (3.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1017 - General Learning Space (52.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1018 - General Learning Space (52.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1019 - General Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1020 - Distribution Board Cupboard (0.77 m2)</b>						
No Asbestos				Note: No inspection of live electrical installation.		
<b>B00A - R1021 - Computer Learning Space (51.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1022 - General Learning Space (52.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8171/B00A/R1022/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1023 - General Storeroom (6.46 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00A/R1024/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1024 - Movement (57.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00A/R1024/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Art - 1954 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00E - R0001 - Staff Study (29.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - General Learning Space (58.04 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0003 - Movement (9.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - Art Learning Space (53.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0005 - General Storeroom (19.72 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0006 - General Learning Space (54.24 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0007 - General Learning Space (54.24 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0008 - Staff Study (22.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00E - R0009 - Movement (76.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00E/R0009/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Technological & Applied Studies - 1980 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior**

**B00F - M0009 - Movement (60.83 m2)**

No Asbestos

**B00F - M0010 - Darkroom Space (22.54 m2)**

No Asbestos

**B00F - M0011 - Design L.S. (51.6 m2)**

No Asbestos

**B00F - M0012 - Computer Learning Space (46.1 m2)**

No Asbestos

**B00F - M0019 - Toilets-Boys (21.63 m2)**

No Asbestos

**B00F - M0020 - Toilets-Girls (21.55 m2)**

No Asbestos

**B00F - M0021 - Toilets-Disabled (2.31 m2)**

No Asbestos

**B00F - M0022 - Cleaning Store - Distributed (1.03 m2)**

No Asbestos

**B00F - M0023 - Staff - Toilet (9.05 m2)**

No Asbestos

**B00F - M0024 - Staff - Toilet (7.5 m2)**

No Asbestos

**B00F - M0025 - External Movement (105.53 m2)**

Ceiling Structures/Linings Flat AC Sheeting 106m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8171/B00F/M0025/Ceiling Structures/Linings/S11

Chrysotile (white asbestos)

**B00F - M0026 - Maintenance Bulk Store (5.85 m2)**

No Asbestos

**B00F - M1008 - Cleaning Store - Distributed (2.99 m2)**

No Asbestos

**B00F - M1009 - Distribution Board Cupboard (1.02 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - M1010 - General Learning Space (46.99 m2)**

No Asbestos

**B00F - M1011 - General Learning Space (47.89 m2)**

No Asbestos

**B00F - M1012 - General Learning Space (45.96 m2)**

No Asbestos

**B00F - M1013 - General Learning Space (47.61 m2)**

No Asbestos

**B00F - M1014 - General Storeroom (22.7 m2)**

No Asbestos

**B00F - M1015 - General Storeroom (4.33 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
<b>B00F - M1016 - Staff Study (27.45 m2)</b>						
No Asbestos						
<b>B00F - M1017 - Movement (95.77 m2)</b>						
No Asbestos						
<b>B00F - R0001 - Materials Store (31.25 m2)</b>						
No Asbestos						
<b>B00F - R0002 - Materials Technology L.S. (81.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6						<b>No Asbestos Detected</b>
<b>B00F - R0003 - Materials Technology L.S. (123.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6						<b>No Asbestos Detected</b>
<b>B00F - R0004 - Welding Area (6.72 m2)</b>						
No Asbestos						
<b>B00F - R0005 - Staff Study (17.11 m2)</b>						
No Asbestos						
<b>B00F - R0006 - General Storeroom (0.91 m2)</b>						
No Asbestos						
<b>B00F - R0007 - Distribution Board Cupboard (0.9 m2)</b>						
						Note: No inspection of live electrical installation.
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00F/R1007/Ceiling Structures/Linings/S10						<b>Chrysotile (white asbestos)</b>
<b>B00F - R0008 - Cleaning Store - Distributed (6.34 m2)</b>						
No Asbestos						
<b>B00F - R0009 - Movement (23.78 m2)</b>						
No Asbestos						
<b>B00F - R0013 - Staff Study (23.51 m2)</b>						
No Asbestos						
<b>B00F - R0014 - Materials Technology L.S. (107.05 m2)</b>						
No Asbestos						
<b>B00F - R0015 - Wood Technology Bay (18.45 m2)</b>						
No Asbestos						
<b>B00F - R0016 - Materials Technology L.S. (108.06 m2)</b>						
No Asbestos						
<b>B00F - R0017 - Movement (139.46 m2)</b>						
No Asbestos						
<b>B00F - R0018 - Movement (61.54 m2)</b>						
No Asbestos						
<b>B00F - R1001 - Food Technology L.S. (102.78 m2)</b>						
No Asbestos						
<b>B00F - R1002 - Staff Study (30.95 m2)</b>						
No Asbestos						
<b>B00F - R1003 - Design L.S. (69.82 m2)</b>						
No Asbestos						
<b>B00F - R1004 - Design L.S. (69.67 m2)</b>						
No Asbestos						
<b>B00F - R1005 - Materials Store (11.98 m2)</b>						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R1006 - Cleaning Store - Distributed (7.88 m2)</b>						
No Asbestos						
<b>B00F - R1007 - Distribution Board Cupboard (0.84 m2)</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00F/R1007/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8171/B00F/R1007/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1018 - Laundry (10.09 m2)</b>						
No Asbestos						
<b>B00F - R1019 - Food/Research Space (17.9 m2)</b>						
No Asbestos						
<b>B00F - R1020 - Food Technology L.S. (102.31 m2)</b>						
No Asbestos						
<b>B00F - R1021 - Materials Store (22.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00F - R1022 - Movement (100.84 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities/Physical Education - 1971 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior****B00G - R0001 - Toilets-Girls (21.25 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8171/B00G/R0009/Partition Walls (Cubicles)/S4

**Chrysotile (white asbestos)**

**B00G - R0002 - Movement (79.89 m2)**

Ceiling Structures/Linings Vermiculite  
8171/B00G/R0002/Ceiling Structures/Linings/S14

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00G - R0003 - Gymnasium (309.03 m2)**

No Asbestos

**B00G - R0004 - Sport Equipment Store (21.35 m2)**

No Asbestos

**B00G - R0005 - General Storeroom (8.2 m2)**

No Asbestos

**B00G - R0006 - Student Canteen (45.72 m2)**

Floor Coverings Res/Textile Vinyl Tiles

8171/B00G/R0006/Floor Coverings Res/Textile/S5

**No Asbestos Detected**

**B00G - R0007 - Distribution Board Cupboard (0.88 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0008 - Cleaning Store - Distributed (1.02 m2)**

No Asbestos

**B00G - R0009 - Toilets-Boys (20.19 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8171/B00G/R0009/Partition Walls (Cubicles)/S4

**Chrysotile (white asbestos)**

**B00G - R0010 - Sport Equipment Store (20.36 m2)**

No Asbestos

**B00G - R0011 - Staff - Toilet (3.15 m2)**

No Asbestos

**B00G - R0012 - Maintenance Bulk Store (5.14 m2)**

No Asbestos

**B00G - R0013 - Movement (50.53 m2)**

No Asbestos

**B00G - R0014 - Stairs (6.36 m2)**

No Asbestos

**B00G - R0015 - Movement (46.03 m2)**

No Asbestos

**B00G - R0016 - Stairs (6.35 m2)**

No Asbestos

**B00G - R1001 - General Storeroom (9.11 m2)**

No Asbestos

**B00G - R1003 - Movement (16.58 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R1004 - Gymnasium (33.6 m2)</b>						
No Asbestos						
<b>B00G - R1005 - Movement (16.67 m2)</b>						
No Asbestos						
<b>B00G - R1007 - Staff Change (9.01 m2)</b>						
No Asbestos						
<b>B00G - R1008 - Sport Equipment Store (7.85 m2)</b>						
No Asbestos						
<b>B00G - R1009 - Shower/Change (61.81 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00G/R0009/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
<b>B00G - R1010 - Shower/Change (61.92 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00G/R0009/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
<b>B00G - R1011 - Staff Change (7.73 m2)</b>						
No Asbestos						
<b>B00G - R1012 - Plant (3.51 m2)</b>						
No Asbestos						
<b>B00G - R1013 - Plant (3.51 m2)</b>						
No Asbestos						
<b>B00G - R1014 - Stairs (6.35 m2)</b>						
No Asbestos						
<b>B00G - R1015 - Movement (46.03 m2)</b>						
No Asbestos						
<b>B00G - R1016 - Stairs (21.77 m2)</b>						
No Asbestos						
<b>B00G - R1017 - Movement (34.26 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Multi Purpose Facilities/Performing Arts - 1960 - Concrete Framed (Concrete Framed)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00H/R0009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	
Upper Eaves	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Replaced. Assumed no asbestos.</b>					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - due storage					

**Interior**

<b>B00H - M0001 - General Storeroom (11.28 m2)</b>						
No Asbestos						
<b>B00H - M0002 - Control Room (11.71 m2)</b>						
No Asbestos						
<b>B00H - R0001 - Multi-Purpose Space (264.24 m2)</b>						
No Asbestos						
<b>B00H - R0002 - Cleaning Store - Distributed (6 m2)</b>						
No Asbestos						
<b>B00H - R0003 - Toilets-Girls (6.97 m2)</b>						
No Asbestos						
<b>B00H - R0004 - Student Canteen (4.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00H/R0004/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0005 - Toilets-Boys (5.09 m2)</b>						
No Asbestos						
<b>B00H - R0006 - Movement (14.39 m2)</b>						
No Asbestos						
<b>B00H - R0007 - Stage (53.8 m2)</b>						
No Asbestos						
<b>B00H - R0008 - Movement (30.96 m2)</b>						
No Asbestos						
<b>B00H - R0009 - External Movement (9.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8171/B00H/R0009/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0010 - Performance Workspace (60.32 m2)</b>						
No Asbestos						
<b>B00H - R0011 - Toilets-Girls (6.12 m2)</b>						
No Asbestos						
<b>B00H - R0012 - General Storeroom (7.33 m2)</b>						
No Asbestos						
<b>B00H - R0013 - Toilets-Boys (5.02 m2)</b>						
No Asbestos						
<b>B00H - R0014 - Performing Arts Changeroom (23.68 m2)</b>						
No Asbestos						
<b>B00H - R0015 - General Storeroom (10.37 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
<b>B00H - R0016 - General Storeroom (9.82 m2)</b>						
No Asbestos						
<b>B00H - R0017 - Plant (16.51 m2)</b>						
No Asbestos						
<b>B00H - R0018 - External Movement (4.66 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8171/B00H/R0009/Ceiling Structures/Linings/S9						<b>Chrysotile (white asbestos)</b>
<b>B00H - R9001 - Garden Store Room (19.52 m2)</b>						
No Asbestos						
<b>B00H - R9002 - Garden Store Room (19.95 m2)</b>						
No Asbestos						
<b>B00H - R9003 - General Assistants (51.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8171/B00H/R9003/Ceiling Structures/Linings/S8						<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Library/Science Learning - 1980 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00J - R0001 - Staff Study (23.29 m2)**

Floor Coverings Res/Textile Vinyl Tiles  
8171/B00F/R0002/Floor Coverings Res/Textile/S6 **No Asbestos Detected**

**B00J - R0002 - Chemical Store (9.66 m2)**

No Asbestos

**B00J - R0003 - Movement (76.34 m2)**

No Asbestos

**B00J - R0004 - Apparatus Store (25.24 m2)**

No Asbestos

**B00J - R0005 - External Movement (4.6 m2)**

No Asbestos

**B00J - R0006 - Laboratory L.S. (80.64 m2)**

No Asbestos

**B00J - R0007 - Preparation (48.46 m2)**

No Asbestos

**B00J - R0008 - Laboratory L.S. (79.02 m2)**

No Asbestos

**B00J - R0009 - External Movement (2.93 m2)**

No Asbestos

**B00J - R0010 - Distribution Board Cupboard (0.63 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0011 - Laboratory L.S. (80.64 m2)**

No Asbestos

**B00J - R0012 - Preparation (47.92 m2)**

No Asbestos

**B00J - R0013 - Laboratory L.S. (80.82 m2)**

No Asbestos

**B00J - R0014 - External Movement (2.38 m2)**

No Asbestos

**B00J - R1001 - Main Area (412.91 m2)**

No Asbestos

**B00J - R1002 - Workroom (45.77 m2)**

Floor Coverings Res/Textile Vinyl Tiles  
8171/B00F/R0002/Floor Coverings Res/Textile/S6 **No Asbestos Detected**

**B00J - R1003 - Librarian (11.79 m2)**

No Asbestos

**B00J - R1004 - Audio Visual Workroom (42.28 m2)**

No Asbestos

**B00J - R1005 - Cleaning Store - Distributed (2.39 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00J - R1006 - Clinic - Boys (9.89 m2)</b>						
No Asbestos						
<b>B00J - R1007 - Clinic - Girls (13.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00J - R1008 - Deputy Principal Office (12.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8171/B00F/R0002/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00J - R1009 - Administration - Clerical (11.62 m2)</b>						
No Asbestos						
<b>B00J - R1010 - Movement (25.52 m2)</b>						
No Asbestos						
<b>B00J - R1011 - Distribution Board Cupboard (0.69 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00J - R1012 - Plant (1.25 m2)</b>						
No Asbestos						
<b>B00J - R1013 - Pupil Entry (2.95 m2)</b>						
No Asbestos						
<b>B00J - R1014 - Seminar (10.39 m2)</b>						
No Asbestos						
<b>B00J - R1015 - Seminar (10.26 m2)</b>						
No Asbestos						
<b>B00J - R1016 - Seminar (10.59 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Mechanical Services - 1954 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00K - R0001 - Dust Extraction Space (8.62 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00L - General Learning/Computer Learning - 2004 - Brick/Veneer (Brick/Veneer)

#### Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

#### Interior

##### B00L - R0001 - Computer Learning Space (65.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0002 - Computer Learning Space (64.62 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0003 - Cleaning Store - Distributed (2.25 m2)

No Asbestos

##### B00L - R0004 - General Storeroom (21.83 m2)

No Asbestos

##### B00L - R0005 - Distribution Board Cupboard (0.75 m2)

Note: No inspection of live electrical installation.

No Asbestos

##### B00L - R0006 - General Learning Space (59.58 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0007 - General Learning Space (57.94 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0008 - Seminar (25.53 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0009 - General Learning Space (58.72 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0010 - General Learning Space (57.94 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0011 - Distribution Board Cupboard (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

##### B00L - R0012 - External Movement (4.34 m2)

No Asbestos

##### B00L - R0013 - Movement (15.31 m2)

No Asbestos

##### B00L - R0014 - Stairs (3 m2)

No Asbestos

##### B00L - R0015 - Movement (159.77 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R0016 - Covered Area (62.55 m2)

No Asbestos

##### B00L - R0017 - External Movement (40.43 m2)

No Asbestos

##### B00L - R1001 - Computer Learning Space (64.78 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

##### B00L - R1002 - Computer Learning Space (64.69 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1003 - Cleaning Store - Distributed (2.25 m2)</b>						
No Asbestos						
<b>B00L - R1004 - General Storeroom (21.85 m2)</b>						
No Asbestos						
<b>B00L - R1005 - Distribution Board Cupboard (0.75 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00L - R1006 - General Learning Space (59.03 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1007 - General Learning Space (59.03 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1008 - Seminar (24.01 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1009 - General Learning Space (58.94 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1010 - General Learning Space (59.66 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00L - R1011 - Distribution Board Cupboard (0.68 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00L - R1012 - Movement (4.1 m2)</b>						
No Asbestos						
<b>B00L - R1013 - Movement (7.5 m2)</b>						
No Asbestos						
<b>B00L - R1014 - Stairs (14.22 m2)</b>						
No Asbestos						
<b>B00L - R1015 - Movement (160.81 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00M - General Learning/Staff Facilities - 2007 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00M - R0001 - Music Learning Space (59.51 m2)**

No Asbestos

**B00M - R0002 - Music Learning Space (60.29 m2)**

No Asbestos

**B00M - R0003 - General Learning Space (60.01 m2)**

No Asbestos

**B00M - R0004 - General Learning Space (59.98 m2)**

No Asbestos

**B00M - R0005 - Change (21.66 m2)**

No Asbestos

**B00M - R0006 - Change (22.51 m2)**

No Asbestos

**B00M - R0007 - Cleaning Store - Distributed (3.24 m2)**

No Asbestos

**B00M - R0008 - Seminar (20.36 m2)**

No Asbestos

**B00M - R0009 - Fitness Laboratory (96.61 m2)**

No Asbestos

**B00M - R0010 - Fitness Store (19.88 m2)**

No Asbestos

**B00M - R0011 - Music Store (19.46 m2)**

No Asbestos

**B00M - R0012 - Performance Workshop (52.77 m2)**

No Asbestos

**B00M - R0013 - Practice/Seminar (19.02 m2)**

No Asbestos

**B00M - R0015 - External Movement (130.36 m2)**

No Asbestos

**B00M - R0016 - Movement (3.29 m2)**

No Asbestos

**B00M - R0017 - External Movement (20.21 m2)**

No Asbestos

**B00M - R0018 - External Movement (19.38 m2)**

No Asbestos

**B00M - R0019 - External Stairs (1.14 m2)**

No Asbestos

**B00M - R0020 - External Stairs (0.81 m2)**

No Asbestos

**B00M - R0021 - External Movement (12.94 m2)**

No Asbestos

**B00M - R0022 - Lift (2.1 m2)**

No Asbestos

**B00M - R0023 - Handwashing Facilities (4.32 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00M - R0024 - External Movement (25.11 m2)</b>					
	No Asbestos					
	<b>B00M - R0025 - Performance Workshop (52.85 m2)</b>					
	No Asbestos					
	<b>B00M - R0026 - Distribution Board Cupboard (0.81 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00M - R1001 - Art Learning Space (59.21 m2)</b>					
	No Asbestos					
	<b>B00M - R1002 - Art Learning Space (59.21 m2)</b>					
	No Asbestos					
	<b>B00M - R1003 - Interview/Office - Type 1 (12.51 m2)</b>					
	No Asbestos					
	<b>B00M - R1004 - Interview/Office - Type 1 (12.75 m2)</b>					
	No Asbestos					
	<b>B00M - R1005 - Art Learning Space (59.12 m2)</b>					
	No Asbestos					
	<b>B00M - R1006 - Art Learning Space (58.36 m2)</b>					
	No Asbestos					
	<b>B00M - R1007 - Visual Arts Workshop (99.69 m2)</b>					
	No Asbestos					
	<b>B00M - R1008 - Visual Arts Store (24.7 m2)</b>					
	No Asbestos					
	<b>B00M - R1009 - Visual Arts Store (24.68 m2)</b>					
	No Asbestos					
	<b>B00M - R1010 - Visual Arts Store (19.59 m2)</b>					
	No Asbestos					
	<b>B00M - R1011 - Visual Arts Store (19.58 m2)</b>					
	No Asbestos					
	<b>B00M - R1012 - Kiln Space (4 m2)</b>					
	No Asbestos					
	<b>B00M - R1013 - Pottery Store (19.96 m2)</b>					
	No Asbestos					
	<b>B00M - R1014 - Visual Arts Workshop (99.33 m2)</b>					
	No Asbestos					
	<b>B00M - R1015 - Distribution Board Cupboard (0.82 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00M - R1016 - Movement (3.15 m2)</b>					
	No Asbestos					
	<b>B00M - R1017 - External Movement (130.36 m2)</b>					
	No Asbestos					
	<b>B00M - R1018 - External Movement (15.63 m2)</b>					
	No Asbestos					
	<b>B00M - R1019 - External Movement (17.37 m2)</b>					
	No Asbestos					
	<b>B00M - R1020 - External Stairs (0.57 m2)</b>					
	No Asbestos					
	<b>B00M - R1021 - External Movement (20.21 m2)</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00M - R1022 - External Stairs (0.81 m2)</b>					
	No Asbestos					
	<b>B00M - R1023 - Lift (2.1 m2)</b>					
	No Asbestos					
	<b>B00M - R2001 - Preparation/Printing (33.11 m2)</b>					
	No Asbestos					
	<b>B00M - R2002 - Staff - Toilet (4.26 m2)</b>					
	No Asbestos					
	<b>B00M - R2003 - Staff - Toilet (4.34 m2)</b>					
	No Asbestos					
	<b>B00M - R2004 - Cleaning Store - Distributed (3.61 m2)</b>					
	No Asbestos					
	<b>B00M - R2005 - Staff - Toilet (3.61 m2)</b>					
	No Asbestos					
	<b>B00M - R2006 - Staff - Toilet (3.61 m2)</b>					
	No Asbestos					
	<b>B00M - R2007 - Toilets-Disabled (6.27 m2)</b>					
	No Asbestos					
	<b>B00M - R2008 - Interview/Office - Type 1 (12.42 m2)</b>					
	No Asbestos					
	<b>B00M - R2009 - Interview/Office - Type 1 (12.42 m2)</b>					
	No Asbestos					
	<b>B00M - R2010 - Movement (68 m2)</b>					
	No Asbestos					
	<b>B00M - R2011 - Staff Study (196.03 m2)</b>					
	No Asbestos					
	<b>B00M - R2012 - Staff Lounge (91.13 m2)</b>					
	No Asbestos					
	<b>B00M - R2013 - Staff Study (196.44 m2)</b>					
	No Asbestos					
	<b>B00M - R2014 - Distribution Board Cupboard (0.72 m2)</b>					Note: No inspection of live electrical installation.
	No Asbestos					
	<b>B00M - R2015 - Movement (3.59 m2)</b>					
	No Asbestos					
	<b>B00M - R2016 - External Movement (51.69 m2)</b>					
	No Asbestos					
	<b>B00M - R2017 - Movement (10.8 m2)</b>					
	No Asbestos					
	<b>B00M - R2018 - External Movement (14.29 m2)</b>					
	No Asbestos					
	<b>B00M - R2019 - External Stairs (18.78 m2)</b>					
	No Asbestos					
	<b>B00M - R2020 - External Stairs (20.23 m2)</b>					
	No Asbestos					
	<b>B00M - R2021 - Lift (2.1 m2)</b>					
	No Asbestos					
	<b>B00M - R2022 - Staff Kitchen (7.3 m2)</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00M - R2023 - Staff Kitchen (7.28 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00N - Physical Education - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00N - R0001 - External Movement (68.52 m2)**

No Asbestos

**B00N - R0002 - Gymnasium (632.18 m2)**

No Asbestos

**B00N - R0003 - Chair Store (33.75 m2)**

No Asbestos

**B00N - R0004 - Large Equipment Store (24.19 m2)**

No Asbestos

**B00N - R0005 - No Access (0.84 m2)**

No Asbestos

**B00N - R0006 - Change (29.08 m2)**

No Asbestos

**B00N - R0007 - Change (29.14 m2)**

No Asbestos

**B00N - R0008 - Cleaning Store - Distributed (3.26 m2)**

No Asbestos

**B00N - R0009 - First Aid (12.45 m2)**

No Asbestos

**B00N - R0010 - Utility Space (0.4 m2)**

No Asbestos

**B00N - R0011 - Access Student Shower/Toilet/Change (9.45 m2)**

No Asbestos

**B00N - R0012 - Utility Space (0.74 m2)**

No Asbestos

**B00N - R9001 - Tiered Learning Area (184.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 600 - D11327 - Learning Unit - Small : Placement Date - 7/08/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**OS 720 - D12130 - Science Laboratory/Prep Room : Placement Date - 10/02/1998**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	17.28 m2

**Interior**

**R1 - Laboratory L.S.**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	90 m2

**R2 - Preparation**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	19 m2

**NS 111 - D13172 - Learning Unit - Double Secondary/Secure : Placement Date - 3/01/2006**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**R2 - General Learning Space**

No Asbestos Found.

**R3 - Entry**

No Asbestos Found.

**R4 - Secure Storeroom**

No Asbestos Found.

**R5 - Secure Storeroom**

No Asbestos Found.

**R6 - Entry**

No Asbestos Found.

**OS 600 - D13208 - Learning Unit - Small : Placement Date - 7/08/2009**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**OS 840 - D13481 - Girls Toilet : Placement Date - 13/02/1998**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
-------------	---------------------	------------------	---------



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
<b>Interior</b>						
<b>R1 - Toilets-Girls</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2
<b>OS 760 - D13963 - Woodwork/Store : Placement Date - 18/02/2002</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				17.28 m2
<b>Interior</b>						
<b>R1 - Woodwork</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				91 m2
<b>R2 - Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

8171\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017