


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kurri Kurri High School (8177)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Cessnock

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Reviewed By : Greencap-NAA : 04 - Dec - 2014

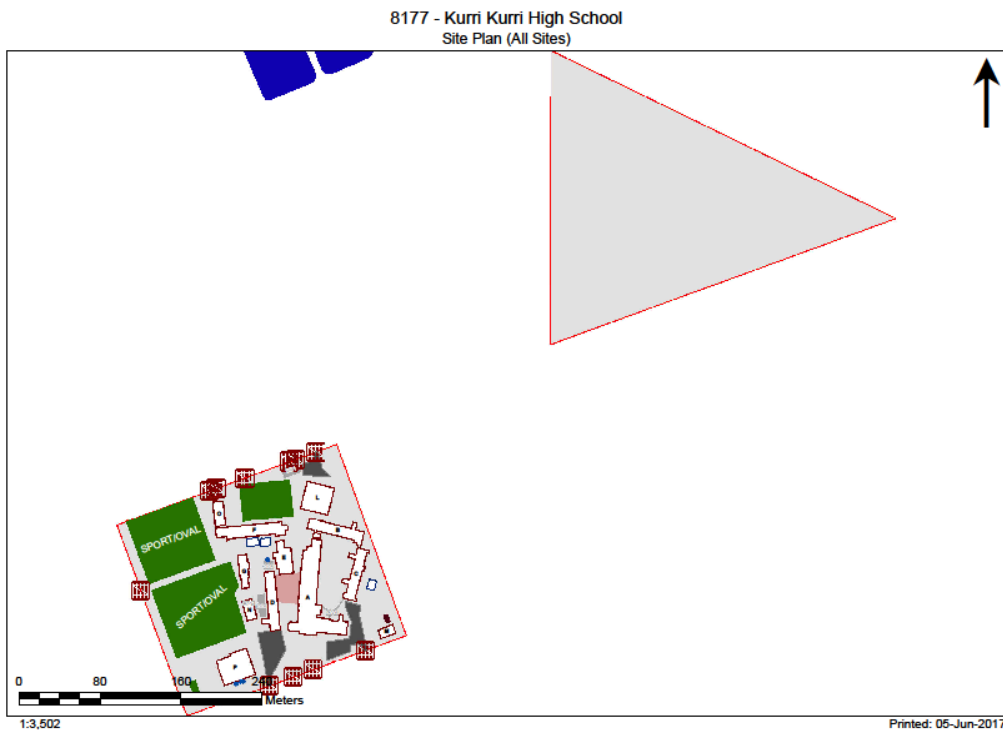

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Multi Purpose Facilities - 1951 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Staff Study (17.62 m2)

No Asbestos

B00A - R0002 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0003 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0004 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0005 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0006 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0007 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0008 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0009 - General Learning Space (49.04 m2)

No Asbestos

B00A - R0010 - General Storeroom (3.99 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0016/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	

B00A - R0011 - Clinic - Boys (14.73 m2)

No Asbestos

B00A - R0012 - Clinic-Toilets (1.82 m2)

No Asbestos

B00A - R0013 - Clinic-Toilets (1.84 m2)

No Asbestos

B00A - R0014 - Clinic - Girls (14.57 m2)

No Asbestos

B00A - R0015 - General Storeroom (3.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0016/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	

B00A - R0016 - General Storeroom (5.5 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0016/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	

B00A - R0017 - Staff Study (12.9 m2)

No Asbestos

B00A - R0018 - Cleaning Store - Distributed (0.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0019 - Staff - Toilet (4.34 m2)						
No Asbestos						
B00A - R0020 - Staff Study (13.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0021 - General Storeroom (5.27 m2)						
No Asbestos						
B00A - R0022 - Cleaning Store - Distributed (0.76 m2)						
No Asbestos						
B00A - R0023 - Toilets-Disabled (4.32 m2)						
No Asbestos						
B00A - R0024 - Movement (248.03 m2)						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0025 - Staff Study (20.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0026 - Distribution Board Cupboard (0.56 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Floor Coverings Res/Textile	Vinyl Tiles 8177/B00A/R0016/Floor Coverings Res/Textile/S8	0.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0027 - Distribution Board Cupboard (1.37 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Floor Coverings Res/Textile	Flat AC Sheeting 8177/B00A/R0027/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00A - R0028 - Chair Store (40.25 m2)						
No Asbestos						
B00A - R0029 - Movement (4.71 m2)						
No Asbestos						
B00A - R0030 - Control Room (10.95 m2)						
No Asbestos						
B00A - R0031 - Movement (10.62 m2)						
No Asbestos						
B00A - R0032 - Multi-Purpose Space (277.84 m2)						
No Asbestos						
B00A - R0033 - Movement (8.61 m2)						
No Asbestos						
B00A - R0034 - Movement (0.41 m2)						
No Asbestos						
B00A - R0035 - Movement (0.98 m2)						
No Asbestos						
B00A - R0036 - Stage (70.48 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0037 - Movement (0.98 m2)						
No Asbestos						
B00A - R0038 - Movement (27.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0039 - Movement (74.3 m2)						
Wall Linings Internal	Vermiculite 8177/B00A/R0045/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0040 - Staff - Toilet (6.09 m2)						
No Asbestos						
B00A - R0041 - Deputy Principal Office (12.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0042 - Interview/Office - Type 1 (12.74 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0043 - General Storeroom (2.17 m2)						
No Asbestos						
B00A - R0044 - Staff - Toilet (3.28 m2)						
Ceiling Structures/Linings	Vermiculite 8177/B00A/R0045/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0045 - Principal Office (18.61 m2)						
Ceiling Structures/Linings	Vermiculite 8177/B00A/R0045/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0046 - Security Store (13.4 m2)						
Ceiling Structures/Linings	Vermiculite 8177/B00A/R0045/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0047 - Administration - Clerical (12.8 m2)						
Ceiling Structures/Linings	Vermiculite 8177/B00A/R0045/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0048 - Administration - Clerical (48.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00A/R0016/Floor Coverings Res/Textile/S8	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0049 - Duplicating Workroom (25.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0016/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R0050 - Movement (0.49 m2)						
No Asbestos						
B00A - R0051 - Control Room (0.49 m2)						
No Asbestos						
B00A - R0052 - Stage (13.54 m2)						
No Asbestos						
B00A - R0053 - Movement (10.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R0054 - Movement (2.33 m2)						
No Asbestos						
B00A - R0055 - Movement (10.13 m2)						
No Asbestos						
B00A - R0056 - Movement (10.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R0057 - Movement (3.92 m2)						
No Asbestos						
B00A - R0058 - Movement (3.95 m2)						
No Asbestos						
B00A - R0059 - Covered Area (15.06 m2)						
No Asbestos						
B00A - R0060 - Movement (36.95 m2)						
No Asbestos						
B00A - R0061 - Covered Area (322.43 m2)						
No Asbestos						
B00A - R0062 - Disabled Toilet (12.07 m2)						
No Asbestos						
B00A - R0063 - Stairs (6.51 m2)						
No Asbestos						
B00A - R0064 - Stairs (15.46 m2)						
No Asbestos						
B00A - R0065 - Stairs (13.01 m2)						
No Asbestos						
B00A - R0066 - Stairs (6.25 m2)						
No Asbestos						
B00A - R1001 - Movement (10.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R1002 - Apparatus Store (18.35 m2)						
No Asbestos						
B00A - R1003 - General Learning Space (50.16 m2)						
No Asbestos						
B00A - R1004 - General Learning Space (49.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R1005 - General Learning Space (49.27 m2)						
No Asbestos						
B00A - R1006 - General Learning Space (49.27 m2)						
No Asbestos						
B00A - R1007 - Laboratory L.S. (83.71 m2)						
No Asbestos						
B00A - R1008 - Preparation (16.54 m2)						
No Asbestos						
B00A - R1009 - General Learning Space (49.63 m2)						
No Asbestos						
B00A - R1010 - Preparation (16.46 m2)						
No Asbestos						
B00A - R1011 - Laboratory L.S. (83.79 m2)						
No Asbestos						
B00A - R1012 - General Storeroom (13.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9						Chrysotile (white asbestos)
B00A - R1013 - Staff Study (32.37 m2)						
No Asbestos						
B00A - R1014 - Commonroom (106.77 m2)						
No Asbestos						
B00A - R1015 - Movement (8.74 m2)						
No Asbestos						
B00A - R1016 - Staff - Toilet (7.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					
8177/B00A/R1016/Wall Linings Internal/S2						No Asbestos Detected
B00A - R1017 - Staff - Toilet (4.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					
8177/B00A/R1016/Wall Linings Internal/S2						No Asbestos Detected
B00A - R1018 - Staff Study (28.29 m2)						
No Asbestos						
B00A - R1019 - Staff Study (46.74 m2)						
No Asbestos						
B00A - R1020 - Plant (21.97 m2)						
No Asbestos						
B00A - R1021 - Commonroom (35.3 m2)						
No Asbestos						
B00A - R1022 - Cleaning Store - Distributed (1.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9						Chrysotile (white asbestos)
B00A - R1023 - Staff Study (34.98 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R1024 - Cleaning Store - Distributed (1.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R1025 - Movement (243.83 m2)						
No Asbestos						
B00A - R1026 - Stairs (10.18 m2)						
No Asbestos						
B00A - R1027 - Stairs (10.87 m2)						
No Asbestos						
B00A - R1028 - Stairs (7.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9001 - Staff Study (9.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8177/B00A/R9009/Ceiling Structures/Linings/S10				No Asbestos Detected		
B00A - R9002 - Shower/Change (53.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8177/B00A/R9009/Ceiling Structures/Linings/S10				No Asbestos Detected		
B00A - R9003 - Toilets-Boys (2.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9004 - Toilets-Girls (1.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9005 - Shower/Change (51.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9006 - Sport Equipment Store (15.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9007 - Staff Shower (1.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9008 - Staff - Toilet (3.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9009 - Movement (22.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8177/B00A/R9009/Ceiling Structures/Linings/S10				No Asbestos Detected		
B00A - R9010 - Staff - Toilet (1.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R9011 - Maintenance Bulk Store (115.6 m2)						
Insulation to Pipework	Paper					
8177/B00A/R9011/Insulation to Pipework/S20				No Asbestos Detected		
B00A - R9012 - Cleaning Store - Distributed (5.16 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R9013 - Movement (1.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R9014 - Cleaning Store - Distributed (7.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00A - R9015 - Movement (3.77 m2)						
No Asbestos						
B00A - R9016 - Stairs (10.57 m2)						
No Asbestos						
B00A - R9017 - Stairs (6.8 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Art/Technological & Applied Studies - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00B - R0001 - Distribution Board Cupboard (0.65 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

Lining to back of doors	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1015/Lining to back of doors/S21					Chrysotile (white asbestos)

B00B - R0002 - Laboratory L.S. (92.61 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Window Sill	Compressed AC Sheet	10m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)

B00B - R0003 - Staff - Toilet (3.48 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1004/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)

B00B - R0004 - Preparation (29.05 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0005 - Apparatus Store (9.36 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0006 - General Learning Space (52.7 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Window Sill	Compressed AC Sheet	7m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00B - R0007 - Food/Research Space (8.14 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window Sill	Compressed AC Sheet	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00B - R0008 - Food/Research Space (8.39 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00B - R0009 - Food Technology L.S. (88.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	8m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00B - R0010 - Distribution Board Cupboard (0.66 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
Lining to back of doors	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1015/Lining to back of doors/S21					Chrysotile (white asbestos)
B00B - R0011 - Staff Study (24.08 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00B - R0012 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8177/B00A/R0045/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00B - R0013 - Movement (178.59 m2)						
No Asbestos						
B00B - R0014 - Stairs (16.75 m2)						
No Asbestos						
B00B - R1001 - Distribution Board Cupboard (0.64 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Lining to back of doors	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1015/Lining to back of doors/S21					Chrysotile (white asbestos)	
B00B - R1002 - Seminar (12.38 m2)						
No Asbestos						
B00B - R1003 - Staff Study (12.24 m2)						
No Asbestos						
B00B - R1004 - Staff - Toilet (3.67 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1004/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00B - R1005 - Bulk Store (12.59 m2)						
Window sill	Compressed AC Sheet	3m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
8177/B00B/R1005/Floor Coverings Res/Textile/S18					No Asbestos Detected	
B00B - R1006 - Staff Study (25.51 m2)						
Window sill	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1007 - Senior Study (65.48 m2)						
Window sill	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1011 - Art Learning Space (51.32 m2)						
Window sill	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1012 - Art Learning Space (59.8 m2)						
Window sill	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1013 - General Storeroom (10.08 m2)						
No Asbestos						
B00B - R1014 - Kiln Space (20.32 m2)						
Window sill	Compressed AC Sheet	3m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1015 - Distribution Board Cupboard (0.45 m2)						
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
					Note: No inspection of live electrical installation.	
Assumed Asbestos - Electrical Hazard						
Lining to back of doors	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1015/Lining to back of doors/S21					Chrysotile (white asbestos)	
B00B - R1016 - Art Learning Space (52.56 m2)						
Window sill	Compressed AC Sheet	4m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1017 - Movement (179.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	180m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00B - R1018 - Darkroom Space (35.17 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window sill	Compressed AC Sheet	7m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1016/Window sill/S3					Chrysotile (white asbestos)	
B00B - R1019 - Plant (4.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00B - R1020 - Stairs (8.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Science/General Learning - 1964 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior

B00C - R0001 - Cleaning Store - Distributed (4.71 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0002 - Music Store (11.27 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0003 - Music Learning Space (52.56 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Window Sill	Compressed AC Sheet	7m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3				Chrysotile (white asbestos)	

B00C - R0004 - Music Learning Space (52.56 m2)

Window Sill	Compressed AC Sheet	6m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0005 - Movement (9.18 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0006 - Practice/Seminar (11.98 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Window Sill	Compressed AC Sheet	3m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00B/R1016/Window sill/S3				Chrysotile (white asbestos)	

B00C - R0007 - Music Store (9.29 m2)

Ceiling Structures/Linings	Vermiculite	8177/B00A/R0045/Ceiling Structures/Linings/S1			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0008 - Laboratory L.S. (85.77 m2)

No Asbestos

B00C - R0011 - Laboratory L.S. (85.77 m2)

No Asbestos

B00C - R0012 - Chemical Store (9.2 m2)

No Asbestos

B00C - R0013 - General Storeroom (5.42 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0014 - Staff - Toilet (5.02 m2)						
In-fill-panel	Flat AC Sheeting 8177/B00D/R0004/Partition Walls (Cubicles)/S14					No Asbestos Detected
B00C - R0015 - Movement (116.02 m2)						
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Lining to back of doors	Flat AC Sheeting 8177/B00B/R1015/Lining to back of doors/S21	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0016 - Movement (11.91 m2)						
No Asbestos						
B00C - R0017 - Stairs (15.62 m2)						
No Asbestos						
B00C - R0018 - Stairs (15.62 m2)						
No Asbestos						
B00C - R0019 - Preparation (39.08 m2)						
No Asbestos						
B00C - R1001 - General Storeroom (11.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8177/B00C/R1001/Floor Coverings Res/Textile/S4	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1002 - Cleaning Store - Distributed (4.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8177/B00C/R1001/Floor Coverings Res/Textile/S4	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1003 - General Learning Space (52.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1004 - General Learning Space (52.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1005 - Staff Study (31.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1006 - General Learning Space (52.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - General Learning Space (52.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1008 - General Learning Space (52.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1009 - Computer Learning Space (52.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8177/B00C/R1001/Floor Coverings Res/Textile/S4	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1010 - General Storeroom (9.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00C - R1011 - General Storeroom (5.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00C/R1001/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00C - R1012 - Staff - Toilet (4.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00C - R1013 - Movement (116.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	117m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Lining to back of doors	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00B/R1015/Lining to back of doors/S21					Chrysotile (white asbestos)	
B00C - R1014 - Stairs (15.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00C - R1015 - Stairs (15.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1951 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00D - R0005 - Toilets-Girls (16.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0006 - Movement (60.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0007 - Movement (151.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting	152m2	Throughout	Minimal Damage (2)	Medium (2)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0008 - Student Canteen (84.05 m2)

No Asbestos

B00D - R0009 - Movement (1.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0010 - Staff - Toilet (4.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0011 - Pantry (9.08 m2)

No Asbestos

B00D - R0012 - Movement (61.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0015 - Toilets-Boys (45.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0016 - Security Store (20.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0017 - Toilets-Boys (12.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0018 - Toilet - Lobby (21.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00D - R0019 - Toilets-Girls (76.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1951 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00E - R0001 - Laundry (13.39 m2)

No Asbestos

B00E - R0002 - General Storeroom (5.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00E/R0002/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0003 - Food Technology L.S. (78.97 m2)

Under sink pad	Resinous Membrane	8177/B00E/R0003/Under sink pad/S22				No Asbestos Detected
----------------	-------------------	------------------------------------	--	--	--	----------------------

B00E - R0004 - Food/Research Space (18.82 m2)

Under sink pad	Resinous Membrane	8177/B00E/R0003/Under sink pad/S22				No Asbestos Detected
----------------	-------------------	------------------------------------	--	--	--	----------------------

B00E - R0005 - Cleaning Store - Distributed (0.95 m2)

No Asbestos

B00E - R0006 - General Storeroom (0.81 m2)

No Asbestos

B00E - R0007 - Food Technology L.S. (88.4 m2)

Under sink pad	Resinous Membrane	8177/B00E/R0003/Under sink pad/S22				No Asbestos Detected
----------------	-------------------	------------------------------------	--	--	--	----------------------

B00E - R0008 - Staff Study (9.83 m2)

No Asbestos

B00E - R0009 - Staff - Toilet (4.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0010 - Movement (26.08 m2)

No Asbestos

B00E - R0011 - Movement (2.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00E - R0012 - Covered Area (169.34 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1951 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00F - R0001 - Staff Study (36.48 m2)**

No Asbestos

B00F - R0002 - Movement (4.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00F - R0003 - Staff - Toilet (3.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00F - R0004 - Computer Learning Space (77.51 m2)

No Asbestos

B00F - R0005 - Staff Study (11.71 m2)

No Asbestos

B00F - R0006 - General Storeroom (7.94 m2)

No Asbestos

B00F - R0007 - Materials Technology L.S. (103.94 m2)

No Asbestos

B00F - R0008 - Materials Store (15.86 m2)

No Asbestos

B00F - R0009 - Staff Study (7.15 m2)

No Asbestos

B00F - R0010 - Materials Store (23.34 m2)

No Asbestos

B00F - R0011 - Materials Technology L.S. (140.32 m2)

No Asbestos

B00F - R0012 - Materials Store (14.69 m2)

No Asbestos

B00F - R0013 - Staff Study (7.21 m2)

No Asbestos

B00F - R0014 - Materials Technology L.S. (118.11 m2)

No Asbestos

B00F - R0015 - Welding Area (6.06 m2)

No Asbestos

B00F - R0016 - Movement (116.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	117m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00F - R0017 - Movement (7.72 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1956 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00G - R0001 - Movement (32.23 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00G - R0002 - Design L.S. (67.69 m2)

No Asbestos

B00G - R0003 - General Storeroom (6.64 m2)

No Asbestos

B00G - R0004 - General Storeroom (6.59 m2)

No Asbestos

B00G - R0005 - General Storeroom (13.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8177/B00A/R0053/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00G - R0006 - Design L.S. (67.77 m2)

No Asbestos

B00G - R0007 - Garden Store Room (67.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1985 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00L - R0002 - Main Area (401.37 m2)**

No Asbestos

B00L - R0003 - General Storeroom (4.74 m2)

No Asbestos

B00L - R0004 - Audio Visual Workroom (34.26 m2)

No Asbestos

B00L - R0005 - Workroom (39.85 m2)

No Asbestos

B00L - R0006 - Librarian (11.9 m2)

No Asbestos

B00L - R0007 - Pupil Entry (16.29 m2)

No Asbestos

B00L - R0009 - Distribution Board Cupboard (1.22 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0010 - Staff - Toilet (2.4 m2)

No Asbestos

B00L - R0011 - Staff - Toilet (2.43 m2)

No Asbestos

B00L - R0012 - Seminar (13.39 m2)

No Asbestos

B00L - R0013 - Cleaning Store - Distributed (0.91 m2)

No Asbestos

B00L - R0014 - Seminar (20.61 m2)

No Asbestos

B00L - R0015 - Movement (168.13 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other-Community Use - 1910 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00M - R0001 - Museum (42.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00M/R0003/Floor Coverings Res/Textile/S7						Chrysotile (white asbestos)

B00M - R0002 - General Storeroom (14.7 m2)

No Asbestos

B00M - R0003 - Museum (29.29 m2)

No Asbestos

B00M - R0004 - No Access (40.37 m2)

Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8177/B00M/R0003/Floor Coverings Res/Textile/S7						Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Performing Arts - 2001 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 8177/B00N/Eaves Linings/S5					No Asbestos Detected
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00N - R0001 - Music Learning Space (64.71 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0002 - Performance Workspace (65.44 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0003 - Performing Arts Changeroom (6.47 m2)

Wall Linings Internal	Flat AC Sheeting 8177/B00N/R0003/Wall Linings Internal/S6					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00N - R0004 - Music Store (9.57 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0005 - Performing Arts Changeroom (6.5 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0006 - Music Store (10.98 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0007 - Staff Study (10.9 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00N - R0008 - Movement (2.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8177/B00N/R0008/Ceiling Structures/Linings/S16					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Technological & Applied Studies - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B000 - R0001 - Workshop Area (234.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Physical Education - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00P - R0001 - Gymnasium (620.87 m2)**

No Asbestos

B00P - R0002 - First Aid (11.99 m2)

No Asbestos

B00P - R0003 - Large Equipment Store (23.93 m2)

No Asbestos

B00P - R0004 - Chair Store (33.63 m2)

No Asbestos

B00P - R0005 - Access Student Shower/Toilet/Change (9.04 m2)

No Asbestos

B00P - R0006 - Plant (0.72 m2)

No Asbestos

B00P - R0007 - Cleaning Store - Distributed (3.09 m2)

No Asbestos

B00P - R0008 - Change (29.08 m2)

No Asbestos

B00P - R0009 - Change (29.08 m2)

No Asbestos

B00P - R0010 - Distribution Board Cupboard (1.22 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00P - R0011 - External Movement (67.69 m2)

No Asbestos

B00P - R0012 - Plant (1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12950 - Learning Unit - Standard/Withdrawal : Placement Date - 27/06/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 601 - D13235 - Learning Unit - Standard/Withdrawal : Placement Date - 18/09/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 836 - D13701 - H Cap Shower/Change/Toilet : Placement Date - 15/11/2016

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 620 - D15416 - Single Learning Unit - H/Cap : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - Home Base-I.O.

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R3 - Disabled Shower/laundry

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

OS 730 - D15959 - Needlework Textile Learning/Str/Fitting : Placement Date - 22/01/2001

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Classroom

No Asbestos Found.

R2 - Fitting room

No Asbestos Found.

R3 - Materials Store

No Asbestos Found.

OS 601 - D16809 - Learning Unit - Standard/Withdrawal : Placement Date - 15/11/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8177_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017