


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kandos High School (8318)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Mid-Western

Initial Survey : Noel Arnold & Associates : 27 - May - 2008
Reviewed By : Greencap-NAA : 17 - Apr - 2015

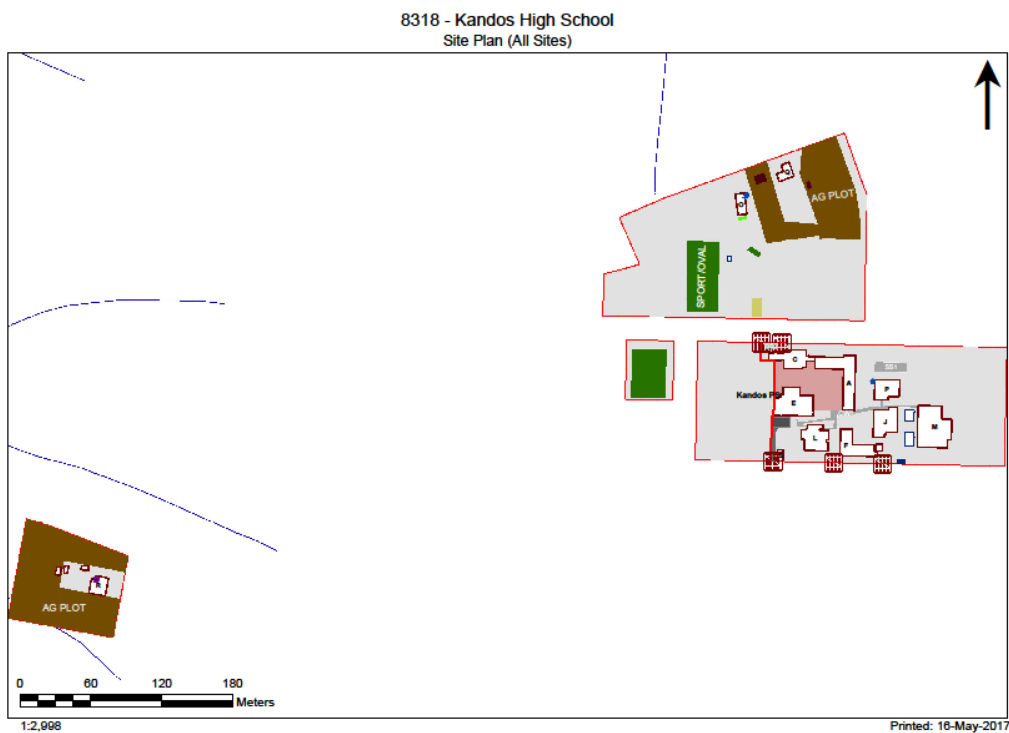

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B005 - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B005 - R0001 - Garden Store Room (40.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Various - 1969 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - M0001 - Staff - Toilet (6.61 m2)

No Asbestos

B00A - M0002 - Darkroom Space (6.65 m2)

No Asbestos

B00A - M0003 - Movement (6.19 m2)

No Asbestos

B00A - M0004 - Movement (6.21 m2)

No Asbestos

B00A - M0005 - Stairs (2.57 m2)

No Asbestos

B00A - M0006 - Stairs (1.29 m2)

No Asbestos

B00A - M0007 - Stairs (2.45 m2)

No Asbestos

B00A - M0008 - Stairs (2.45 m2)

No Asbestos

B00A - M1001 - Staff - Toilet (6.61 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - M1002 - Cleaning Store - Distributed (6.54 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - M1003 - Movement (6.19 m2)

No Asbestos

B00A - M1004 - Movement (6.21 m2)

No Asbestos

B00A - M1005 - Stairs (2.54 m2)

No Asbestos

B00A - M1006 - Stairs (2.54 m2)

No Asbestos

B00A - M1007 - Stairs (2.54 m2)

No Asbestos

B00A - M1008 - Stairs (2.54 m2)

No Asbestos

B00A - R0001 - Laboratory L.S. (93.39 m2)

Heat-proof Mat	Flat AC Sheeting					No Asbestos Detected
	8318/B00A/R0001/Heat-proof Mat/S15					

B00A - R0002 - Apparatus Store (12.68 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0003 - Chemical Store (12.65 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0004 - Interview/Office - Type 1 (26.27 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0006 - Apparatus Store (7.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0007 - Distribution Board Cupboard (0.9 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board 8318/B00A/R0009/Window Sill/S2	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R0008 - Staff Study (25.03 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00A - R0009 - Laboratory L.S. (93.89 m2)						
Fume Cupboard	Flat AC Sheeting 8318/B00A/R0009/Fume Cupboard/S5	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	5m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0010 - Preparation (29.08 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0011 - Resources Space (9.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Window Sill	Compressed AC Sheet	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Laboratory L.S. (94.08 m2)						
Fume Cupboard	Flat AC Sheeting	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Fume Cupboard/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Window Sill	Compressed AC Sheet	5m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Workbench	Compressed AC Sheet	3m2	East	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
	8318/B00A/R0009/Workbench/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - General Storeroom (13.37 m2)						
No Asbestos						
B00A - R0017 - Plant (10.53 m2)						
No Asbestos						
B00A - R0018 - External Movement (8.95 m2)						
No Asbestos						
B00A - R0019 - Plant (8.9 m2)						
No Asbestos						
B00A - R0020 - Stairs (5.88 m2)						
No Asbestos						
B00A - R0021 - Stairs (2.57 m2)						
No Asbestos						
B00A - R0022 - Stairs (2.45 m2)						
No Asbestos						
B00A - R0023 - Movement (156.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Window Sill	Compressed AC Sheet	50m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1001 - General Learning Space (53.63 m2)						
Window Sill	Compressed AC Sheet	3m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Workbench/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4			Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R1002 - General Storeroom (12.46 m2)						
Window Sill	Compressed AC Sheet	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4			Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1003 - General Learning Space (52.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4			Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
Window Sill	Compressed AC Sheet	20m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1004 - Staff Study (26.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
Window Sill	Compressed AC Sheet	10m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1005 - Distribution Board Cupboard (0.59 m2)						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
				Note: No inspection of live electrical installation.		
				Assumed Asbestos - Electrical Hazard		
B00A - R1006 - General Storeroom (9.01 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1007 - Special Learning Space (52.82 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	53m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00A - R1008 - Commonroom (52.61 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1009 - Music Learning Space (66.11 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	20m	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00A - R1010 - Music Store (6.14 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1011 - Music Store (6.09 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1012 - General Learning Space (53.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	20m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1013 - Movement (144.51 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Ceiling Structures/Linings/S4					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00A - R1014 - Stairs (19.62 m2)						
No Asbestos						
B00A - R1015 - Stairs (2.54 m2)						
No Asbestos						
B00A - R1016 - Stairs (2.54 m2)						
No Asbestos						
B00A - R1017 - Stairs (2.54 m2)						
No Asbestos						
B00A - R1018 - Stairs (2.54 m2)						
No Asbestos						
B00A - R2001 - General Learning Space (53.63 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	20m	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2002 - General Storeroom (6.13 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R2003 - General Storeroom (6.12 m2)						
Window Sill	Compressed AC Sheet	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R2004 - General Learning Space (52.76 m2)						
Window Sill	Compressed AC Sheet	10m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R2005 - Staff Study (26.51 m2)						
Window Sill	Compressed AC Sheet	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R2006 - Distribution Board Cupboard (0.65 m2)						
						<i>Note: No inspection of live electrical installation.</i>
Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R2006/Wall Linings Internal/S18					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
B00A - R2007 - Cleaning Store - Distributed (2.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2008 - General Storeroom (7.49 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window Sill	Compressed AC Sheet	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2009 - Stage (24.54 m2)						
Window Sill	Compressed AC Sheet	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2010 - General Learning Space (52.76 m2)						
Window Sill	Compressed AC Sheet	10m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R2011 - General Learning Space (52.76 m2)						
Window Sill	Compressed AC Sheet	10m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8318/B00A/R0006/Floor Coverings Res/Textile/S17					
B00A - R2012 - Resources Store (6.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2013 - Art Learning Space (86.05 m2)						
Window Sill	Compressed AC Sheet	20m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00A/R0009/Window Sill/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8318/B00A/R0009/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R2014 - Resources Store (6.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2015 - Resources Store (6.61 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	5m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R2016 - Movement (145.14 m2)						
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	50m	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00A - R2017 - Stairs (19.62 m2)						
Ceiling Structures/Linings	Vermiculite 8318/B00A/R0009/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet 8318/B00A/R0009/Window Sill/S2	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8318/B00A/R0006/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00A - R2018 - Stairs (11.07 m2)						
No Asbestos						
B00A - R2019 - Stairs (11.07 m2)						
No Asbestos						
B00A - R9001 - Main Switchroom (8.85 m2)						
Electrical Backing Board	Resinous Board 8318/B00A/R9001/Electrical Backing Board/S1	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00A - R9002 - Plant (15.6 m2)						
Gasket	Encapsulated Insulation material within unit 8318/B00A/R9002/Gasket/S14					No Asbestos Detected
Electrical Backing Board	Resinous Board 8318/B00A/R9002/Electrical Backing Board/S1	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/General Learning - 1929 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Administration - Clerical (47.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00C - R0002 - General Learning Space (47.63 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00C - R0004 - Toilets-Disabled (9.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0007 - Staff - Toilet (3.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8318/B00A/R0006/Floor Coverings Res/Textile/S16					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0008 - Movement (8.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00C - R0009 - Deputy Principal Office (9.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0010 - Cleaning Supplies Store (7.61 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R0012 - Staff Study (18.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R0013 - Clinic - Boys (16.14 m2)						
No Asbestos						
B00C - R0014 - Interview/Office - Type 1 (17.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R0016 - Movement (79.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0017 - General Storeroom (3.66 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R0018 - Uniform Shop (4.77 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R1001 - Toilets-Girls (2.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1002 - Resources Space (18.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - R1003 - General Learning Space (49.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					
Floor Coverings Res/Textile	Backing					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					
B00C - R1004 - General Learning Space (49.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					
Floor Coverings Res/Textile	Backing					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					
B00C - R1005 - General Learning Space (50.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					
Floor Coverings Res/Textile	Backing					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					
B00C - R1006 - Staff Study (7.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					
Floor Coverings Res/Textile	Backing					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					
B00C - R1007 - General Storeroom (11.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1008 - Movement (16.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8318/B00C/R0002/Floor Coverings Res/Textile/S19					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Backing					
	8318/B00C/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00C - R1009 - Stairs (12.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R9001 - Chair Store (3.84 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1966 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Interview/Office - Type 1 (15.57 m2)

No Asbestos

B00D - R0002 - General Storeroom (6.67 m2)

No Asbestos

B00D - R0003 - Principal Office (19.83 m2)

No Asbestos

B00D - R0004 - Movement (21.89 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - Pupil Facilities/Physical Education - 1969 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Compressed AC Sheet	12m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/Wall Cladding/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Interior						
B00E - R0002 - Sport Equipment Store (11.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0003 - Student Canteen (40.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Benchtops	Vinyl Sheet					No Asbestos Detected
	8318/B00E/R0003/Benchtops/S21					
Benchtop	Adhesive					No Asbestos Detected
	8318/B00E/R0003/Benchtop/S22					
B00E - R0004 - General Storeroom (4.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0005 - Staff Change (1.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0006 - Staff - Toilet (3.1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0007 - Sport Equipment Store (23.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0008 - Shower/Change (4.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0009 - Plant (4.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - R0010 - Toilets-Girls (46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0011 - Shower/Change (18.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0012 - Cleaning Supplies Store (6.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0013 - Toilets-Boys (27.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	2m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0013/In-fill-panel/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0014 - External Movement (1.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0015 - General Storeroom (17.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0016 - Sport Equipment Store (8.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0017 - Sport Equipment Store (19.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00E - R0018 - Sport Equipment Store (19.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0019 - General Storeroom (21.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0020 - Covered Area (80.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0021 - Covered Area (179.53 m2)						
No Asbestos						
B00E - R0022 - External Movement (20.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0023 - Adjoining School (18.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0010/Partition Walls (Cubicles)/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0024 - Adjoining School (2.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0025 - Adjoining School (1.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0026 - Adjoining School (21.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0010/Partition Walls (Cubicles)/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00E - R0027 - Adjoining School (1.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8318/B00E/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1955 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0007 - Movement (3.76 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0008 - Staff Study (10.5 m2)

No Asbestos

B00F - R0009 - Staff - Toilet (5.42 m2)

No Asbestos

B00F - R0010 - Commonroom (6.99 m2)

No Asbestos

B00F - R0015 - Wood Technology Bay (138.15 m2)

No Asbestos

B00F - R0016 - External Movement (8.79 m2)

No Asbestos

B00F - R0017 - Materials Store (6.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0018 - Metal Technology L.S. (151.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0019 - Materials Store (21.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0020 - Welding Area (34.09 m2)

No Asbestos

B00F - R9001 - General Storeroom (134.4 m2)

No Asbestos

B00F - R9002 - Dust Extraction Space (6.14 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Technological & Applied Studies - 1994 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Distribution Board Cupboard (1.08 m2) Note: No inspection of live electrical installation.

No Asbestos

B00J - R0002 - External Movement (5.48 m2)

No Asbestos

B00J - R0003 - Computer Learning Space (76.32 m2)

No Asbestos

B00J - R0004 - General Storeroom (15.75 m2)

No Asbestos

B00J - R0005 - Cleaning Store - Distributed (3.22 m2)

No Asbestos

B00J - R0006 - Materials Technology L.S. (76.49 m2)

No Asbestos

B00J - R0011 - Staff Study (20.32 m2)

No Asbestos

B00J - R0012 - Staff - Toilet (6.29 m2)

No Asbestos

B00J - R0013 - Seminar (15.31 m2)

No Asbestos

B00J - R0014 - Movement (36.86 m2)

No Asbestos

B00J - R0015 - External Movement (2.11 m2)

No Asbestos

B00J - R0016 - Laundry (2.28 m2)

No Asbestos

B00J - R0017 - Food Technology L.S. (82.61 m2)

No Asbestos

B00J - R0018 - Preparation - Materials (28.88 m2)

No Asbestos

B00J - R0019 - Pantry (6.59 m2)

No Asbestos

B00J - R0020 - Preparation - Materials (17.76 m2)

No Asbestos

B00J - R0021 - Food/Research Space (13.51 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 2003 - Timber Shed (Timber Shed)**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/Wall Cladding/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00K - R0001 - General Storeroom (25.5 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/Wall Cladding/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 2008 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00L - R0001 - Main Entry (21.57 m2)**

No Asbestos

B00L - R0002 - Staff - Toilet (5.18 m2)

No Asbestos

B00L - R0003 - Toilets-Disabled (5.86 m2)

No Asbestos

B00L - R0004 - Careers Advisers Office (12.02 m2)

No Asbestos

B00L - R0005 - System Administrators Office (12.93 m2)

No Asbestos

B00L - R0006 - Communication Space (9.85 m2)

No Asbestos

B00L - R0007 - Store (5.79 m2)

No Asbestos

B00L - R0008 - Main Area (146.16 m2)

No Asbestos

B00L - R0009 - Store (5.18 m2)

No Asbestos

B00L - R0010 - Library Administration (53.09 m2)

No Asbestos

B00L - R0011 - Special Learning Space (15.5 m2)

No Asbestos

B00L - R0012 - Seminar (12.88 m2)

No Asbestos

B00L - R0013 - Seminar (12.88 m2)

No Asbestos

B00L - R0014 - External Movement (54.4 m2)

No Asbestos

B00L - R0015 - Distribution Board Cupboard (0.47 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0016 - Special Learning Space (15.5 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Multi Purpose Facilities/Performing Arts - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00M - R0001 - Gymnasium (487.11 m2)

No Asbestos

B00M - R0002 - Apparatus Store (24.98 m2)

No Asbestos

B00M - R0003 - Stage (66.41 m2)

No Asbestos

B00M - R0004 - Movement (10.51 m2)

No Asbestos

B00M - R0005 - Chair Store (23.74 m2)

No Asbestos

B00M - R0007 - Toilet - Lobby (3.64 m2)

No Asbestos

B00M - R0008 - Toilets-Boys (20.11 m2)

No Asbestos

B00M - R0009 - Change (20.78 m2)

No Asbestos

B00M - R0010 - Toilet - Lobby (3.64 m2)

No Asbestos

B00M - R0011 - Toilets-Girls (25.22 m2)

No Asbestos

B00M - R0012 - Change (20.74 m2)

No Asbestos

B00M - R0013 - Control Room (9.75 m2)

No Asbestos

B00M - R0014 - Toilets-Disabled (5.63 m2)

No Asbestos

B00M - R0015 - Distribution Board Cupboard (1.39 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0016 - External Movement (20.95 m2)

No Asbestos

B00M - R0017 - External Movement (74.14 m2)

No Asbestos

B00M - R0018 - Shower (6.91 m2)

No Asbestos

B00M - R0019 - Cleaning Supplies Store (2.59 m2)

No Asbestos

B00M - R0020 - Shower (7.47 m2)

No Asbestos

B00M - R0021 - Ramp (11.18 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00N - R0001 - Garden Store Room (33.67 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Agricultural Science - 1955 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - General Storeroom (19.73 m2)

No Asbestos

B000 - R0002 - Plant Growing Space (16.48 m2)

No Asbestos

B000 - R0003 - General Storeroom (13.37 m2)

No Asbestos

B000 - R0004 - Toilets-Unisex (6.34 m2)

No Asbestos

B000 - R0005 - Machine Storage (30.39 m2)

No Asbestos

B000 - R0006 - General Learning Space (44.44 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00P - R0001 - General Learning Space (21.09 m2)**

No Asbestos

B00P - R0002 - Staff Study (21.09 m2)

No Asbestos

B00P - R0003 - Chemical Store (12.13 m2)

No Asbestos

B00P - R0004 - Preparation (36.45 m2)

No Asbestos

B00P - R0005 - Distribution Board Cupboard (0.63 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00P - R0006 - Apparatus Storage (13.71 m2)

No Asbestos

B00P - R0007 - Laboratory L.S. (60.06 m2)

No Asbestos

B00P - R0008 - Laboratory L.S. (60.06 m2)

No Asbestos

B00P - R0009 - Outdoor Learning Space - Type 4 (41.45 m2)

No Asbestos

B00P - R0010 - External Movement (44.19 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Toilets West of Building E**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00D/Eaves Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**Build+1 - Room+1 - Girls Toilets**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

Build+1 - Room+2 - Cleaners Cupboard

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

Build+1 - Room+3 - Boys Toilets

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0010/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

Build+1 - Room+4 - Storage Room

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8318/B00E/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 621 - D10435 - Single Learning Unit - H/Cap : Placement Date - 3/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Home Base-I.O.

No Asbestos Found.

R2 - Toilets-Disabled

No Asbestos Found.

R3 - Laundry

No Asbestos Found.

OS 601 - D10882 - Learning Unit - Standard/Withdrawal : Placement Date - 14/01/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 844 - D13850 - Country Toilet - Reltc - Boys/Girls : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017