


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kogarah High School (8320)  
**Region :** Sydney  
**State Electorate :** Kogarah  
**Local Government Area :** Kogarah

**Initial Survey :** Noel Arnold & Associates : 03 - Feb - 2010  
**Reviewed By :** Greencap-NAA : 13 - Aug - 2014

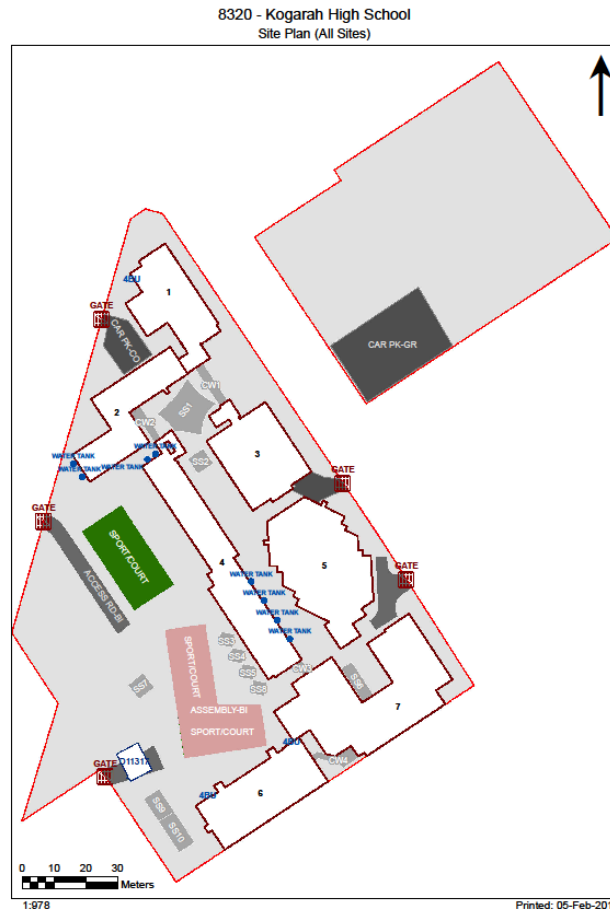

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Technological & Applied Studies - 1972 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height restricted 8m</b>						

Underfloor Voids - Slab on Ground	No Asbestos Found
-----------------------------------	-------------------

Ceiling Voids - Raked Ceiling	No Asbestos Found
-------------------------------	-------------------

**Interior****B001 - R0001 - Distribution Board Cupboard (0.88 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B001 - R0002 - Toilets-Girls (42.16 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0003 - Materials Technology L.S. (82.48 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0004 - Welding Area (16.03 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0005 - Resource/Project Store (16.17 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0006 - Materials Technology L.S. (83.02 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0007 - Resource/Project Store (15.87 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B001 - R0008 - Art Learning Space (63.58 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					<b>Chrysotile (white asbestos)</b>

**B001 - R0009 - Resources Store (8.27 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					<b>Chrysotile (white asbestos)</b>

**B001 - R0010 - Kiln Space (13.45 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8320/B001/R2009/Ceiling Structures/Linings/S16					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0011 - General Storeroom (4.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B001/R2004/Floor Coverings Res/Textile/S15					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0012 - Movement (68.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R0013 - Materials Store (10.85 m2)</b>						
No Asbestos						
<b>B001 - R0014 - General Storeroom (8.97 m2)</b>						
No Asbestos						
<b>B001 - R0015 - General Storeroom (4.71 m2)</b>						
No Asbestos						
<b>B001 - R0016 - General Storeroom (9.8 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B001/R0016/Ceiling Structures/Linings/S45					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R0017 - External Movement (45.53 m2)</b>						
No Asbestos						
<b>B001 - R0018 - External Stairs (0.38 m2)</b>						
No Asbestos						
<b>B001 - R0019 - Stairs (11.99 m2)</b>						
No Asbestos						
<b>B001 - R1001 - Distribution Board Cupboard (0.87 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R1002 - Cleaning Store - Distributed (10.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1003 - Toilets-Boys (42.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1004 - Materials Technology L.S. (82.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1005 - Materials Store (15.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1006 - Dust Extraction Space (5.69 m2)</b>						
No Asbestos						
<b>B001 - R1007 - Materials Store (9.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1008 - Materials Technology L.S. (82.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8320/B001/R2009/Ceiling Structures/Linings/S16					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1009 - Materials Store (15.69 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1010 - Resource/Project Store (11.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1011 - Staff - Toilet (5.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1012 - Staff - Toilet (6.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1013 - Staff Study (25.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1014 - Staff Study (26.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1015 - Movement (74.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R1016 - External Movement (41.41 m2)</b>						
No Asbestos						
<b>B001 - R1017 - External Stairs (4.97 m2)</b>						
No Asbestos						
<b>B001 - R1018 - Stairs (16.99 m2)</b>						
No Asbestos						
<b>B001 - R2001 - Distribution Board Cupboard (0.84 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R2002 - Art Learning Space (65.67 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R2003 - Art Learning Space (67.13 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B001 - R2004 - General Storeroom (15.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B001 - R2005 - Art Learning Space (52.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

**B001 - R2006 - Design L.S. (65.39 m2)**

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

**B001 - R2007 - Design L.S. (28.41 m2)**

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B001 - R2008 - Computer Learning Space (57.48 m2)**

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B001/R2004/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

**B001 - R2009 - Movement (65.76 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8320/B001/R2009/Floor Coverings Res/Textile/S14					No Asbestos Detected

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B001 - R2010 - Movement (36.2 m2)**

No Asbestos

**B001 - R2011 - Stairs (4.97 m2)**

No Asbestos

**B001 - R2012 - Stairs (17.23 m2)**

Ceiling Structures/Linings	Vermiculite					
	8320/B001/R2009/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - Science/General Learning - 1963 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	120m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height restricted 9m</b>						
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B002 - R0001 - Laboratory L.S. (101.48 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B002 - R0002 - Preparation (29.01 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8320/B002/R0013/Floor Coverings Res/Textile/S18						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B002 - R0003 - General Storeroom (9.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8320/B002/R0013/Floor Coverings Res/Textile/S18						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B002 - R0004 - Laboratory L.S. (93.61 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B002 - R0005 - Distribution Board Cupboard (0.69 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B002 - R0006 - General Storeroom (3.28 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8320/B002/R1007/Floor Coverings Res/Textile/S39						

**B002 - R0007 - Laboratory L.S. (99.25 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B002/R0013/Ceiling Structures/Linings/S19						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B002/R0007/Fume Cupboard/S41						<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
8320/B002/R0013/Floor Coverings Res/Textile/S18						
Fume Cupboard	Fibre Cement Pipe	2Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B002/R0007/Fume Cupboard/S41						<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B002 - R0008 - General Storeroom (6.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B002 - R0009 - Preparation (26.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B002 - R0010 - Cleaning Store - Distributed (3.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B002 - R0011 - Staff Study (26.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B002 - R0012 - Staff - Toilet (6.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Infill panels	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B002/R0012/Infill panels/S40					Chrysotile (white asbestos)
<b>B002 - R0013 - Movement (59.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8320/B002/R0013/Floor Coverings Res/Textile/S18					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B002 - R0014 - General Storeroom (1.37 m2)</b>						
No Asbestos						
<b>B002 - R0015 - Stairs (9.99 m2)</b>						
No Asbestos						
<b>B002 - R1001 - General Learning Space (52.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
Vinyl floor sheet adhesive	Adhesive					
	8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B002 - R1002 - General Learning Space (52.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Pipe	Fibre Cement Pipe	1Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B002/R1002/Pipe/S23					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
Vinyl floor sheet adhesive	Adhesive					
	8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B002 - R1003 - General Learning Space (52.79 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Pipe	Fibre Cement Pipe 8320/B002/R1002/Pipe/S23	1Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Sheet 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
Vinyl floor sheet adhesive	Adhesive 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B002 - R1004 - General Learning Space (53.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
Vinyl floor sheet adhesive	Adhesive 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B002 - R1005 - Distribution Board Cupboard (0.65 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B002 - R1006 - Staff - Toilet (6.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1007 - General Learning Space (26.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
Vinyl floor sheet adhesive	Adhesive 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected
<b>B002 - R1008 - Cleaning Store - Distributed (3.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1009 - Staff Study (51.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B002 - R1010 - General Learning Space (67.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B002/R0013/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Pipe	Fibre Cement Pipe 8320/B002/R1002/Pipe/S23	1Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Vinyl floor sheet adhesive	Adhesive 8320/B002/R1007/Floor Coverings Res/Textile/S39					No Asbestos Detected



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile Vinyl Sheet  
 8320/B002/R1007/Floor Coverings Res/Textile/S39 **No Asbestos Detected**

**B002 - R1011 - Movement (100.64 m2)**

Ceiling Structures/Linings Vermiculite  
 8320/B002/R0013/Ceiling Structures/Linings/S19 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B002 - R1012 - Stairs (14.14 m2)**

Ceiling Structures/Linings Vermiculite  
 8320/B002/R0013/Ceiling Structures/Linings/S19 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B003 - Library/Science Learning - 1970 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
<b>Interior</b>						
<b>B003 - M1001 - General Storeroom (14.73 m2)</b>						
No Asbestos						
<b>B003 - M1002 - Senior Seminar (14.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - M1003 - General Storeroom (14.68 m2)</b>						
Debris	Fibre Cement Pipe	2m	Middle portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8320/B003/M1003/Debris/S44		Chrysotile (white asbestos) , Amosite (brown asbestos)				
<b>B003 - M1004 - Main Area (69.21 m2)</b>						
No Asbestos						
<b>B003 - M1005 - Seminar (38.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - M1006 - General Storeroom (12.74 m2)</b>						
No Asbestos						
<b>B003 - M1007 - Distribution Board Cupboard (3.42 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B003 - M1008 - Stairs (3.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - M1009 - Stairs (3.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - R0001 - Laboratory L.S. (90.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - R0004 - Laboratory L.S. (91.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B003 - R0005 - General Learning Space (82.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8320/B003/R0007/Ceiling Structures/Linings/S12		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B003/R0012/Floor Coverings Res/Textile/S11		Chrysotile (white asbestos)				
<b>B003 - R0006 - Staff Study (7.73 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8320/B003/R0007/Ceiling Structures/Linings/S12					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B003/R0012/Floor Coverings Res/Textile/S11	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B003 - R0007 - Staff Study (10.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B003/R0007/Ceiling Structures/Linings/S12					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B003/R0012/Floor Coverings Res/Textile/S11	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B003 - R0008 - Preparation (37.17 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8320/B003/R0012/Floor Coverings Res/Textile/S11	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8320/B003/R0007/Ceiling Structures/Linings/S12					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B003 - R0009 - Laboratory L.S. (90.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B003/R0007/Ceiling Structures/Linings/S12					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B003 - R0010 - Distribution Board Cupboard (0.51 m2)</b>						
Electrical Mounting Board	Resinous Board 8320/B003/R0010/Electrical Mounting Board/S42	2Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles 8320/B003/R0012/Floor Coverings Res/Textile/S11	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B003 - R0011 - Apparatus Store (16.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8320/B003/R0012/Floor Coverings Res/Textile/S11	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B003 - R0012 - Movement (40.34 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8320/B003/R0012/Floor Coverings Res/Textile/S11	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B003 - R0013 - Pupil Entry (28.24 m2)</b>						
No Asbestos						
<b>B003 - R0014 - General Storeroom (4.43 m2)</b>						
No Asbestos						
<b>B003 - R0015 - Plant (10.51 m2)</b>						
Gasket to boiler	Rope gasket 8320/B003/R0015/Gasket to boiler/S10	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Boiler	Encapsulated Insulation material within unit 8320/B003/R0015/Boiler/S43					<b>No Asbestos Detected</b>
Insulation to Pipework	Encapsulated Insulation material within unit 8320/B003/R0015/Boiler/S43					<b>No Asbestos Detected</b>
Electrical Backing Board	Resinous Board 8320/B003/R0015/Boiler/S43	1Unit	Adjacent entrance	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Sealed unit &amp; live</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B003 - R0016 - External Stairs (11.82 m2)</b>						
No Asbestos						
<b>B003 - R0017 - Preparation (48.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B003/R0007/Ceiling Structures/Linings/S12					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B003 - R1001 - Seminar (12.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R1008/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1002 - Seminar (12.33 m2)</b>						
No Asbestos						
<b>B003 - R1003 - Cleaning Store - Distributed (0.38 m2)</b>						
No Asbestos						
<b>B003 - R1004 - Cleaning Store - Distributed (4.61 m2)</b>						
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R0010/Electrical Mounting Board/S42					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1005 - Distribution Board Cupboard (0.31 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R0010/Electrical Mounting Board/S42					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1006 - Seminar (12.99 m2)</b>						
No Asbestos						
<b>B003 - R1007 - Seminar (13.59 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R1008/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	8320/B003/R0007/Ceiling Structures/Linings/S12					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B003 - R1008 - Main Area (327.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	East facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R1008/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	8320/B003/R0007/Ceiling Structures/Linings/S12					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B003 - R1009 - Audio Visual Workroom (28.5 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R1008/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1010 - General Storeroom (12.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B003/R1008/Ceiling Structures/Linings/S13					<b>Chrysotile (white asbestos)</b>
<b>B003 - R1011 - Workroom (17.79 m2)</b>						
No Asbestos						
<b>B003 - R1012 - Librarian (11.43 m2)</b>						
No Asbestos						
<b>B003 - R1013 - Staff - Toilet (3.11 m2)</b>						
No Asbestos						
<b>B003 - R1014 - Staff - Toilet (3.22 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B003 - R1015 - Seminar (71.15 m2)**

Ceiling Structures/Linings Flat AC Sheeting 4m2 East facing Good Condition (1) Low (1) Low Priority (2-3)

8320/B003/R1008/Ceiling Structures/Linings/S13 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite  
8320/B003/R0007/Ceiling Structures/Linings/S12 **Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B003 - R1016 - Plant (5.84 m2)**

No Asbestos

**B003 - R1017 - Plant (6.37 m2)**

No Asbestos

**B003 - R1018 - Stairs (17.05 m2)**

No Asbestos

**B003 - R1020 - External Movement (24.91 m2)**

No Asbestos

**B003 - R1021 - Movement (1.46 m2)**

No Asbestos

**B003 - R1022 - Stairs (0.5 m2)**

Ceiling Structures/Linings Vermiculite  
8320/B003/R0007/Ceiling Structures/Linings/S12 **Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B003 - R1023 - Stairs (0.5 m2)**

Ceiling Structures/Linings Vermiculite  
8320/B003/R0007/Ceiling Structures/Linings/S12 **Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - General Learning/Various - 1963 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	130m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height restricted 6m</b>						
Ceiling Voids	Non Accessible Area - Height restricted 3m					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B004 - R0001 - General Storeroom (26.43 m2)**

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Pipe	Fibre Cement Pipe	1m	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B004/R0001/Pipe/S33 <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>						

**B004 - R0002 - General Storeroom (7.25 m2)**

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B004/R0002/Floor Coverings Res/Textile/S20 <b>Chrysotile (white asbestos)</b>						
Pipe	Fibre Cement Pipe	2m	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B004/R0001/Pipe/S33 <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>						

**B004 - R0003 - Distribution Board Cupboard (9.32 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Electrical Mounting Board	Resinous Board	4Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B004/R0003/Electrical Mounting Board/S34 <b>Chrysotile (white asbestos)</b>						

**B004 - R0006 - Food/Research Space (13.22 m2)**

No Asbestos

**B004 - R0007 - Food/Research Space (12.68 m2)**

No Asbestos

**B004 - R0008 - Food/Research Space (66.91 m2)**

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0009 - General Storeroom (6.53 m2)**

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B004 - R0010 - General Storeroom (3.01 m2)**

Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Flue pipe	Fibre Cement Pipe	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B004/R0001/Pipe/S33					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B004 - R0011 - General Storeroom (3.01 m2)</b>						
No Asbestos						
<b>B004 - R0012 - Cleaning Store - Distributed (3.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0013 - Distribution Board Cupboard (0.48 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B004/R0003/Electrical Mounting Board/S34					<b>Chrysotile (white asbestos)</b>
<b>B004 - R0014 - Music Learning Space (83.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0015 - Resources (17.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	8320/B004/R0015/Floor Coverings Res/Textile/S35					
Vinyl floor tile adhesive	Adhesive					<b>No Asbestos Detected</b>
	8320/B004/R0015/Vinyl floor tile adhesive/S36					
<b>B004 - R0016 - Administration - Clerical (61.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0017 - Computer Learning Space (49.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0018 - Cleaning Store - Distributed (3.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0019 - Staff - Toilet (6.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0020 - Toilets-Boys (26.05 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B004/R1020/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>
<b>B004 - R0022 - Movement (169.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R0023 - General Storeroom (5.58 m2)</b>						
No Asbestos						
<b>B004 - R0024 - Stairs (1.17 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8320/B004/R1001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B004 - R0025 - Stairs (6.35 m2)</b>						
No Asbestos						
<b>B004 - R0026 - Stairs (5.67 m2)</b>						
No Asbestos						
<b>B004 - R0027 - Food Technology L.S. (88.18 m2)</b>						
No Asbestos						
<b>B004 - R0028 - External Movement (72.48 m2)</b>						
No Asbestos						
<b>B004 - R0029 - External Movement (6.09 m2)</b>						
No Asbestos						
<b>B004 - R0030 - Movement (6.45 m2)</b>						
No Asbestos						
<b>B004 - R0031 - Lift (2.24 m2)</b>						
No Asbestos						
<b>B004 - R0032 - Movement (6.71 m2)</b>						
No Asbestos						
<b>B004 - R0033 - Movement (3.09 m2)</b>						
No Asbestos						
<b>B004 - R0034 - External Movement (16.57 m2)</b>						
No Asbestos						
<b>B004 - R1001 - Staff - Toilet (6.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B004/R1001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B004 - R1002 - General Storeroom (5.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B004/R1001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8320/B004/R1002/Floor Coverings Res/Textile/S38					No Asbestos Detected
<b>B004 - R1003 - Distribution Board Cupboard (0.68 m2)</b>						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B004/R0003/Electrical Mounting Board/S34					Chrysotile (white asbestos)
<b>B004 - R1004 - Staff Study (26.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B004/R1001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B004/R0002/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)
<b>B004 - R1005 - Design L.S. (66.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B004/R1001/Ceiling Structures/Linings/S9					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8320/B004/R1009/Floor Coverings Res/Textile/S37					No Asbestos Detected
<b>B004 - R1006 - General Storeroom (8.7 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8320/B004/R1009/Floor Coverings Res/Textile/S37				No Asbestos Detected	
<b>B004 - R1007 - General Storeroom (5.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8320/B004/R1009/Floor Coverings Res/Textile/S37				No Asbestos Detected	
<b>B004 - R1008 - General Storeroom (11.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8320/B004/R1009/Floor Coverings Res/Textile/S37				No Asbestos Detected	
<b>B004 - R1009 - Design L.S. (67.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8320/B004/R1009/Floor Coverings Res/Textile/S37				No Asbestos Detected	
<b>B004 - R1010 - General Storeroom (10.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B004 - R1011 - General Storeroom (14.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B004 - R1012 - General Learning Space (52.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B004 - R1013 - General Learning Space (53.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Flue pipe	Fibre Cement Pipe 8320/B004/R0001/Pipe/S33	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
<b>B004 - R1014 - General Learning Space (53.46 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Flue pipe	Fibre Cement Pipe 8320/B004/R0001/Pipe/S33	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B004 - R1015 - Staff Study (25.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B004 - R1016 - Staff Study (13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B004 - R1017 - Staff Study (12.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B004/R0002/Floor Coverings Res/Textile/S20	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B004 - R1018 - Distribution Board Cupboard (0.72 m2)</b>						
Electrical Backing Board	Resinous Board 8320/B004/R0003/Electrical Mounting Board/S34	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B004 - R1019 - Cleaning Store - Distributed (6.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R1020 - Toilets-Girls (30.06 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 8320/B004/R1020/Partition Walls (Cubicles)/S1	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B004 - R1022 - Movement (177.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R1023 - Stairs (9.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R1024 - Stairs (8.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8320/B004/R1001/Ceiling Structures/Linings/S9					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B004 - R1025 - Stairs (13.86 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
8320/B004/R1001/Ceiling Structures/Linings/S9

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B004 - R1026 - Movement (22.18 m2)**

No Asbestos

**B004 - R1027 - Movement (6.5 m2)**

No Asbestos

**B004 - R1028 - Movement (6.45 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B005 - Multi Purpose Facilities - 1974 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height restricted 6m

**Interior****B005 - M1001 - Plant (19.84 m2)**

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

**Assumed Asbestos - Sealed unit & live****B005 - M1002 - Plant (20.82 m2)**

No Asbestos

**B005 - R0001 - General Storeroom (12.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0006/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	

**B005 - R0002 - Distribution Board Cupboard (0.99 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8320/B005/R0002/Ceiling Structures/Linings/S30					<b>Chrysotile (white asbestos)</b>	

Electrical cabinet floor	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0002/Electrical cabinet floor/S31					<b>Chrysotile (white asbestos)</b>	

Electrical cabinet door lining	Millboard	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0002/Electrical cabinet door lining/S32					<b>Chrysotile (white asbestos)</b>	

**B005 - R0003 - Cleaning Store - Distributed (2.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0006/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	

**B005 - R0004 - Toilets-Girls (26.91 m2)**

No Asbestos

**B005 - R0005 - Movement (73.48 m2)**

No Asbestos

**B005 - R0006 - Student Canteen (17.61 m2)**

No Asbestos

**B005 - R0007 - Toilets-Boys (26.86 m2)**

No Asbestos

**B005 - R0008 - Multi-Purpose Space (455.93 m2)**

No Asbestos

**B005 - R0009 - Chair Store (20.58 m2)**

No Asbestos

**B005 - R0010 - Movement (7.79 m2)**

No Asbestos

**B005 - R0011 - Stage (117.26 m2)**

No Asbestos

**B005 - R0012 - Movement (7.55 m2)**

No Asbestos

**B005 - R0013 - Chair Store (19.17 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B005 - R0014 - Staff - Toilet (1.77 m2)</b>						
No Asbestos						
<b>B005 - R0015 - External Movement (15.84 m2)</b>						
No Asbestos						
<b>B005 - R0016 - External Movement (3 m2)</b>						
No Asbestos						
<b>B005 - R0017 - External Movement (3.02 m2)</b>						
No Asbestos						
<b>B005 - R0018 - External Movement (1.58 m2)</b>						
No Asbestos						
<b>B005 - R0019 - External Movement (2.25 m2)</b>						
No Asbestos						
<b>B005 - R0020 - External Movement (2.61 m2)</b>						
No Asbestos						
<b>B005 - R0021 - External Movement (2.61 m2)</b>						
No Asbestos						
<b>B005 - R0022 - Other (1.31 m2)</b>						
No Asbestos						
<b>B005 - R0023 - External Movement (57.5 m2)</b>						
No Asbestos						
<b>B005 - R1001 - Performing Arts Changeroom (16.54 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0006/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B005 - R1002 - Staff - Toilet (1.72 m2)</b>						
No Asbestos						
<b>B005 - R1003 - Shower/Change (1.72 m2)</b>						
No Asbestos						
<b>B005 - R1004 - Movement (6.51 m2)</b>						
No Asbestos						
<b>B005 - R1005 - Control Room (14.68 m2)</b>						
No Asbestos						
<b>B005 - R1006 - Movement (4.18 m2)</b>						
No Asbestos						
<b>B005 - R1007 - Performing Arts Changeroom (16.4 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B005/R0006/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B005 - R1008 - Shower/Change (1.64 m2)</b>						
No Asbestos						
<b>B005 - R1009 - Staff - Toilet (1.72 m2)</b>						
No Asbestos						
<b>B005 - R1010 - Stairs (1.55 m2)</b>						
No Asbestos						
<b>B005 - R1011 - Stairs (1.55 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B006 - General Learning - 1920 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Underfloor Voids	Flat AC Sheeting	2m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8320/B006/Underfloor Voids/S29					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height restricted 3m					
<b>Interior</b>						
<b>B006 - R0001 - Cleaning Store - Distributed (4.92 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0002 - General Storeroom (12.32 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
Chalk Board	Compressed AC Sheet					<b>No Asbestos Detected</b>
	8320/B006/R0002/Chalk Board/S8					
<b>B006 - R0004 - General Learning Space (48.74 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0005 - General Learning Space (48.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0008 - Staff Study (47.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0009 - General Learning Space (48.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0010 - General Learning Space (47.62 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0011 - Interview/Office - Type 1 (12.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0012 - Cleaning Store - Distributed (4.94 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0013 - Administration - Clerical (28.3 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0014 - Staff Kitchen (15.22 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B006/R0012/Floor Coverings Res/Textile/S7					<b>Chrysotile (white asbestos)</b>
<b>B006 - R0015 - Staff Study (19.75 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R0016 - Staff - Toilet (4.17 m2)</b>						
No Asbestos						
<b>B006 - R0017 - Computer Room (14.95 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R0018 - Entry (18.77 m2)</b>						
No Asbestos						
<b>B006 - R0019 - Movement (138.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	139m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R0020 - Stairs (7.32 m2)</b>						
No Asbestos						
<b>B006 - R0021 - Stairs (7.42 m2)</b>						
No Asbestos						
<b>B006 - R0022 - External Movement (5.8 m2)</b>						
No Asbestos						
<b>B006 - R0023 - External Movement (3.09 m2)</b>						
No Asbestos						
<b>B006 - R0024 - Staff Study (14.83 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R0025 - External Movement (6.03 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B006 - R1001 - Movement (120.76 m2)</b>						
No Asbestos						
<b>B006 - R1002 - General Learning Space (48.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R1003 - General Learning Space (49.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R1004 - Computer Learning Space (50.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R1005 - General Learning Space (49.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R1006 - General Learning Space (49.02 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B006 - R1007 - General Storeroom (9.89 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1008 - Staff Study (26.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1009 - General Learning Space (45.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1010 - Staff Study (71.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1011 - Cleaning Store - Distributed (7.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1012 - Staff - Toilet (2.99 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R1013 - Stairs (11.4 m2)</b>						
No Asbestos						
<b>B006 - R1014 - Stairs (12.82 m2)</b>						
No Asbestos						
<b>B006 - R2001 - Staff Toilet (4.13 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2002 - Movement (2.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2003 - General Storeroom (3.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2004 - General Storeroom (10.62 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2005 - General Learning Space (49.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2006 - General Learning Space (49.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2007 - Special Learning Space (50.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B006/R0012/Floor Coverings Res/Textile/S7				<b>Chrysotile (white asbestos)</b>		
<b>B006 - R2008 - General Learning Space (50.78 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2009 - Art Learning Space-I.E.C. (50.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2010 - Movement (111.45 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2011 - Resources Store (10.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8320/B006/R0012/Floor Coverings Res/Textile/S7	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2012 - General Storeroom (32.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2013 - Special Learning Space (41.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2014 - General Learning Space-I.E.C. (30.62 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2015 - Special Learning Space (40.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8320/B006/R0012/Floor Coverings Res/Textile/S7	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B006 - R2016 - Stairs (11.99 m2)</b>						
No Asbestos						
<b>B006 - R2017 - Stairs (12.96 m2)</b>						
No Asbestos						
<b>B006 - R9001 - Garden Store Room (9.13 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B007 - Administration/Various - 1979 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height restricted 8 m</b>						
Ceiling Voids	Non Accessible Area - Height restricted 3m					
Underfloor Voids	No Asbestos Found					

**Interior****B007 - R0001 - Duplicating Workroom (26.72 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0002 - General Storeroom (13.31 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4						<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0003 - Administration - Clerical (34.29 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0004 - Movement (20.55 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0005 - Staff - Toilet (3.74 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0006 - Staff - Toilet (4.05 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0007 - Ancillary Staff (24.45 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0008 - Movement (12.98 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0009 - Distribution Board Cupboard (1.41 m2)**

Electrical Backing Board	Resinous Board	3Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1020/Electrical Backing Board/S26						<b>Chrysotile (white asbestos)</b>

Note: No inspection of live electrical installation.

**B007 - R0010 - Principal Office (20.71 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8320/B007/R0014/Ceiling Structures/Linings/S5						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B007 - R0011 - Cleaning Store - Distributed (4.61 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B007 - R0012 - Movement (38.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0013 - General Storeroom (14.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0014 - Clinic - Boys (14.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0015 - Clinic-Toilets (3.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0016 - Duplicating Workroom (11.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0017 - Staff - Toilet (3.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0018 - Deputy Principal Office (15.75 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8320/B007/R0014/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B007 - R0019 - Gymnasium (287.36 m2)</b>						
No Asbestos						
<b>B007 - R0020 - Stage (58.77 m2)</b>						
No Asbestos						
<b>B007 - R0021 - Distribution Board Cupboard (0.58 m2)</b>						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Sealed unit &amp; live</i>						
<b>B007 - R0022 - Movement (21.07 m2)</b>						
No Asbestos						
<b>B007 - R0023 - Sport Equipment Store (52.44 m2)</b>						
No Asbestos						
<b>B007 - R0024 - External Movement (190.46 m2)</b>						
No Asbestos						
<b>B007 - R0025 - Cleaning Supplies Store (2.93 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Fire door frame	Encapsulated Insulation material within unit 8320/B007/R0026/Fire door frame/S27					No Asbestos Detected
<b>B007 - R0026 - Cleaning Supplies Store (9.1 m2)</b>						
Fire door frame	Encapsulated Insulation material within unit 8320/B007/R0026/Fire door frame/S27					No Asbestos Detected
<b>B007 - R0027 - Maintenance Bulk Store (4.71 m2)</b>						
No Asbestos						
<b>B007 - R0028 - Distribution Board Cupboard (0.55 m2)</b>					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	3Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1020/Electrical Backing Board/S26					Chrysotile (white asbestos)	
<b>B007 - R0029 - Garden Store Room (12.83 m2)</b>						
No Asbestos						
<b>B007 - R0030 - Student Canteen (67.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B007 - R0031 - Staff - Toilet (7.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B007 - R0032 - External Movement (24.29 m2)</b>						
No Asbestos						
<b>B007 - R0033 - External Stairs (14.3 m2)</b>						
No Asbestos						
<b>B007 - R0034 - Stairs (4.76 m2)</b>						
No Asbestos						
<b>B007 - R0035 - External Movement (1.59 m2)</b>						
No Asbestos						
<b>B007 - R0036 - External Movement (70.21 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B007 - R1001 - Commonroom (122.61 m2)</b>						
No Asbestos						
<b>B007 - R1002 - Staff Study (11.9 m2)</b>						
No Asbestos						
<b>B007 - R1003 - Interview/Office - Type 1 (11.82 m2)</b>						
No Asbestos						
<b>B007 - R1004 - Interview/Office - Type 1 (11.76 m2)</b>						
No Asbestos						
<b>B007 - R1005 - Staff - Toilet (5.12 m2)</b>						
No Asbestos						
<b>B007 - R1006 - Staff - Toilet (5.13 m2)</b>						
No Asbestos						
<b>B007 - R1007 - General Storeroom (21.75 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B007 - R1008 - Movement (34.33 m2)</b>						
No Asbestos						
<b>B007 - R1009 - Careers Advisers Office (34.32 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
<b>B007 - R1010 - Distribution Board Cupboard (0.58 m2)</b>				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1020/Electrical Backing Board/S26				Chrysotile (white asbestos)		
<b>B007 - R1011 - Cleaning Store - Distributed (4.68 m2)</b>						
No Asbestos						
<b>B007 - R1012 - External Movement (26.84 m2)</b>						
No Asbestos						
<b>B007 - R1013 - Movement (62.11 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	63m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
<b>B007 - R1014 - Shower/Change (43.42 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1022/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)		
<b>B007 - R1015 - Toilets-Girls (38.69 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1022/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)		
<b>B007 - R1016 - Shower/Change (36.59 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3.m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1022/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)		
<b>B007 - R1017 - Staff Study (7.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
<b>B007 - R1018 - Staff Study (9.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R0014/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)		
<b>B007 - R1019 - Cleaning Store - Distributed (6.16 m2)</b>						
No Asbestos						
<b>B007 - R1020 - Distribution Board Cupboard (0.53 m2)</b>				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1020/Electrical Backing Board/S26				Chrysotile (white asbestos)		
<b>B007 - R1021 - Shower/Change (43.57 m2)</b>						
No Asbestos						
<b>B007 - R1022 - Toilets-Girls (36.23 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8320/B007/R1022/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)		
<b>B007 - R1023 - Shower/Change (46.74 m2)</b>						
No Asbestos						
<b>B007 - R1024 - External Movement (4.95 m2)</b>						
No Asbestos						
<b>B007 - R1025 - External Movement (6.36 m2)</b>						
No Asbestos						
<b>B007 - R1026 - External Movement (1.66 m2)</b>						
No Asbestos						
<b>B007 - R1027 - External Stairs (18.6 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B007 - R1028 - Stairs (10.25 m2)**

No Asbestos

**B007 - R2001 - Staff Study (28.44 m2)**

No Asbestos

**B007 - R2002 - Cleaning Store - Distributed (4.05 m2)**

No Asbestos

**B007 - R2003 - General Learning Space (53.08 m2)**

No Asbestos

**B007 - R2004 - General Learning Space (54.04 m2)**

No Asbestos

**B007 - R2005 - General Learning Space (51.03 m2)**

No Asbestos

**B007 - R2006 - General Learning Space (52.15 m2)**

No Asbestos

**B007 - R2007 - General Learning Space (51.07 m2)**

No Asbestos

**B007 - R2008 - Distribution Board Cupboard (0.77 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8320/B007/R2008/Ceiling Structures/Linings/S28

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

Electrical Backing Board Resinous Board 2Unit South Good Condition (1) Low (1) Low Priority (2-3)

8320/B007/R1020/Electrical Backing Board/S26

**Chrysotile (white asbestos)****B007 - R2009 - Movement (49.4 m2)**

No Asbestos

**B007 - R2010 - External Movement (10.34 m2)**

Ceiling Structures/Linings Flat AC Sheeting 4m2 Doorway ceiling Good Condition (1) Low (1) Low Priority (2-3)

8320/B007/R2008/Ceiling Structures/Linings/S28

**Chrysotile (white asbestos) , Amosite (brown asbestos)****B007 - R2011 - External Stairs (19.41 m2)**

No Asbestos

**B007 - R2012 - External Movement (10.13 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D11317 - Learning Unit - Standard/Withdrawal : Placement Date - 29/01/2010**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - General Learning Space**

No Asbestos Found.

**R3 - Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017