


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Killarney Heights High School (8422)
Region : Northern Sydney
State Electorate : Wakehurst
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 23 - Jan - 2008
Reviewed By : AECOM : 07 - Oct - 2014

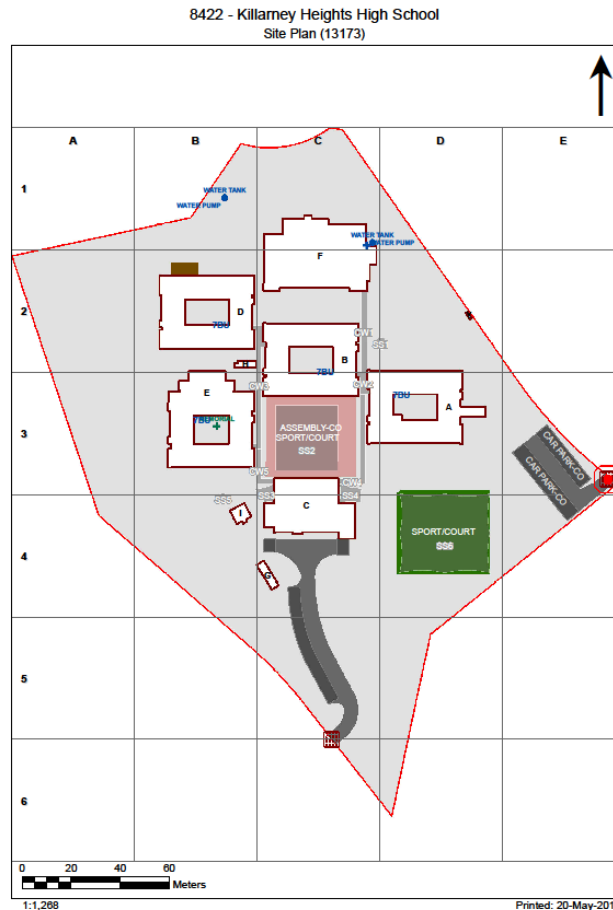

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning/Science Learning - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Ceiling voids accessed through electrical distribution board (EDB) cupboards. No safe access available due to electrical hazard and confined nature of entry point. Space in ceiling void is limited due to flat roof.
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground.

Interior

B00A - R0001 - Staff - Toilet (2.84 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0002 - General Storeroom (1.18 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0015/Wall Linings Internal/S7						Chrysotile (white asbestos)

B00A - R0007 - Interview/Office - Type 1 (12.64 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0008 - Public Reception (39.2 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0009 - Movement (3.38 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0010 - Staff - Toilet (4.37 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0011 - Staff - Toilet (4.37 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0012 - Movement (8.32 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0013 - Administration - Clerical (23.68 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0014 - Principal Office (19.23 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00A - R0015 - Resources Store (2.96 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - Staff - Toilet (2.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00A - R0021 - General Learning Space (58.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0022 - Cleaning Store - Distributed (2.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0025 - General Learning Space (52.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0026 - Resources Store (11.64 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0028 - Resources Store (25.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0031 - Preparation - Science (30.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Fume Cupboard	Flat AC Sheeting	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0008/Fume Cupboard/S5					Chrysotile (white asbestos)
B00A - R0032 - Performance Workshop (85.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0034 - Lift (1.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0036 - Student Waiting (10.5 m2)						
No Asbestos						
B00A - R0037 - Deputy Principal Office (15.22 m2)						
Sound damper / condensate barrier beneath sink (if present)	Bituminous coating	1Unit	Sink	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - No access - area is generally covered
B00A - R0038 - Deputy Principal Office (15.92 m2)						
No Asbestos						
B00A - R0039 - Movement (3.23 m2)						
Bitumastic between precast wall panels	Mastic					No Asbestos Detected
	8422/B00A/R0039/Bitumastic between precast wall panels/S12					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8422/B00D/R0010/Floor Coverings Res/Textile/S6	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00A - R0040 - Leading Teacher (12.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8422/B00D/R0010/Floor Coverings Res/Textile/S6	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Window sealant	Mastic 8422/B00A/R0040/Window sealant/S13					No Asbestos Detected
B00A - R0042 - Printing/Photocopying (10.39 m2)						
Window sealant	Mastic 8422/B00A/R0040/Window sealant/S13					No Asbestos Detected
B00A - R0043 - External Stairs (2.76 m2)						
No Asbestos						
B00A - R0044 - External Stairs (2.41 m2)						
No Asbestos						
B00A - R0045 - Clinic (11.51 m2)						
Sound damper / condensate barrier beneath sink (if present)	Bituminous coating	1Unit	Below sink	Good Condition (1)	Low (1)	Low Priority (2-3)
					Assumed Asbestos - No access – Area is generally covered	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8422/B00D/R0010/Floor Coverings Res/Textile/S6	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Bitumastic between pre-cast wall panels.	Mastic 8422/B00A/R0040/Window sealant/S13					No Asbestos Detected
B00A - R0046 - Computer Learning Space (52.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8422/B00D/R0010/Floor Coverings Res/Textile/S6	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Window sealant	Mastic 8422/B00A/R0040/Window sealant/S13					No Asbestos Detected
B00A - R0049 - Administration - Clerical (27.15 m2)						
No Asbestos						
B00A - R0050 - Tea Room (4.08 m2)						
No Asbestos						
B00A - R0051 - General Storeroom (8.23 m2)						
No Asbestos						
B00A - R0052 - Toilet - Lobby (4.83 m2)						
No Asbestos						
B00A - R0053 - Toilets-Disabled (3.99 m2)						
No Asbestos						
B00A - R0054 - Access Student Shower/Toilet/Change (16.58 m2)						
No Asbestos						
B00A - R0055 - Laboratory L.S. (93.13 m2)						
No Asbestos						
B00A - R0056 - Handwashing Facilities (0.17 m2)						
No Asbestos						
B00A - R0057 - Cleaning Supplies Store (17.81 m2)						
No Asbestos						
B00A - R0058 - Performance Store (7.38 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0059 - External Movement (158.97 m2)						
No Asbestos						
B00A - R0060 - Plant (0.22 m2)						
No Asbestos						
B00A - R1001 - Staff - Toilet (2.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Distribution Board Cupboard (1.11 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - General Learning Space (52.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Resources Store (5.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00A - R1005 - Interview/Office - Type 1 (12.7 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - General Learning Space (58.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Resources Store (6.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Computer Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - Computer Room (5.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - General Learning Space (65.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - Resources Store (6.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R1012 - Resources Store (2.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R1013 - Textiles Technology L.S. (71.74 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1014 - Resources Store (2.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R1015 - Performance Store (2.79 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1016 - Distribution Board Cupboard (1.21 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1017 - General Learning Space (52.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1018 - Resources Store (5.8 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1019 - Resources Store (5.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00A - R1021 - Art Learning Space (52.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R1022 - General Learning Space (52.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8422/B00D/R0013/Ceiling Structures/Linings/S4				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1024 - External Movement (169.86 m2)						
No Asbestos						
B00A - R1026 - External Stairs (6.05 m2)						
No Asbestos						
B00A - R1027 - External Stairs (6.14 m2)						
No Asbestos						
B00A - R1028 - Darkroom Space (6.59 m2)						
No Asbestos						
B00A - R1029 - Dark Room (20.23 m2)						
No Asbestos						
B00A - R1030 - Commonroom (123.1 m2)						
No Asbestos						
B00A - R1031 - Staff Kitchen (13 m2)						
No Asbestos						
B00A - R1032 - Chair Store (1.79 m2)						
No Asbestos						
B00A - R1033 - Handwashing Facilities (0.16 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Music/Art - 1967 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Ceiling voids accessed through electrical distribution board (EDB) cupboards. No safe access available due to electrical hazard and confined nature of entry point. Space in ceiling void is limited due to flat roof.
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground.

Interior**B00B - R0001 - General Storeroom (2.8 m2)**

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0004 - Music Learning Space (52.51 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0005 - Music Store (5.91 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0006 - Resources Store (5.6 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0008 - Metal Technology Bay (39.2 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0009 - Materials Technology L.S. (92.73 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0010 - Design/Technology L.S. (58.37 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00B/R0010/Ceiling Structures/Linings/S10						Chrysotile (white asbestos)
Flue pipe	Fibre Cement Pipe	1m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00B/R0010/Flue pipe/S11						Chrysotile (white asbestos)

B00B - R0011 - Staff - Toilet (2.79 m2)

No Asbestos

B00B - R0015 - General Storeroom (6.04 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00B - R0016 - Design L.S. (51.85 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0017 - Resources Store (6.22 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0020 - Food Technology L.S. (65.86 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0021 - Preparation - Materials (12.68 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0022 - Pantry (12.71 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0025 - Resources Store (3.6 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0027 - Laundry (3.6 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0029 - External Stairs (2.76 m2)						
Expansion gap mastic	Mastic	8422/B00E/R0027/Expansion gap material/S14			No Asbestos Detected	
B00B - R0030 - External Stairs (2.46 m2)						
Expansion gap mastic	Mastic	8422/B00E/R0027/Expansion gap material/S14			No Asbestos Detected	
B00B - R0031 - General Storeroom (8.19 m2)						
No Asbestos						
B00B - R0032 - Class Tools Storage (12.4 m2)						
No Asbestos						
B00B - R0033 - Food Technology L.S. (117.48 m2)						
No Asbestos						
B00B - R0034 - Staff Study (40.93 m2)						
No Asbestos						
B00B - R0035 - Tea Room (3.84 m2)						
No Asbestos						
B00B - R0036 - Metal Technology L.S. (77.21 m2)						
No Asbestos						
B00B - R0037 - Welding Area (7.78 m2)						
No Asbestos						
B00B - R0038 - Handwashing Facilities (0.16 m2)						
No Asbestos						
B00B - R0039 - General Storeroom (7.82 m2)						
No Asbestos						
B00B - R0040 - External Movement (177.26 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R1001 - Cleaning Store - Distributed (2.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - Distribution Board Cupboard (1.19 m2)						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00B - R1003 - Music Learning Space (51.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1004 - Music Store (5.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Resources Store (5.61 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Wood Technology L.S. (85.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00B - R1008 - Wood Technology Bay (33.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1009 - Wood Technology L.S. (79.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1010 - Design L.S. (58.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1011 - Staff - Toilet (2.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - Distribution Board Cupboard (1.13 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Music Learning Space (52.66 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1014 - Resources Store (11.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1016 - Resources Store (12.38 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1018 - Resources Store (11.44 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1019 - Kiln Space (27.13 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1021 - Resources Store (6.16 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8422/B00D/R0010/Floor Coverings Res/Textile/S6	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R1022 - Art Learning Space (71.84 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8422/B00D/R0010/Floor Coverings Res/Textile/S6	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R1023 - Resources Store (6.14 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1024 - External Movement (175.94 m2)						
No Asbestos						
B00B - R1025 - External Stairs (6.11 m2)						
No Asbestos						
B00B - R1026 - External Stairs (6.07 m2)						
No Asbestos						
B00B - R1027 - Project Store - Type 1 (4.76 m2)						
No Asbestos						
B00B - R1028 - Project Store - Type 1 (4.34 m2)						
No Asbestos						
B00B - R1029 - Dust Extraction Space (5.99 m2)						
No Asbestos						
B00B - R1030 - Staff Study (29.58 m2)						
No Asbestos						
B00B - R1031 - Tea Room (1.91 m2)						
No Asbestos						
B00B - R1032 - Handwashing Facilities (0.16 m2)						
No Asbestos						
B00B - R1033 - Art Learning Space (106.26 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Physical Education - 1967 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof Non Accessible Area
 - Ceiling void generally inaccessible due to fixed ceilings, height and absence of designated entry points. No asbestos identified in ceiling void of CR0022 Movement however minimal access was available due to depth of void and services.

Underfloor Voids - Slab on Ground Non Accessible Area
 - Slab on ground.

Interior**B00C - R0001 - General Storeroom (10.75 m2)**

No Asbestos

B00C - R0003 - Main Switchroom (11.2 m2)

Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00C - R0004 - Class Tools Storage (12.92 m2)**

No Asbestos

B00C - R0005 - General Storeroom (6.16 m2)

No Asbestos

B00C - R0006 - Multi-Purpose Space (316.85 m2)

No Asbestos

B00C - R0008 - Student Canteen (56.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00C - R0009 - Pantry (2.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00C - R0010 - Staff - Toilet (3.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00C - R0011 - Distribution Board Cupboard (0.56 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)	

B00C - R0012 - Materials Store (13.29 m2)

No Asbestos

B00C - R0013 - Sport Equipment Store (14.39 m2)

No Asbestos

B00C - R0014 - Sport Equipment Store (21.3 m2)

No Asbestos

B00C - R0015 - Movement (14.12 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0016 - Cleaning Store - Distributed (1.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00C - R0017 - Staff - Toilet (4.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00C - R0018 - Sport Equipment Store (10.67 m2)						
No Asbestos						
B00C - R0019 - General Storeroom (11.17 m2)						
No Asbestos						
B00C - R0020 - External Movement (53.09 m2)						
No Asbestos						
B00C - R0021 - Movement (14.01 m2)						
No Asbestos						
B00C - R0022 - Movement (3.89 m2)						
No Asbestos						
B00C - R0023 - Movement (10.36 m2)						
No Asbestos						
B00C - R0024 - Stairs (3.88 m2)						
No Asbestos						
B00C - R0025 - Stairs (3.82 m2)						
No Asbestos						
B00C - R0026 - External Movement (53.42 m2)						
No Asbestos						
B00C - R0027 - Movement (10.98 m2)						
No Asbestos						
B00C - R0028 - Class Tools Storage (2.91 m2)						
No Asbestos						
B00C - R1001 - General Storeroom (11.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00C - R1002 - Staff Shower (6.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00C - R1003 - General Storeroom (1.16 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)	
B00C - R1005 - Change (38.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No**Test Result**

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1005/Partition Walls (Cubicles)/S2						Chrysotile (white asbestos)

B00C - R1006 - Movement (12.21 m2)

No Asbestos

B00C - R1007 - General Storeroom (11.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1						Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6						Chrysotile (white asbestos)

B00C - R1008 - Staff Shower (6.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1010/Ceiling Structures/Linings/S1						Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6						Chrysotile (white asbestos)

B00C - R1009 - General Storeroom (1.16 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0015/Wall Linings Internal/S7						Chrysotile (white asbestos)

B00C - R1012 - Movement (12.22 m2)

No Asbestos

B00C - R1013 - Stairs (15.4 m2)

Black window sealant	Mastic					No Asbestos Detected
8422/B00A/R0040/Window sealant/S13						

B00C - R1014 - Stairs (15.37 m2)

Black window sealant	Mastic					No Asbestos Detected
8422/B00E/R0027/Expansion gap material/S14						

B00C - R1015 - Change (34.17 m2)

No Asbestos

B00C - R1016 - Plant (4.21 m2)

No Asbestos

B00C - R1017 - Toilets-Girls (34.16 m2)

No Asbestos

B00C - R1018 - Plant (4.21 m2)

No Asbestos

B00C - R1019 - Toilets-Boys (34.19 m2)

No Asbestos

B00C - R1020 - Plant (4.21 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Science Learning - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Ceiling voids accessed through electrical distribution board (EDB) cupboards. No safe access available due to electrical hazard and confined nature of entry point. Space in ceiling void is limited due to flat roof.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground.					

Interior

B00D - R0001 - Staff - Toilet (2.79 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0004 - General Learning Space (52.65 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0005 - Resources Store (11.57 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0006 - Toilets-Boys (40 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1005/Partition Walls (Cubicles)/S2						Chrysotile (white asbestos)

B00D - R0007 - Chemical Store (25.78 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0008 - Laboratory L.S. (92.67 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Fume Cupboard	Flat AC Sheeting	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0008/Fume Cupboard/S5						Chrysotile (white asbestos)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R0009 - Resources Store (5.88 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6						Chrysotile (white asbestos)

B00D - R0010 - Preparation - Science (19.15 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00D - R0013 - Toilets-Girls (40.06 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00C/R1005/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0014 - Cleaning Store - Distributed (2.79 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0017 - General Learning Space (52.51 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0020 - General Learning Space (58.43 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0021 - Laboratory L.S. (91.66 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Fume Cupboard	Flat AC Sheeting	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0008/Fume Cupboard/S5				Chrysotile (white asbestos)		
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0024 - Laboratory L.S. (85.39 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Fume Cupboard	Flat AC Sheeting	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0008/Fume Cupboard/S5				Chrysotile (white asbestos)		
Thermacon Heater	Encapsulated Insulation material within unit	3Unit	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0027 - External Stairs (3.07 m2)						
Expansion gap mastic	Mastic					
8422/B00E/R0027/Expansion gap material/S14				No Asbestos Detected		
B00D - R0028 - External Stairs (2.31 m2)						
No Asbestos						
B00D - R0029 - Staff Study (36.01 m2)						
No Asbestos						
B00D - R0030 - Tea Room (3.13 m2)						
No Asbestos						
B00D - R0031 - General Storeroom (8.2 m2)						
No Asbestos						
B00D - R0032 - General Storeroom (18.58 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0033 - Preparation - Science (39.27 m2)						
No Asbestos						
B00D - R0034 - Cleaning Supplies Store (8.3 m2)						
No Asbestos						
B00D - R0035 - Handwashing Facilities (0.16 m2)						
No Asbestos						
B00D - R0036 - External Movement (170.39 m2)						
No Asbestos						
B00D - R1001 - Staff - Toilet (2.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R1001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00D - R1002 - Distribution Board Cupboard (1.15 m2)						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R1003 - General Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1004 - General Storeroom (11.79 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1005 - General Learning Space (58.36 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1006 - General Learning Space (52.58 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1007 - Multi Media Workshop (11.53 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1008 - Staff Study (25.89 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1009 - Staff Study (12.64 m2)						
Ceiling Structures/Linings	Vermiculite					
8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8422/B00D/R0010/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00D - R1011 - Resources Store (12.36 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1012 - Computer Room (12.52 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8422/B00D/R0010/Floor Coverings Res/Textile/S6	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1013 - Computer Learning Space (58.21 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1014 - General Storeroom (2.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8422/B00D/R1001/Ceiling Structures/Linings/S8	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1015 - Distribution Board Cupboard (1.3 m2) Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting 8422/B00D/R0015/Wall Linings Internal/S7	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board 1Unit	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1016 - General Learning Space (52.51 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1017 - Resources Store (5.68 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1018 - Office/Store (13.03 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1019 - General Learning Space (58.43 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1020 - General Learning Space (52.8 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1021 - General Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1022 - Resources Store (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1024 - Resources Store (12.43 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8422/B00D/R0010/Floor Coverings Res/Textile/S6	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R1025 - General Learning Space (58.36 m2)

Ceiling Structures/Linings	Vermiculite 8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8422/B00D/R0010/Floor Coverings Res/Textile/S6	1m2	Door entry	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R1026 - External Movement (169.25 m2)

No Asbestos

B00D - R1027 - External Stairs (5.98 m2)

No Asbestos

B00D - R1028 - External Stairs (6.12 m2)

No Asbestos

B00D - R1029 - Handwashing Facilities (0.16 m2)

No Asbestos

B00D - R1030 - Tea Room (4.08 m2)

No Asbestos

B00D - R1031 - Staff Study (21.48 m2)

No Asbestos

B00D - R1032 - Tea Room (5.82 m2)

No Asbestos

B00D - R1033 - Staff Study (19.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/General Learning/Science Learning - 1994 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Ceiling voids accessed through electrical distribution board (EDB) cupboards. No safe access available due to electrical hazard and confined nature of entry point. Space in ceiling void is limited due to flat roof.
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground.

Interior**B00E - R0001 - Other-Vacant (0.52 m2)**

No Asbestos

B00E - R0002 - Plant (0.44 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)
Electrical pipework	Fibre Cement Pipe					No Asbestos Detected
	8422/B00E/R0014/Electrical pipework/S9					

B00E - R0003 - Staff - Toilet (10.85 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	8422/B00D/R0013/Ceiling Structures/Linings/S4					
Partition Walls (Cubicles)	Compressed AC Sheet	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00C/R1005/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Ceiling Structures/Linings	Vermiculite	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00C/R1005/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00E - R0004 - Cleaning Store - Distributed (2.68 m2)

No Asbestos

B00E - R0005 - General Storeroom (5.34 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0006 - General Learning Space (49.7 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0007 - General Learning Space (57.95 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0009 - Staff Study (20.02 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0010 - Resources Store (12.01 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0011 - Printing/Photocopying (25.57 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0015 - General Assistants (10.73 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0016 - General Assistants (2.69 m2)						
No Asbestos						
B00E - R0017 - Resources Store (18.1 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0018 - Main Area (51.79 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0021 - Librarian (12.68 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0023 - System Administrators Office (24.56 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0024 - General Storeroom (7.91 m2)						
Ceiling Structures/Linings	Vermiculite	8422/B00D/R0013/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0026 - Resources Store (6.62 m2)						
No Asbestos						
B00E - R0027 - External Movement (165.88 m2)						
Expansion gap material	Mastic	8422/B00A/R0039/Bitumastic between precast wall panels/S12				No Asbestos Detected
Expansion gap material	Mastic	8422/B00E/R0027/Expansion gap material/S14				No Asbestos Detected
B00E - R0028 - External Stairs (4.61 m2)						
Expansion gap mastic	Mastic	8422/B00A/R0039/Bitumastic between precast wall panels/S12				No Asbestos Detected
B00E - R0029 - External Stairs (4.72 m2)						
Expansion gap mastic	Mastic	8422/B00A/R0039/Bitumastic between precast wall panels/S12				No Asbestos Detected
B00E - R0030 - Senior Study (14.75 m2)						
No Asbestos						
B00E - R0031 - Senior Study (15.95 m2)						
No Asbestos						
B00E - R0033 - Tea Room (7.04 m2)						
No Asbestos						
B00E - R0034 - Staff Study (18.28 m2)						
No Asbestos						
B00E - R0035 - Commonroom (84.99 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0036 - Staff Kitchen (12.52 m2)						
No Asbestos						
B00E - R0037 - Library Administration (27.15 m2)						
No Asbestos						
B00E - R0038 - Tea Room (2.61 m2)						
No Asbestos						
B00E - R0039 - Main Entry (5.65 m2)						
No Asbestos						
B00E - R0040 - Main Area (288.54 m2)						
No Asbestos						
B00E - R0041 - General Assistants (4.77 m2)						
No Asbestos						
B00E - R1001 - Staff - Toilet (2.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1002 - Handwashing Facilities (0.44 m2)						
No Asbestos						
B00E - R1003 - Distribution Board Cupboard (0.73 m2)						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R1004 - General Learning Space (50.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1005 - Resources Store (10.34 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1007 - Fitness Laboratory (92.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1008 - Resources Store (12.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1009 - Preparation - Science (22.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1010 - Chemical Store (2.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1011 - Laboratory L.S. (84.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1012 - Staff - Toilet (2.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1013 - Handwashing Facilities (0.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1014 - Distribution Board Cupboard (0.67 m2)						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8422/B00D/R0015/Wall Linings Internal/S7					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00E - R1015 - General Learning Space (50.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1016 - Resources Store (5.49 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1018 - General Learning Space (57.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1019 - General Learning Space (52.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1020 - General Learning Space (52.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1022 - Computer Learning Space (57.95 m2)						
Ceiling Structures/Linings	Vermiculite					
	8422/B00D/R0013/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1024 - External Stairs (7.63 m2)						
Expansion gap mastic	Mastic					
	8422/B00A/R0039/Bitumastic between precast wall panels/S12					No Asbestos Detected
B00E - R1025 - External Stairs (7.64 m2)						
Expansion gap mastic	Mastic					
	8422/B00A/R0039/Bitumastic between precast wall panels/S12					No Asbestos Detected
B00E - R1026 - Tea Room (5.81 m2)						
No Asbestos						
B00E - R1027 - Staff Study (25.04 m2)						
No Asbestos						
B00E - R1028 - Tea Room (4.98 m2)						
No Asbestos						
B00E - R1029 - Staff Study (20.45 m2)						
No Asbestos						
B00E - R1030 - Resources Store (3.43 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R1031 - Careers Advisers Office (12.82 m2)

No Asbestos

B00E - R1032 - External Movement (167.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Multi Purpose Facilities - 2002 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00F - R0001 - Movement (68.53 m2)**

No Asbestos

B00F - R0002 - Multi-Purpose Space (494.56 m2)

No Asbestos

B00F - R0003 - Sport Equipment Store (20.49 m2)

No Asbestos

B00F - R0004 - General Storeroom (25.41 m2)

No Asbestos

B00F - R0005 - General Storeroom (25.41 m2)

No Asbestos

B00F - R0006 - Chair Store (21.91 m2)

No Asbestos

B00F - R0007 - Movement (10.22 m2)

No Asbestos

B00F - R0008 - General Storeroom (4.5 m2)

No Asbestos

B00F - R0009 - Stage (109.79 m2)

No Asbestos

B00F - R0010 - Movement (9.85 m2)

No Asbestos

B00F - R0012 - Lift (1.98 m2)

No Asbestos

B00F - R0013 - Staff - Toilet (9.22 m2)

No Asbestos

B00F - R0015 - Distribution Board Cupboard (0.74 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0016 - Movement (25.27 m2)

No Asbestos

B00F - R0017 - Cleaning Store - Distributed (2.65 m2)

No Asbestos

B00F - R0020 - Office/Store (12.76 m2)

No Asbestos

B00F - R0021 - Staff Kitchen (7.42 m2)

No Asbestos

B00F - R0022 - Access Student Shower/Toilet/Change (4.73 m2)

No Asbestos

B00F - R0023 - Movement (10.47 m2)

No Asbestos

B00F - R0024 - Control Room (1 m2)

No Asbestos

B00F - R0025 - External Movement (119.32 m2)

No Asbestos

B00F - R0026 - Toilets-Girls (6.97 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0027 - Change (18.56 m2)						
No Asbestos						
B00F - R0028 - Change (20.12 m2)						
No Asbestos						
B00F - R0029 - Toilets-Boys (6.25 m2)						
No Asbestos						
B00F - R0030 - Toilet - Lobby (1.96 m2)						
No Asbestos						
B00F - R0031 - Toilets-Boys (19.49 m2)						
No Asbestos						
B00F - R0032 - Toilet - Lobby (1.96 m2)						
No Asbestos						
B00F - R0033 - Toilets-Girls (24.77 m2)						
No Asbestos						
B00F - R9001 - Practice/Seminar (114.98 m2)						
Vinyl Tiles (Under Floor No Asbestos Found Covering/Carpet)						
B00F - R9002 - External Movement (4.82 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Student Services - 2008 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof Non Accessible Area
 - No access due to fixed ceiling throughout.

Underfloor Voids Non Accessible Area
 - No designated access points identified.

Interior

B00G - R0001 - External Movement (5.63 m2)

No Asbestos

B00G - R0002 - Uniform Shop (26.26 m2)

No Asbestos

B00G - R0003 - Uniform Shop (6.06 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Student Services - 2009 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00H - R0001 - External Movement (7.93 m2)

No Asbestos

B00H - R0002 - Movement (4.62 m2)

No Asbestos

B00H - R0003 - Lift (2.27 m2)

No Asbestos

B00H - R0004 - External Movement (2.09 m2)

No Asbestos

B00H - R1001 - External Movement (7.9 m2)

No Asbestos

B00H - R1002 - Movement (4.57 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Storage - 2012 - Timber (Timber)

Exterior

No Asbestos

Interior

B00I - R0001 - General Storeroom (38.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - Building Services - 2012 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00Y - R0001 - Plant (2.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 2012 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00Z - R0001 - Plant (2.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Timber shed

Exterior

No Asbestos

Interior

Build+1 - Room+1 - R0001

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017