


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kotara High School (8423)
Region : Hunter/Central Coast
State Electorate : Charlestown
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 02 - Apr - 2008
Reviewed By : Greencap-NAA : 10 - Feb - 2015

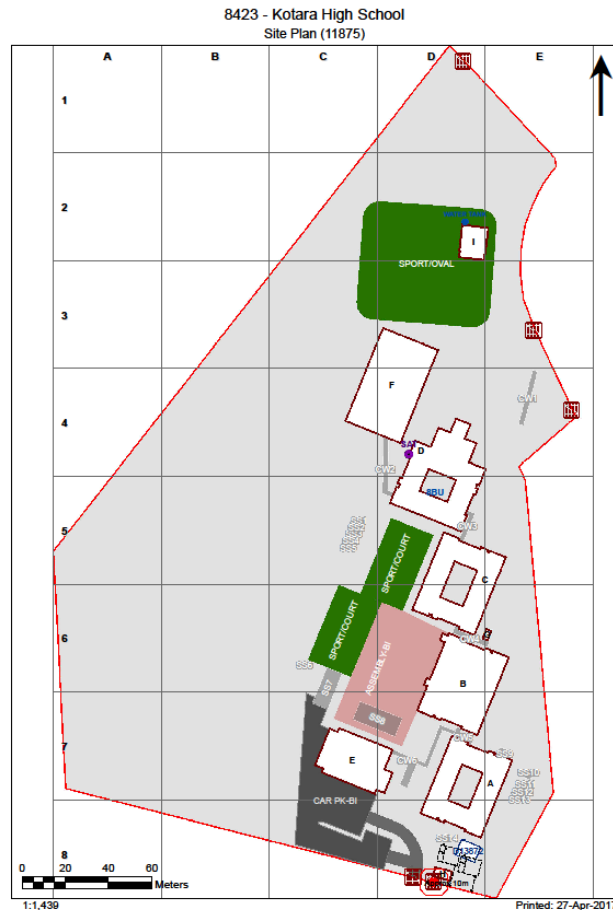

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Various - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall mastic	Mastic 8423/B00A/Wall mastic/S14					No Asbestos Detected

Interior**B00A - R0001 - General Learning Space (58.77 m2)**

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0001/Floor Coverings Res/Textile/S11	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8423/B00A/R0001/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00A - R0002 - Staff Study (39.52 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0003 - Movement (9.21 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00A - R0004 - Staff - Toilet (3.13 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00A - R0005 - Ancillary Staff (12.4 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00A - R0006 - Clinic - Boys (13.29 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0007 - Duplicating Workroom (8.04 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0008 - Deputy Principal Office (17.64 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0009 - Deputy Principal Office (13.19 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0010 - Principal Office (20.63 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0011 - General Storeroom (2.94 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Safe	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0012 - Staff - Toilet (4.4 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0013 - Entry (2.93 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0014 - Staff - Toilet (4.4 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0015 - Clinic - Girls (16.12 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0016 - Interview (15.05 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0017 - Movement (47.24 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0020 - Staff - Toilet (2.92 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0023 - Laboratory L.S. (85.78 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Top of bench	Compressed AC Sheet 8423/B00A/R0023/Top of bench/S13	1Unit	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
Fume Cupboard	Flat AC Sheeting 8423/B00C/R0015/Fume Cupboard/S5	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00A - R0024 - Growing/Breeding (8.94 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0025 - Preparation (29.71 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0026 - Laboratory L.S. (93.42 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0027 - Apparatus Store (25.56 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	26m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0028 - Toilets-Boys (26.16 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8423/B00D/R0010/Wall Linings Internal/S4	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0029 - Cleaning Store - Distributed (11.53 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0030 - General Learning Space (53.11 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0031 - Cleaning Store - Distributed (2.84 m2)						
No Asbestos						
B00A - R0032 - General Storeroom (1.2 m2)						
No Asbestos						
B00A - R0033 - General Storeroom (1.7 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0035 - Stairs (3.72 m2)						
No Asbestos						
B00A - R0036 - Stairs (4.05 m2)						
No Asbestos						
B00A - R0037 - General Storeroom (5.8 m2)						
Recently Modified Space Requires Inspection						
B00A - R0038 - Movement (170.46 m2)						
Recently Modified Space Requires Inspection						
B00A - R0039 - Administration - Clerical (60.65 m2)						
Recently Modified Space Requires Inspection						
B00A - R0040 - Staff Kitchen (2.82 m2)						
Recently Modified Space Requires Inspection						
B00A - R1001 - Textiles Technology L.S. (78.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Materials Store (6.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R1003 - Computer Learning Space (66.26 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R1005 - Computer Store (6.22 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R1007 - Computer Learning Space (58.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R1008 - Computer Resource (13.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00A - R1009 - General Storeroom (5.58 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1010 - General Learning Space (52.09 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1011 - Staff - Toilet (2.86 m2)						
No Asbestos						
B00A - R1012 - Distribution Board Cupboard (1.2 m2) Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting 8423/B00D/R1011/Wall Linings Internal/S2	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1015 - General Learning Space (52.81 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1016 - General Learning Space (52.45 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1017 - Toilets-Girls (26.59 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 8423/B00D/R0010/Wall Linings Internal/S4	14m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1018 - General Storeroom (5.59 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1019 - General Storeroom (5.78 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1020 - General Learning Space (52.82 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1021 - Cleaning Store - Distributed (2.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8423/B00D/R0005/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1022 - Distribution Board Cupboard (1.2 m2) Note: No inspection of live electrical installation.

Wall Linings Internal Flat AC Sheeting 5m2 South Good Condition (1) Low (1) Low Priority (2-3)
 8423/B00D/R1011/Wall Linings Internal/S2 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00A - R1023 - Movement (170.23 m2)

No Asbestos

B00A - R1024 - Stairs (5.58 m2)

No Asbestos

B00A - R1025 - Stairs (5.35 m2)

No Asbestos

B00A - R1026 - General Learning Space (59.58 m2)

Recently Modified Space Requires Inspection

B00A - R1027 - Staff Kitchen (15.46 m2)

Recently Modified Space Requires Inspection

B00A - R1028 - Staff Study (15.37 m2)

Recently Modified Space Requires Inspection

B00A - R1029 - Staff Lounge (79.45 m2)

Recently Modified Space Requires Inspection

B00A - R1030 - Interview/Meeting (17.18 m2)

Recently Modified Space Requires Inspection

B00A - R1031 - Interview/Meeting (8.3 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Various - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall mastic	Mastic 8423/B00A/Wall mastic/S14					No Asbestos Detected

Interior**B00B - R0001 - Food/Research Space (22.22 m2)**

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00D/R1014/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00B - R0002 - Materials Store (3.67 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - Cleaning Store - Distributed (3.7 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0004 - Laundry (14.23 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0005 - Food Technology L.S. (79.63 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0006 - Pantry (25.86 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0007 - Food Technology L.S. (65.98 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0010 - General Learning Space (52.08 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00D/R1014/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00B - R0011 - Materials Store (6.3 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Sheet 8423/B00B/R0011/Floor Coverings Res/Textile/S15					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 8423/B00B/R0011/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00B - R0012 - Materials Store (6.04 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0013 - Staff - Toilet (2.87 m2)						
No Asbestos						
B00B - R0014 - General Learning Space (58.77 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00A/R0016/Floor Coverings Res/Textile/S9	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0019 - Materials Store (5.51 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0020 - Materials Store (5.85 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0021 - General Learning Space (52.96 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0022 - Cleaning Store - Distributed (2.81 m2)						
No Asbestos						
B00B - R0024 - General Storeroom (1.2 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0025 - General Storeroom (1.8 m2)						
No Asbestos						
B00B - R0026 - General Storeroom (1.2 m2)						
Ceiling Structures/Linings	Vermiculite		8423/B00D/R0005/Ceiling Structures/Linings/S1		Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0027 - General Storeroom (1.8 m2)						
No Asbestos						
B00B - R0028 - Stairs (3.84 m2)						
No Asbestos						
B00B - R0029 - Stairs (3.84 m2)						
No Asbestos						
B00B - R0030 - Dust Extraction Space (8.35 m2)						
No Asbestos						
B00B - R0031 - Dust Extraction Space (4.87 m2)						
No Asbestos						
B00B - R0033 - Project Store - Type 1 (7.44 m2)						
No Asbestos						
B00B - R0034 - Project Store - Type 1 (12.18 m2)						
No Asbestos						
B00B - R0035 - Materials Store (22.95 m2)						
No Asbestos						
B00B - R0036 - Outdoor Workshop (82.8 m2)						
No Asbestos						
B00B - R0037 - Movement (243.17 m2)						
Ceiling Structures/Linings	Vermiculite		8423/B00D/R0005/Ceiling Structures/Linings/S1		Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0038 - Staff Study (59.48 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0039 - General Learning Space (142.93 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0040 - General Learning Space (75.6 m2)						
Recently Modified Space	Requires Inspection					
B00B - R1001 - Art Learning Space (72.01 m2)						
Ceiling Structures/Linings	Vermiculite		8423/B00D/R0005/Ceiling Structures/Linings/S1		Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
B00B - R1002 - Resources Store (6.21 m2)						
Ceiling Structures/Linings	Vermiculite		8423/B00D/R0005/Ceiling Structures/Linings/S1		Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1003 - Resources Store (6.16 m2)						
Ceiling Structures/Linings	Vermiculite		8423/B00D/R0005/Ceiling Structures/Linings/S1		Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1004 - Art Learning Space (53.04 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Art Learning Space (52.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Resources Store (9.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1007 - Kiln Space (27.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1008 - Staff Study (45.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1009 - General Storeroom (5.7 m2)						
No Asbestos						
B00B - R1010 - Music Store (5.94 m2)						
No Asbestos						
B00B - R1011 - Music Learning Space (52.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - Staff - Toilet (2.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Distribution Board Cupboard (1.2 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1015 - Workshop (17.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1021 - Materials Store (5.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1022 - Music Store (5.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1023 - Music Learning Space (52.53 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R1024 - Cleaning Store - Distributed (2.77 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00B - R1025 - Distribution Board Cupboard (1.2 m2) Note: No inspection of live electrical installation.

No Asbestos

B00B - R1026 - Movement (185.5 m2)

No Asbestos

B00B - R1027 - Stairs (4.37 m2)

No Asbestos

B00B - R1028 - Stairs (4.8 m2)

No Asbestos

B00B - R1029 - Materials Technology L.S. (124.35 m2)

No Asbestos

B00B - R1030 - Welding Area (7.55 m2)

No Asbestos

B00B - R1031 - Materials Store (8.74 m2)

No Asbestos

B00B - R1032 - Design L.S. (75.38 m2)

No Asbestos

B00B - R1033 - Movement (4.43 m2)

Recently Modified Space Requires Inspection

B00B - R1034 - Music Store (13.85 m2)

Recently Modified Space Requires Inspection

B00B - R1035 - Music Learning Space (21.01 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Various - 1968 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall mastic	Mastic 8423/B00A/Wall mastic/S14					No Asbestos Detected

Interior**B00C - R0001 - Toilets-Boys (31.89 m2)**

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00C - R0002 - Darkroom Space (25.93 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00C/R0004/Floor Coverings Res/Textile/S6	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0003 - Staff Study (39.38 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00A/R0016/Floor Coverings Res/Textile/S9	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0004 - General Storeroom (5.87 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00C/R0004/Floor Coverings Res/Textile/S6	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0005 - Duplicating Workroom (17.95 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00C/R0004/Floor Coverings Res/Textile/S6	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0006 - Laboratory L.S. (93.08 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00C - R0007 - Chemical Store (25.94 m2)

Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8423/B00C/R0004/Floor Coverings Res/Textile/S6	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0008 - Toilets-Girls (28.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0009 - General Learning Space (53.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0010 - Staff - Toilet (3.65 m2)						
No Asbestos						
B00C - R0011 - Distribution Board Cupboard (0.52 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00D/R1011/Wall Linings Internal/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0012 - Cleaning Store - Distributed (3.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0013 - Laboratory L.S. (85.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0016 - Laboratory L.S. (92.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0017 - General Learning Space (58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R0018 - General Learning Space (52.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R0019 - General Storeroom (10.08 m2)						
No Asbestos						
B00C - R0020 - Distribution Board Cupboard (0.7 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00D/R1011/Wall Linings Internal/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0021 - Movement (217.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0022 - Stairs (7.14 m2)						
No Asbestos						
B00C - R0023 - Stairs (6.69 m2)						
No Asbestos						
B00C - R0024 - Preparation (39.3 m2)						
Recently Modified Space Requires Inspection						
B00C - R1001 - General Learning Space (58.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1002 - Performance Store (25.97 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1003 - General Learning Space (53.26 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Flue pipe	Fibre Cement Pipe	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00C - R1004 - Performance Workshop (53.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1005 - Stage (24.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1006 - Performing Arts Changeroom (6.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1007 - Performing Arts Changeroom (6.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1010 - Performing Arts Store (11.62 m2)						
No Asbestos						
B00C - R1011 - General Learning Space (51.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8423/B00C/R1019/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00C - R1012 - Distribution Board Cupboard (0.65 m2)						
Note: No inspection of live electrical installation.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00D/R1011/Wall Linings Internal/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1013 - Staff - Toilet (3.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1020 - General Learning Space (53.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R1021 - General Learning Space (53.18 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R1022 - General Learning Space (58.76 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R1023 - General Storeroom (5.82 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R1024 - General Storeroom (5.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R1025 - General Learning Space (52.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00C - R1026 - Cleaning Store - Distributed (4.5 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1027 - Distribution Board Cupboard (0.75 m2)						
						Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8423/B00D/R1011/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R1028 - Movement (189.04 m2)

No Asbestos

B00C - R1029 - Stairs (7.14 m2)

No Asbestos

B00C - R1030 - Stairs (6.69 m2)

No Asbestos

B00C - R1031 - Staff Study (45.78 m2)

Recently Modified Space Requires Inspection

B00C - R1032 - Computer Learning Space (71.84 m2)

Recently Modified Space Requires Inspection

B00C - R1033 - Staff Study (39.35 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - Various - 1968 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall mastic	Mastic 8423/B00A/Wall mastic/S14					No Asbestos Detected
Interior						
B00D - R0001 - Seminar (13.4 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0002 - Seminar (13.22 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0003 - Main Area (351.29 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0004 - Librarian (12.1 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0005 - Entry (14.69 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0006 - Workroom (30.12 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0007 - Seminar (13.29 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0008 - Audio Visual Workroom (25.35 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0009 - General Storeroom (18.15 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0010 - Toilets-Girls (10.06 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	8423/B00D/R0010/Wall Linings Internal/S4					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00D - R0011 - Cleaning Store - Distributed (2.37 m2)						
No Asbestos						
B00D - R0012 - Seminar (30.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0016 - General Storeroom (12.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0017 - Careers Advisers Office (19.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0018 - Staff Study (25.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0019 - General Learning Space (58.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0020 - General Learning Space (50.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0021 - General Storeroom (5.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0022 - Materials Store (10.23 m2)						
No Asbestos						
B00D - R0023 - Cleaning Store - Distributed (2.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0024 - Movement (190.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0025 - Stairs (4.75 m2)						
No Asbestos						
B00D - R0026 - Stairs (4.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0027 - Special Learning Space (47.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0028 - Computer Room (44.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00C/R0004/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B00D - R0029 - Outdoor Learning Area (48.32 m2)						
No Asbestos						
B00D - R1001 - General Learning Space (57.02 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1002 - Staff Study (25.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1003 - General Learning Space (52.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1004 - General Learning Space (52.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1005 - General Learning Space (57.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1006 - Resources Store (12.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1007 - Entry (3.23 m2)						
No Asbestos						
B00D - R1008 - General Storeroom (5.49 m2)						
Ceiling Structures/Linings	Vermiculite					
	8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1009 - General Learning Space (50.94 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1010 - Staff - Toilet (2.86 m2)						
No Asbestos						
B00D - R1011 - Distribution Board Cupboard (0.8 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 8423/B00D/R1011/Wall Linings Internal/S2	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Resinous Board 2Unit	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1012 - Laboratory L.S. (84.51 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1013 - Preparation (22.46 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00D/R1014/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00D - R1014 - General Storeroom (2.44 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00D/R1014/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00D - R1015 - Apparatus Store (12.69 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8423/B00D/R1014/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00D - R1016 - Laboratory L.S. (93 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1019 - General Storeroom (4.74 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1020 - General Storeroom (5.08 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1021 - General Learning Space (50.94 m2)						
Ceiling Structures/Linings	Vermiculite 8423/B00D/R0005/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R1022 - Distribution Board Cupboard (0.83 m2)						
				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8423/B00D/R1011/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Mounting Board	Resinous Board	3Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R1023 - Staff - Toilet (3.15 m2)

No Asbestos

B00D - R1024 - Movement (177.55 m2)

No Asbestos

B00D - R1025 - Stairs (7.41 m2)

No Asbestos

B00D - R1026 - Stairs (7.41 m2)

No Asbestos

B00D - R1027 - General Learning Space (31.86 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00E - R0001 - Sport Equipment Store (29.36 m2)**

No Asbestos

B00E - R0002 - General Storeroom (7.01 m2)

No Asbestos

B00E - R0003 - Maintenance Bulk Store (11.31 m2)

No Asbestos

B00E - R0004 - Cleaning Store - Distributed (4.57 m2)

No Asbestos

B00E - R0005 - Cleaning Store - Distributed (1.38 m2)

No Asbestos

B00E - R0006 - General Assistants (22.05 m2)

No Asbestos

B00E - R0007 - General Storeroom (14.38 m2)

No Asbestos

B00E - R0008 - Movement (7.25 m2)

No Asbestos

B00E - R0011 - Staff - Toilet (3.62 m2)

No Asbestos

B00E - R0014 - General Storeroom (6.14 m2)

No Asbestos

B00E - R0015 - Main Switchroom (11.3 m2)

No Asbestos

B00E - R0018 - Distribution Board Cupboard (0.61 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board Resinous Board 1Unit East Good Condition (1) Low (1) Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00E - R0019 - Movement (47.7 m2)**

No Asbestos

B00E - R0020 - Stairs (11.27 m2)

No Asbestos

B00E - R0021 - Stairs (11.27 m2)

No Asbestos

B00E - R0022 - Student Canteen (25.83 m2)

No Asbestos

B00E - R0023 - Office/Store (7.9 m2)

No Asbestos

B00E - R0024 - Student Canteen (39.58 m2)

No Asbestos

B00E - R0025 - Movement (327.82 m2)

Infill panels Flat AC Sheeting 35m2 North Good Condition (1) Low (1) Low Priority (2-3)

8423/B00D/R0010/Wall Linings Internal/S4

Chrysotile (white asbestos)**B00E - R0026 - Movement (10.54 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R0027 - Movement (16.86 m2)						
No Asbestos						
B00E - R0028 - Sport Equipment Store (15.54 m2)						
No Asbestos						
B00E - R1001 - Movement (12.44 m2)						
No Asbestos						
B00E - R1002 - Sport Equipment Store (11.3 m2)						
No Asbestos						
B00E - R1003 - Staff Change (6.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1004 - Plant (4.37 m2)						
No Asbestos						
B00E - R1005 - Toilets-Girls (23.24 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00D/R0010/Wall Linings Internal/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1006 - Change (10.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1007 - Plant (4.63 m2)						
No Asbestos						
B00E - R1008 - Shower (34.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1009 - Change (38.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1010 - Toilets-Boys (23.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1011 - Change (10.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1012 - Plant (4.74 m2)						
No Asbestos						
B00E - R1013 - Staff Shower (6.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8423/B00A/R0016/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting					
	8423/B00E/R1010/Ceiling Structures/Linings/S10					No Asbestos Detected
B00E - R1014 - Movement (12.5 m2)						
No Asbestos						
B00E - R1015 - General Storeroom (11.13 m2)						
No Asbestos						
B00E - R1016 - Stairs (15.57 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1017 - Stairs (15.57 m2)						
No Asbestos						
B00E - R1018 - Store (1.05 m2)						
No Asbestos						
B00E - R1019 - Store (1.05 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Multi Purpose Facilities - 1997 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - M0001 - Control Room (5.43 m2)**

No Asbestos

B00F - M0002 - Movement (5.38 m2)

No Asbestos

B00F - M0003 - Movement (5.34 m2)

No Asbestos

B00F - R0001 - Shower/Change (27.7 m2)

No Asbestos

B00F - R0002 - Toilets-Girls (5.88 m2)

No Asbestos

B00F - R0003 - Sport Equipment Store (18.68 m2)

No Asbestos

B00F - R0004 - Distribution Board Cupboard (2.56 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting
8423/B00F/R0004/Ceiling Structures/Linings/S8

No Asbestos Detected**B00F - R0005 - Student Canteen (15.25 m2)**

No Asbestos

B00F - R0006 - Cleaning Store - Distributed (3.87 m2)

No Asbestos

B00F - R0007 - Toilets-Boys (24.2 m2)

No Asbestos

B00F - R0008 - Toilets-Girls (18.34 m2)

No Asbestos

B00F - R0009 - Disabled Toilet (9.81 m2)

No Asbestos

B00F - R0010 - Sport Equipment Store (29.04 m2)

No Asbestos

B00F - R0011 - Chair Store (24.54 m2)

No Asbestos

B00F - R0012 - Chair Store (21.33 m2)

No Asbestos

B00F - R0013 - Toilets-Boys (5.13 m2)

No Asbestos

B00F - R0014 - Shower (27.74 m2)

No Asbestos

B00F - R0015 - Movement (9.64 m2)

No Asbestos

B00F - R0016 - Movement (9.53 m2)

No Asbestos

B00F - R0017 - Stage (109.16 m2)

No Asbestos

B00F - R0018 - Multi-Purpose Space (600.56 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0019 - Movement (214.89 m2)						
No Asbestos						
B00F - R0020 - Sport Equipment Store (18.41 m2)						
No Asbestos						
B00F - R0021 - Control Room (1.29 m2)						
No Asbestos						
B00F - R0022 - Movement (1.64 m2)						
No Asbestos						
B00F - R0023 - Movement (1.64 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Mechanical Services - 2007 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00G - R0001 - Lift (4.35 m2)

No Asbestos

B00G - R0002 - Lift (2.1 m2)

No Asbestos

B00G - R1001 - Lift (4.35 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other - 2008 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store (31.65 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 2014 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00I - R0001 - Sport Equipment Store (137.58 m2)

No Asbestos

B00I - R0002 - External Movement (34.57 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D13872 - Learning Unit - Standard/Withdrawal : Placement Date - 10/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017