


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kirrawee High School (8437)
Region : Sydney
State Electorate : Cronulla
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

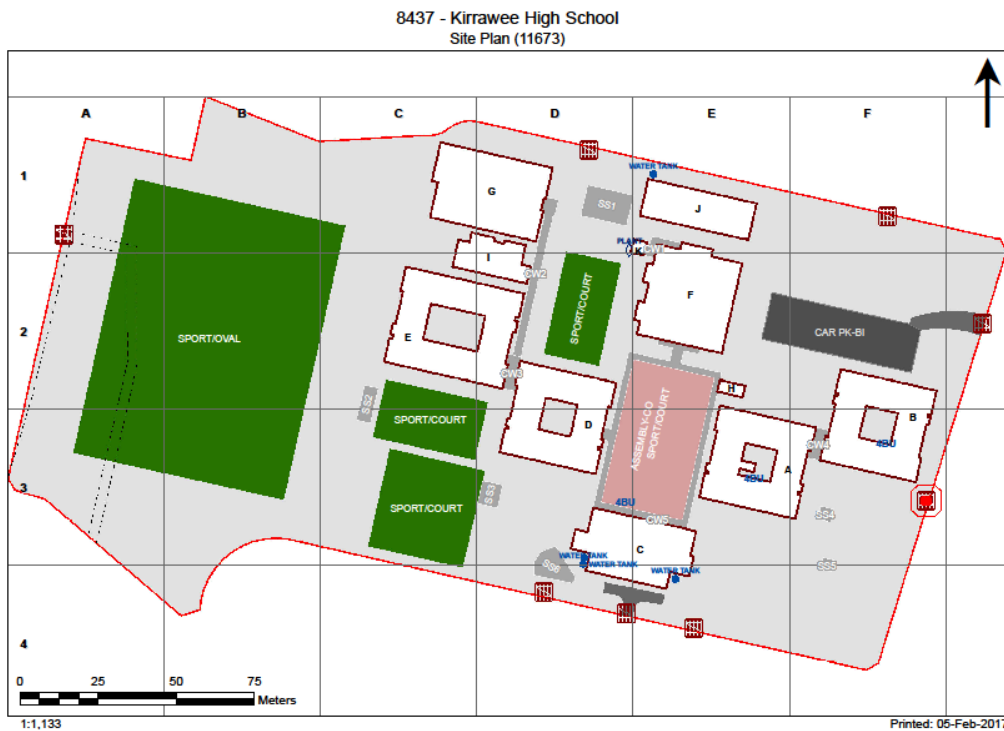

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Various - 1965 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00A - R0001 - Deputy Principal Office (11.52 m2)**

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0002 - Public Entry (28.54 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0003 - Cleaning Store - Distributed (2.05 m2)

No Asbestos

B00A - R0004 - Distribution Board Cupboard (1.46 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0004/Wall Linings Internal/S7					Chrysotile (white asbestos)

B00A - R0006 - General Storeroom (6.44 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0007 - Preparation (19.08 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00A - R0008 - Duplicating Workroom (23.98 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0009 - Administration - Clerical (58.98 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0010 - Staff - Toilet (3.3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0010/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00A - R0011 - Distribution Board Cupboard (0.42 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0012 - Duplicating Workroom (21.22 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0013 - Interview/Office - Type 1 (10.54 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0014 - Principal Office (19.69 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Staff - Toilet (2.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - General Storeroom (3.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R0017 - Administration - Clerical (39.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - Administration - Clerical (8.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Administration - Clerical (8.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Movement (17.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0021 - Interview/Office - Type 1 (7.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0022 - Staff - Toilet (3.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0023 - Staff - Toilet (3.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0024 - Clinic - Girls (7.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0025 - Administration - Clerical (7.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Public Entry (12.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0028 - Music Store (13.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0029 - Laboratory L.S. (80.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0030 - Darkroom Space (18.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R0032 - External Stairs (5.36 m2)						
No Asbestos						
B00A - R0033 - External Stairs (5.45 m2)						
No Asbestos						
B00A - R0034 - External Movement (293.55 m2)						
Non Accessible						
B00A - R0035 - Lift (2.38 m2)						
Non Accessible						
B00A - R1001 - Art Learning Space (58.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R1002 - No Access (10.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R1003 - Art Learning Space (52.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R1004 - Cleaning Store - Distributed (2.05 m2)						
No Asbestos						
B00A - R1005 - Distribution Board Cupboard (1.47 m2)						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0004/Wall Linings Internal/S7					Chrysotile (white asbestos)
B00A - R1006 - General Learning Space (18.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - General Learning Space (39.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - General Learning Space (52.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - General Learning Space (52.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - General Learning Space (58.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1011 - Staff - Toilet (3.32 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0010/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)
B00A - R1012 - Distribution Board Cupboard (0.43 m2)						
					Note: No inspection of live electrical installation.	
Non Accessible						
B00A - R1014 - General Storeroom (12.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R1015 - Music Learning Space (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00A - R1016 - Music Store (66.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1017 - Interview/Office - Type 1 (13.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1018 - Staff Study (12.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1019 - Music Learning Space (52.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1021 - Music Store (9.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00A/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1022 - Music Store (9.48 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00A/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1023 - Computer Learning Space (13.07 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00A/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1024 - Staff Study (39.64 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00A/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1025 - External Stairs (4.77 m2)						
No Asbestos						
B00A - R1026 - External Stairs (5 m2)						
No Asbestos						
B00A - R1027 - External Movement (138 m2)						
Non Accessible						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Art - 1965 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - Staff Study (26.08 m2)**

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0002 - Laundry (10.22 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0003 - Staff - Toilet (3.3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00B - R0004 - Distribution Board Cupboard (0.56 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0005 - Staff Study (26.97 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00B - R0006 - Cleaning Store - Distributed (3.4 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0007 - Dust Extraction Space (8.99 m2)

No Asbestos

B00B - R0008 - Resource/Project Store (12.92 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0009 - Materials Technology L.S. (86.05 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0010 - Materials Store (23.87 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0013 - Resource/Project Store (5 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0014 - Resource/Project Store (5.39 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0015 - Design L.S. (53.8 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00B/R1020/Floor Coverings Res/Textile/S2	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0017 - Food Technology L.S. (72.37 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0018 - Food/Research Space (12.96 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0019 - Food/Research Space (12.53 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0020 - Food Technology L.S. (86.73 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0022 - Computer Learning Space (11.61 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0023 - Materials Store (13.98 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0024 - Materials Technology L.S. (112.96 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0025 - Communications Cupboard (1.71 m2)						
No Asbestos						
B00B - R0026 - Movement (136.76 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0027 - Stairs (6.04 m2)						
No Asbestos						
B00B - R0028 - Stairs (5.88 m2)						
No Asbestos						
B00B - R1001 - Design L.S. (55.91 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00B/R1020/Floor Coverings Res/Textile/S2	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1002 - Staff - Toilet (3.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)		
B00B - R1003 - Distribution Board Cupboard (0.56 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R1004 - Design L.S. (66.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00B - R1005 - Resource/Project Store (6.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00B - R1006 - Resource/Project Store (6.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00B - R1007 - Materials Store (8.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00B - R1008 - Resource/Project Store (9.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1009 - Materials Technology L.S. (79.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1010 - Materials Technology L.S. (113 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1011 - Resource/Project Store (12.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1012 - Resources Store (5.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1013 - General Storeroom (5.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8437/B00B/R1020/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1014 - General Learning Space (53.66 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1015 - Cleaning Store - Distributed (2.25 m2)						
No Asbestos						
B00B - R1016 - Distribution Board Cupboard (1.58 m2)						
No Asbestos						
B00B - R1017 - Resources Store (10.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1018 - Kiln Space (21.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1019 - Art Learning Space (52.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1020 - Art Learning Space (53 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00B/R1020/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1021 - Staff Study (25.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00B/R1020/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1022 - Movement (133.56 m2)						
No Asbestos						
B00B - R1023 - Stairs (4.92 m2)						
No Asbestos						
B00B - R1024 - Stairs (4.88 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Maintenance Bulk Store (23.13 m2)**

No Asbestos

B00C - R0002 - Movement (19.64 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0003 - Sport Equipment Store (13.17 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0004 - Office/Store (5.77 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0005 - Student Canteen (59.69 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00C/R0007/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

B00C - R0006 - Staff - Toilet (3.06 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00C/R0006/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0007 - Office/Store (2.97 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00C/R0007/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

B00C - R0008 - Security Store (6.17 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0009 - General Storeroom (6.17 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Drain pipe	Fibre Cement Pipe	4m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00C/R0009/Drain pipe/S27					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0010 - General Storeroom (14.39 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0011 - Secure Storeroom (2.02 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0012 - General Assistants (19.38 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0013 - Cleaning Store - Distributed (1.17 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0014 - Staff - Toilet (5.32 m2)						
No Asbestos						
B00C - R0015 - Movement (19.71 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0016 - Maintenance Bulk Store (23.08 m2)						
No Asbestos						
B00C - R0017 - Movement (341.13 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - External Movement (4.64 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0019 - Stairs (13.97 m2)						
No Asbestos						
B00C - R0020 - Stairs (9.28 m2)						
No Asbestos						
B00C - R0021 - Sport Equipment Store (3.93 m2)						
No Asbestos						
B00C - R0022 - Bulk Store (22.31 m2)						
No Asbestos						
B00C - R1001 - Movement (16.55 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1002 - Staff Change (7.18 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00C/R0006/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00C/R0007/Floor Coverings Res/Textile/S10						Chrysotile (white asbestos)
B00C - R1003 - Toilets-Boys (33.45 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00C/R0006/Partition Walls (Cubicles)/S9	16m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	-----------------------------	--------------------	---------	---

B00C - R1004 - Shower/Change (39.59 m2)

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00C - R1005 - Shower/Change (36.44 m2)

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00C/R0006/Partition Walls (Cubicles)/S9	22m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	--------------	--------------------	---------	---

B00C - R1006 - Toilets-Girls (36.56 m2)

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00C/R0006/Partition Walls (Cubicles)/S9	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	-----------------------------	--------------------	---------	---

B00C - R1007 - Staff Change (7.18 m2)

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 8437/B00C/R0007/Floor Coverings Res/Textile/S10	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00C - R1008 - Movement (16.28 m2)

Ceiling Structures/Linings	Vermiculite 8437/B00C/R0006/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00C - R1009 - Stairs (13.72 m2)

No Asbestos

B00C - R1010 - Stairs (13.72 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Science Learning - 1965 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00D - R0001 - Laboratory L.S. (93.13 m2)**

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0002 - Toilets-Boys (33.5 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R0007/Partition Walls (Cubicles)/S25					Chrysotile (white asbestos)

B00D - R0003 - General Storeroom (12.64 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0004 - General Storeroom (13.21 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R1006/Floor Coverings Res/Textile/S24					Chrysotile (white asbestos)

B00D - R0005 - Cleaning Store - Distributed (2.2 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R0005/Wall Linings Internal/S23					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0006 - General Storeroom (1.6 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R0005/Wall Linings Internal/S23					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0007 - Toilets-Girls (53.19 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R0007/Partition Walls (Cubicles)/S25					Chrysotile (white asbestos)

B00D - R0008 - General Storeroom (52.34 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00D/R1006/Floor Coverings Res/Textile/S24					Chrysotile (white asbestos)

B00D - R0009 - Preparation (19.2 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
Fume Cupboard	Flat AC Sheeting	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Fume Cupboard/S20				Chrysotile (white asbestos)		
B00D - R0010 - Apparatus Store (6.41 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R0011 - Laboratory L.S. (85.7 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0012 - Staff - Toilet (3.32 m2)						
No Asbestos						
B00D - R0013 - Distribution Board Cupboard (0.48 m2)						
No Asbestos						Note: No inspection of live electrical installation.
B00D - R0014 - Staff Study (26.42 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0016 - Laboratory L.S. (93.26 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0017 - General Storeroom (9.53 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R0018 - Preparation (27.82 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
Fume Cupboard	Flat AC Sheeting	2Unit	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Fume Cupboard/S20				Chrysotile (white asbestos)		
B00D - R0019 - Movement (149.55 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0020 - Apparatus Store (23.05 m2)						
Ceiling Structures/Linings	Vermiculite					
8437/B00D/R0011/Ceiling Structures/Linings/S22				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R0021 - Computer Learning Space (13.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R0022 - Stairs (5.89 m2)						
No Asbestos						
B00D - R0023 - Stairs (6.01 m2)						
No Asbestos						
B00D - R1001 - General Learning Space (59.06 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R1002 - Interview/Office - Type 1 (23.41 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1003 - General Learning Space (54.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1004 - Cleaning Store - Distributed (2.2 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1005 - Distribution Board Cupboard (1.63 m2)						
Non Accessible				Note: No inspection of live electrical installation.		
B00D - R1006 - General Learning Space (58.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R1007 - Staff Study (38.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1008 - General Storeroom (12.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1009 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00D/R0011/Ceiling Structures/Linings/S22				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00D/R1006/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00D - R1010 - Computer Learning Space (58.91 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00D/R1006/Floor Coverings Res/Textile/S24	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1011 - Staff - Toilet (3.3 m2)						
No Asbestos						
B00D - R1012 - Distribution Board Cupboard (0.48 m2)					Note: No inspection of live electrical installation.	
Non Accessible						
B00D - R1014 - General Learning Space (58.99 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1015 - General Learning Space (52.7 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00D/R1006/Floor Coverings Res/Textile/S24	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1016 - General Learning Space (52.77 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00D/R1006/Floor Coverings Res/Textile/S24	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1017 - Movement (133.12 m2)						
No Asbestos						
B00D - R1018 - General Learning Space (44.84 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00D/R1006/Floor Coverings Res/Textile/S24	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1019 - Computer Learning Space (19.74 m2)						
Ceiling Structures/Linings	Vermiculite 8437/B00D/R0011/Ceiling Structures/Linings/S22					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8437/B00D/R1006/Floor Coverings Res/Textile/S24	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1020 - Stairs (5.61 m2)						
No Asbestos						
B00D - R1021 - Stairs (5.79 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Science Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - Chemical Store (19.08 m2)**

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0002 - Staff - Toilet (5.86 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R0003 - Computer Learning Space (53.87 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0004 - General Learning Space (45.71 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R0005 - General Learning Space (52.19 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0006 - General Storeroom (6.14 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0007 - General Storeroom (6.15 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0008 - General Storeroom (9.58 m2)

Ceiling Structures/Linings	Vermiculite					
	8437/B00E/R0002/Ceiling Structures/Linings/S18					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00E - R0009 - Preparation (26.88 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Fume Cupboard/S20					Chrysotile (white asbestos)	
B00E - R0010 - Laboratory L.S. (92.37 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00E - R0011 - Apparatus Store (32.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00E - R0012 - General Storeroom (5.01 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0013 - Distribution Board Cupboard (1.3 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B00E - R0014 - General Learning Space (52.49 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8437/B00E/R0019/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00E - R0015 - General Storeroom (6.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0016 - General Storeroom (19.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0017 - Laboratory L.S. (99.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8437/B00E/R0002/Ceiling Structures/Linings/S18					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0020 - Laboratory L.S. (92.56 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0021 - Staff Study (25.7 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0022 - Movement (180.54 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0023 - Preparation - Science (39.57 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0024 - Stairs (8.98 m2)						
No Asbestos						
B00E - R0025 - Stairs (8.83 m2)						
No Asbestos						
B00E - R1001 - Computer Store (9.48 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1002 - General Storeroom (8.27 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1003 - Staff Kitchen (6.29 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1004 - Commonroom (63.6 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1005 - Audio Visual Workroom (32.41 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1006 - Duplicating Workroom (12.78 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1007 - Staff Kitchen (15.84 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1008 - Commonroom (102.43 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1009 - General Learning Space (52.7 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1010 - General Learning Space (59.35 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1011 - Cleaning Store - Distributed (5.04 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1012 - Distribution Board Cupboard (0.87 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B00E - R1013 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1014 - General Storeroom (6.08 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1015 - Performing Arts Store (12.14 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1018 - Stage (25.91 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1019 - Staff Kitchen (6.07 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1020 - General Storeroom (6.14 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1021 - Staff Study (39.33 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1022 - Computer Learning Space (65.91 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1023 - Movement (180.62 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1024 - Performance Workspace (111.7 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1025 - Stairs (1.36 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R1026 - Stairs (7.33 m2)						
No Asbestos						
B00E - R1027 - Stairs (1.36 m2)						
No Asbestos						
B00E - R1028 - Stairs (7.18 m2)						
No Asbestos						
B00E - R2001 - General Learning Space (58.89 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2002 - Staff - Toilet (6.44 m2)						
Wall Linings Internal	Flat AC Sheeting		8437/B00E/R2002/Wall Linings Internal/S21			No Asbestos Detected
B00E - R2003 - Staff Study (57.23 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2004 - General Storeroom (5.35 m2)						
No Asbestos						
B00E - R2005 - General Learning Space (58.98 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2006 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2007 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2008 - General Learning Space (52.55 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2009 - General Learning Space (59.12 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2010 - Cleaning Store - Distributed (5.21 m2)						
No Asbestos						
B00E - R2011 - Distribution Board Cupboard (0.87 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00E - R2012 - Computer Learning Space (52.41 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2013 - Computer Resource (5.77 m2)						
Ceiling Structures/Linings	Vermiculite		8437/B00E/R0002/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2014 - General Storeroom (5.9 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2015 - General Storeroom (5.64 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2016 - General Learning Space (58.6 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2017 - General Learning Space (51.24 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2018 - General Learning Space (52.12 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2019 - General Learning Space (52.41 m2)						
Ceiling Structures/Linings	Vermiculite	8437/B00E/R0002/Ceiling Structures/Linings/S18				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R2020 - Movement (183.6 m2)						
No Asbestos						
B00E - R2021 - Stairs (6.52 m2)						
No Asbestos						
B00E - R2022 - Stairs (6.32 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1984 - Brick/Block (Brick/Block)**Exterior**

Movements outside doors	Flat AC Sheeting 8437/B00F/Movements outside doors/S11					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Sport Equipment Store (31.01 m2)**

No Asbestos

B00F - R0002 - Multi-Purpose Space (473.04 m2)

No Asbestos

B00F - R0003 - Toilets-Disabled (4.08 m2)

No Asbestos

B00F - R0004 - Staff Change (6.76 m2)

No Asbestos

B00F - R0005 - Staff Kitchen (11.07 m2)

Panels below windows	Flat AC Sheeting 8437/B00F/R0006/Panels below windows/S12					No Asbestos Detected
----------------------	--	--	--	--	--	-----------------------------

B00F - R0006 - Staff Study (21.82 m2)

Panels below windows	Flat AC Sheeting 8437/B00F/R0006/Panels below windows/S12					No Asbestos Detected
----------------------	--	--	--	--	--	-----------------------------

B00F - R0007 - Chair Store (29.59 m2)

No Asbestos

B00F - R0008 - Toilets-Girls (21.01 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00F/R0012/Partition Walls (Cubicles)/S13					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Panels below windows	Flat AC Sheeting 8437/B00F/R0006/Panels below windows/S12					No Asbestos Detected
----------------------	--	--	--	--	--	-----------------------------

B00F - R0009 - Stage (83.26 m2)

No Asbestos

B00F - R0011 - Distribution Board Cupboard (0.56 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0012 - Toilets-Boys (19.75 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00F/R0012/Partition Walls (Cubicles)/S13					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Panels below windows	Flat AC Sheeting 8437/B00F/R0006/Panels below windows/S12					No Asbestos Detected
----------------------	--	--	--	--	--	-----------------------------

B00F - R0013 - External Movement (15.74 m2)

No Asbestos

B00F - R0015 - Movement (0.84 m2)

No Asbestos

B00F - R0016 - Movement (0.84 m2)

No Asbestos

B00F - R0017 - Stairs (1.28 m2)

No Asbestos

B00F - R0018 - Stairs (1.46 m2)

No Asbestos

B00F - R0019 - Stairs (9.14 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0020 - Stairs (8.81 m2)						
No Asbestos						
B00F - R0021 - External Movement (11.42 m2)						
No Asbestos						
B00F - R0022 - External Movement (11.25 m2)						
No Asbestos						
B00F - R0023 - Movement (31.07 m2)						
No Asbestos						
B00F - R0024 - Lift (1.39 m2)						
No Asbestos						
B00F - R0025 - Movement (4.93 m2)						
No Asbestos						
B00F - R0026 - Plant (0.43 m2)						
No Asbestos						
B00F - R1001 - Performing Arts Changeroom (44.7 m2)						
Wall Linings Internal	Flat AC Sheeting		8437/B00F/R1002/Wall Linings Internal/S14			No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet		8437/B00F/R0012/Partition Walls (Cubicles)/S13			No Asbestos Detected
B00F - R1002 - Cleaning Store - Distributed (4.72 m2)						
Wall Linings Internal	Flat AC Sheeting		8437/B00F/R1002/Wall Linings Internal/S14			No Asbestos Detected
B00F - R1003 - Control Room (5.73 m2)						
No Asbestos						
B00F - R1004 - Performing Arts Changeroom (44.65 m2)						
Wall Linings Internal	Flat AC Sheeting		8437/B00F/R1002/Wall Linings Internal/S14			No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet		8437/B00F/R0012/Partition Walls (Cubicles)/S13			No Asbestos Detected
B00F - R1005 - Movement (87.91 m2)						
No Asbestos						
B00F - R1006 - Control Room (4.88 m2)						
No Asbestos						
B00F - R1007 - Stairs (3.14 m2)						
No Asbestos						
B00F - R1008 - Stairs (3.12 m2)						
No Asbestos						
B00F - R1009 - Stairs (2.27 m2)						
No Asbestos						
B00F - R1010 - Movement (1.16 m2)						
No Asbestos						
B00F - R1011 - Stairs (2.4 m2)						
No Asbestos						
B00F - R1012 - Movement (1.16 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1989 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - R0001 - Seminar (14.52 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0002 - Seminar (14.52 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0003 - Seminar (14.61 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0004 - Entry (17.26 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0005 - Distribution Board Cupboard (0.57 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0006 - Cleaning Store - Distributed (2.32 m2)

No Asbestos

B00G - R0007 - Staff - Toilet (4.89 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8437/B00G/R0007/Partition Walls (Cubicles)/S15
----------------------------	---

No Asbestos Detected**B00G - R0008 - Audio Visual Workroom (26.65 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0009 - Workroom (37.34 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0010 - Librarian (11.3 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0011 - Main Area (401.31 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0012 - Computer Learning Space (87.47 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0013 - Administration - Clerical (13.16 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0014 - Interview/Office - Type 1 (13.08 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0015 - General Storeroom (11.7 m2)

No Asbestos

B00G - R0016 - Administration - Clerical (11.95 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0017 - Staff - Toilet (7.02 m2)

Wall Linings Internal	Flat AC Sheeting 8437/B00G/R0017/Wall Linings Internal/S16
-----------------------	---

No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - R0018 - Multi-Purpose Space (112.02 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1965 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Main Switchroom (8.25 m2)

No Asbestos

B00H - R0002 - Maintenance Bulk Store (17.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - Other - 1999 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - Main Area (50.56 m2)**

No Asbestos

B00I - R0002 - General Storeroom (1.65 m2)

No Asbestos

B00I - R0003 - General Storeroom (1.04 m2)

No Asbestos

B00I - R0004 - General Learning Space (45.3 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00I - R0005 - Staff Kitchen (5.37 m2)**

No Asbestos

B00I - R0006 - Staff Study (12.43 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00I - R0007 - General Learning Space (37.26 m2)**

No Asbestos

B00I - R0008 - General Storeroom (1.3 m2)

No Asbestos

B00I - R0009 - General Storeroom (1.2 m2)

No Asbestos

B00I - R0010 - General Learning Space (6.39 m2)

No Asbestos

B00I - R0011 - General Learning Space (6.39 m2)

No Asbestos

B00I - R0012 - Distribution Board Cupboard (0.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0013 - General Storeroom (3.1 m2)Wall Linings Internal Flat AC Sheeting
8437/B00I/R0014/Wall Linings Internal/S17**No Asbestos Detected****B00I - R0014 - Disabled Toilet (4.5 m2)**Wall Linings Internal Flat AC Sheeting
8437/B00I/R0014/Wall Linings Internal/S17**No Asbestos Detected****B00I - R0015 - Staff - Toilet (3.57 m2)**Wall Linings Internal Flat AC Sheeting
8437/B00I/R0014/Wall Linings Internal/S17**No Asbestos Detected****B00I - R0016 - Secure Storeroom (5.25 m2)**Wall Linings Internal Flat AC Sheeting
8437/B00I/R0014/Wall Linings Internal/S17**No Asbestos Detected****B00I - R0017 - External Movement (4.44 m2)**

No Asbestos

B00I - R0018 - External Movement (16.82 m2)

No Asbestos

B00I - R0019 - External Movement (6.71 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - R0020 - External Movement (13.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Music - 2005 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Music Store (8.48 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0002 - Music Store (8.57 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0003 - Music Store (8.54 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0004 - Music Learning Space (97.24 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0005 - External Movement (94.12 m2)

No Asbestos

B00J - R0006 - Music Learning Space (57.44 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0007 - Music Learning Space (60.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0008 - Music Store (14.01 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0009 - Staff Study (24.43 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00J - R0010 - Staff - Toilet (3.37 m2)

No Asbestos

B00J - R0011 - Toilets-Boys (8.88 m2)

No Asbestos

B00J - R0012 - Toilets-Girls (8.88 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 2014 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00K - R0001 - Toilets-Disabled (13.47 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8437_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017