


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Killara High School (8457)
Region : Northern Sydney
State Electorate : Davidson
Local Government Area : Ku-Ring-Gai

Initial Survey : Noel Arnold & Associates : 18 - Jan - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

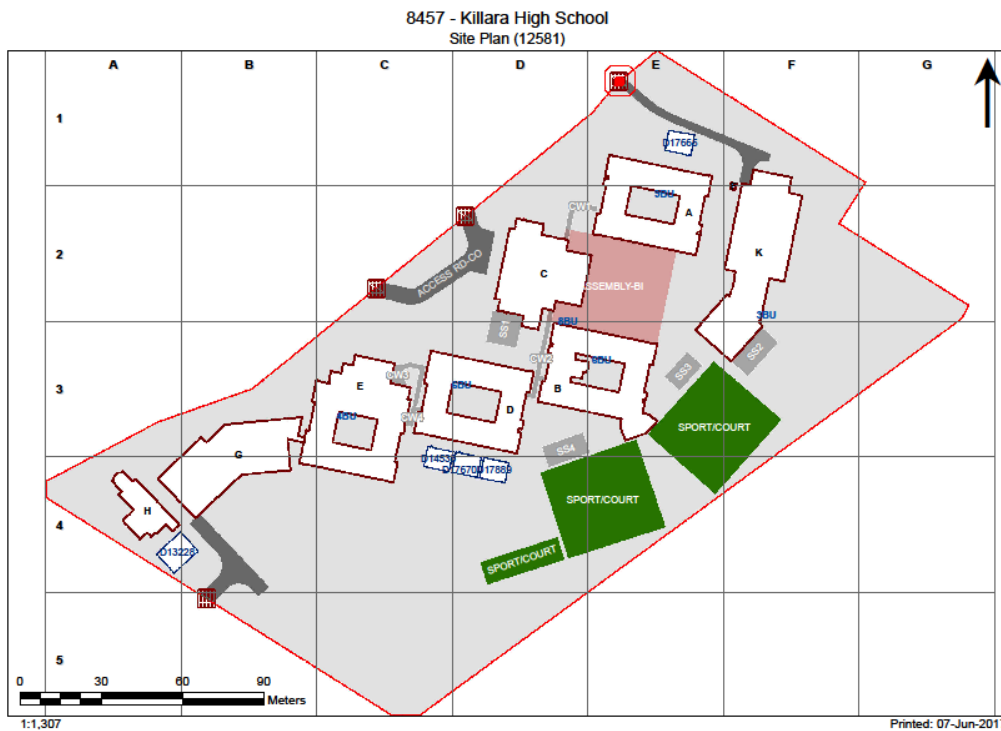

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00A - R0003 - Staff - Toilet (4.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0004 - Staff - Toilet (4.43 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0008 - Administration - Clerical (23.25 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0010 - Principal Office (20.11 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0011 - General Storeroom (3.07 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0012 - Staff - Toilet (3.2 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0014 - Administration - Clerical (34.13 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0015 - General Learning Space (57.73 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0016 - Cleaning Supplies Store (2.97 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0017 - Distribution Board Cupboard (1.26 m2) Note: No inspection of live electrical installation.						
Door backing	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00A/R0029/Door backing/S3					Chrysotile (white asbestos)	
B00A - R0018 - General Storeroom (2.55 m2)						
No Asbestos						
B00A - R0020 - General Storeroom (10.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R0021 - Movement (174.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0022 - Toilets-Boys (26.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0023 - Staff Study (25.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00A/R0014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R0024 - Laboratory L.S. (91.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0025 - Preparation (29.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0026 - Apparatus Store (8.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0027 - Laboratory L.S. (83.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00A/R0021/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0028 - Staff - Toilet (5.02 m2)						
No Asbestos						
B00A - R0029 - Distribution Board Cupboard (0.99 m2) Note: No inspection of live electrical installation.						
Door backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00A/R0029/Door backing/S3					Chrysotile (white asbestos)	
B00A - R0030 - General Storeroom (2.55 m2)						
No Asbestos						
B00A - R0031 - Duplicating Workroom (37.79 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0032 - Administration - Clerical (9.31 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0033 - Staff Study (14.1 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0034 - Clinic-Waiting (15.73 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0035 - Staff Study (14.83 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0036 - Staff Study (15.36 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0037 - Entry (48.04 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0038 - Administration - Clerical (7.06 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0039 - Staff Study (15.97 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0040 - Stairs (3.14 m2)						
No Asbestos						
B00A - R0041 - Stairs (3.28 m2)						
No Asbestos						
B00A - R0042 - Staff Study (36.46 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0043 - Deputy Principal (13.65 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1001 - Toilets-Girls (25.96 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1002 - General Learning Space (51.94 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1004 - Distribution Board Cupboard (1.04 m2)						
				Note: No inspection of live electrical installation.		
Door backing	Flat AC Sheeting 8457/B00A/R0029/Door backing/S3	4Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1009 - Staff - Toilet (3.31 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1010 - General Learning Space (50.9 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1011 - Staff Study (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1012 - General Storeroom (5.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	6m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
B00A - R1014 - General Learning Space (57.7 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1015 - General Storeroom (6.45 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1016 - General Storeroom (5.71 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1017 - General Learning Space (52.03 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1018 - General Learning Space (65.23 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1019 - General Storeroom (5.88 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1020 - General Storeroom (2.92 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1021 - General Storeroom (2.83 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1022 - Staff Lounge (66.76 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1023 - Distribution Board Cupboard (1.26 m2)				Note: No inspection of live electrical installation.		
Door backing	Flat AC Sheeting 8457/B00A/R0029/Door backing/S3	4Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1024 - Cleaning Store - Distributed (2.97 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1025 - General Learning Space (50.85 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1026 - General Storeroom (5.26 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1027 - General Storeroom (4.88 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R1028 - Movement (173.07 m2)						
No Asbestos						
B00A - R1031 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1032 - Staff Study (13.2 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00A/R0014/Floor Coverings Res/Textile/S9	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1033 - Commonroom (122.96 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00A/R0014/Floor Coverings Res/Textile/S9	123m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1034 - Stairs (5.91 m2)						
No Asbestos						
B00A - R1035 - Stairs (5.76 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & App. Studies - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0003 - Movement (164.12 m2)**

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0004 - Toilets-Disabled (11.83 m2)

No Asbestos

B00B - R0005 - Lift (2.1 m2)

No Asbestos

B00B - R0036 - Textiles Technology L.S. (65.07 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0037 - Art Learning Space (57.47 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0042/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00B - R0038 - Staff - Toilet (4.06 m2)

No Asbestos

B00B - R0039 - Distribution Board Cupboard (1.26 m2)

Note: No inspection of live electrical installation.

door backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0039/door backing/S12					Chrysotile (white asbestos)

B00B - R0042 - General Storeroom (5.71 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0042/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00B - R0043 - Resources Store (6.08 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0042/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00B - R0044 - Art Learning Space (49.74 m2)

Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0042/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00B - R0050 - Food Technology L.S. (93.31 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0051 - Materials Store (8.9 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0052 - Materials Store (6.87 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
flue pipe	bit-u-flue 8457/B00B/R0052/flue pipe/S13	3m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0053 - Cleaning Store - Distributed (4.02 m2)						
No Asbestos						
B00B - R0054 - Cleaning Store - Distributed (1.26 m2)						
door backing	Flat AC Sheeting 8457/B00B/R0039/door backing/S12	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0055 - General Storeroom (2.55 m2)						
No Asbestos						
B00B - R0057 - Textiles Technology L.S. (51.19 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00B/R0042/Floor Coverings Res/Textile/S11	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0058 - Music Store (5.38 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00B/R0042/Floor Coverings Res/Textile/S11	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0059 - Materials Store (4.98 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00B/R0042/Floor Coverings Res/Textile/S11	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0060 - Stairs (2.78 m2)						
No Asbestos						
B00B - R0061 - Stairs (2.99 m2)						
No Asbestos						
B00B - R0062 - General Storeroom (13.37 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0063 - Movement (0.75 m2)						
No Asbestos						
B00B - R0065 - Preparation - Materials (25.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0066 - Food Technology L.S. (95.24 m2)						
No Asbestos						
B00B - R0067 - Change (9.62 m2)						
No Asbestos						
B00B - R0068 - Plant (1.06 m2)						
No Asbestos						
B00B - R0069 - Project Store - Type 1 (7.64 m2)						
No Asbestos						
B00B - R0070 - Food Technology L.S. (120.66 m2)						
No Asbestos						
B00B - R0071 - Student Change - Type 2 (0.86 m2)						
No Asbestos						
B00B - R0072 - Student Change - Type 2 (4.98 m2)						
No Asbestos						
B00B - R0073 - Distribution Board Cupboard (0.76 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0073/Ceiling Structures/Linings/S27					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0074 - Seminar - Type 1 (27.42 m2)						
Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0073/Ceiling Structures/Linings/S27					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0075 - Handwashing Facilities (1.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0073/Ceiling Structures/Linings/S27					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0076 - No Access (8.88 m2)						
No Asbestos						
B00B - R1001 - Movement (166.9 m2)						
No Asbestos						
B00B - R1002 - Lift (2.1 m2)						
No Asbestos						
B00B - R1059 - Resources Store (10.41 m2)						
No Asbestos						
B00B - R1065 - Staff - Toilet (3.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1066 - Distribution Board Cupboard (1.26 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1068 - Materials Technology L.S. (50.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00B/R0042/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)
B00B - R1078 - Distribution Board Cupboard (1.32 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1079 - Music Store (3.15 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1080 - Music Learning Space (50.85 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00B/R0042/Floor Coverings Res/Textile/S11	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1081 - Music Store (16.51 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00B/R0042/Floor Coverings Res/Textile/S11	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1082 - Materials Store (4.92 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00B/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1084 - Stairs (5.58 m2)						
No Asbestos						
B00B - R1085 - Stairs (5.61 m2)						
No Asbestos						
B00B - R1088 - General Learning Space (70.2 m2)						
No Asbestos						
B00B - R1089 - General Learning Space (64.92 m2)						
No Asbestos						
B00B - R1090 - General Learning Space (64.81 m2)						
No Asbestos						
B00B - R1091 - General Learning Space (70.13 m2)						
No Asbestos						
B00B - R1092 - General Learning Space (70.49 m2)						
No Asbestos						
B00B - R1093 - General Learning Space (65.19 m2)						
No Asbestos						
B00B - R1094 - General Assistants (65.19 m2)						
No Asbestos						
B00B - R1095 - Staff Lounge (66.01 m2)						
No Asbestos						
B00B - R1096 - Student Kitchen (4.21 m2)						
No Asbestos						
B00B - R9001 - Movement (9.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8457/B00B/R9001/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R9002 - Materials Store (38.79 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Physical Education - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00C - R0002 - Cleaning Supplies Store (11.37 m2)**

No Asbestos

B00C - R0005 - Sport Equipment Store (6.25 m2)

No Asbestos

B00C - R0006 - Staff - Toilet (3.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00C - R0007 - Student Canteen (56.65 m2)

No Asbestos

B00C - R0008 - General Storeroom (13.59 m2)

No Asbestos

B00C - R0009 - Maintenance Bulk Store (14.26 m2)

No Asbestos

B00C - R0010 - Sport Equipment Store (22.1 m2)

No Asbestos

B00C - R0011 - Cleaning Store - Distributed (1.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00C - R0012 - Staff - Toilet (4.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00C - R0013 - Main Switchroom (11.22 m2)

No Asbestos

B00C - R0014 - Sport Equipment Store (14.41 m2)

No Asbestos

B00C - R0015 - Sport Equipment Store (42.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00C - R0016 - Movement (316.8 m2)

No Asbestos

B00C - R0017 - Movement (10.76 m2)

No Asbestos

B00C - R0018 - Movement (5.36 m2)

No Asbestos

B00C - R0019 - Movement (6.22 m2)

No Asbestos

B00C - R0020 - Movement (13.41 m2)

No Asbestos

B00C - R0021 - Distribution Board Cupboard (0.63 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
door backing	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R0021/door backing/S8					Chrysotile (white asbestos)	
B00C - R0022 - General Storeroom (2.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R0023 - Stairs (3.28 m2)						
No Asbestos						
B00C - R0024 - Stairs (3.28 m2)						
No Asbestos						
B00C - R0025 - Movement (233.18 m2)						
No Asbestos						
B00C - R0026 - Movement (10.68 m2)						
No Asbestos						
B00C - R0027 - Sports Store (11.04 m2)						
No Asbestos						
B00C - R0028 - General Assistants (16.42 m2)						
No Asbestos						
B00C - R1000 - Chair Store (11.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Hot water services flue pipes	Fibre Cement Pipe	4Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00B/R0052/flue pipe/S13					Chrysotile (white asbestos)	
B00C - R1002 - Staff Change (6.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R1003 - General Storeroom (5.61 m2)						
No Asbestos						
B00C - R1004 - Toilets-Boys (34.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R1005 - Shower/Change (37.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R1006 - Shower/Change (34.46 m2)						
Partition Walls (Cubicles)	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R1008 - Toilets-Girls (34.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00C/R1008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R1009 - General Storeroom (5.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R1010 - Staff Study (6.81 m2)

Ceiling Structures/Linings Flat AC Sheeting 7m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

8457/B00C/R1008/Ceiling Structures/Linings/S5

Chrysotile (white asbestos)

B00C - R1011 - Sport Equipment Store (11.22 m2)

Ceiling Structures/Linings Flat AC Sheeting 12m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

8457/B00C/R1008/Ceiling Structures/Linings/S5

Chrysotile (white asbestos)

B00C - R1012 - Stairs (11.22 m2)

No Asbestos

B00C - R1014 - Stairs (11.22 m2)

No Asbestos

B00C - R1017 - Movement (37.38 m2)

No Asbestos

B00C - R1018 - Staff Kitchen (6.83 m2)

No Asbestos

B00C - R1019 - Staff Study (32.04 m2)

No Asbestos

B00C - R1020 - Shared Learning Space (76.39 m2)

No Asbestos

B00C - R1021 - Practice/Seminar (77.02 m2)

No Asbestos

B00C - R1022 - Performance Workshop (77.87 m2)

No Asbestos

B00C - R1023 - Movement (13.6 m2)

No Asbestos

B00C - R1024 - Movement (13.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Science Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00D - R0097 - Staff Study (65.37 m2)**

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0098 - Stairs (6.88 m2)

No Asbestos

B00D - R0099 - Stairs (6.95 m2)

No Asbestos

B00D - R0100 - Movement (197.57 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0101 - Laboratory L.S. (83.98 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0102 - Apparatus Store (9.1 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0103 - Preparation (28.89 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0104 - Laboratory L.S. (91.12 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0105 - General Learning Space (57.62 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0106 - General Storeroom (4.67 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0107 - General Storeroom (4.56 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00D - R0108 - General Learning Space (50.15 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00D - R0109 - General Storeroom (9.73 m2)						
No Asbestos						
B00D - R0110 - Distribution Board Cupboard (0.74 m2)				Note: No inspection of live electrical installation.		
door backing	Flat AC Sheeting	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0110/door backing/S19					Chrysotile (white asbestos)	
B00D - R0111 - Toilets-Boys (28.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Flat AC Sheeting					No Asbestos Detected
8457/B00D/R0119/Partition Walls (Cubicles)/S15						
B00D - R0115 - Preparation (19.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00D - R0116 - Preparation (5.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00D - R0117 - Laboratory L.S. (91.61 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0118 - Apparatus Store (25.65 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00D - R0119 - Toilets-Girls (27.37 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Flat AC Sheeting					No Asbestos Detected
8457/B00D/R0119/Partition Walls (Cubicles)/S15						
B00D - R0120 - Computer Learning Space (50.03 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0121 - Cleaning Store - Distributed (3.73 m2)						
No Asbestos						
B00D - R0122 - Staff - Toilet (3.84 m2)						
No Asbestos						
B00D - R0123 - Distribution Board Cupboard (0.74 m2)						
Note: No inspection of live electrical installation.						
door backing	Flat AC Sheeting 8457/B00D/R0110/door backing/S19	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1199 - Stairs (6.88 m2)						
No Asbestos						
B00D - R1200 - Stairs (6.95 m2)						
No Asbestos						
B00D - R1201 - General Learning Space (57.15 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1207 - General Learning Space (51.48 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1208 - General Learning Space (52.14 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1209 - Computer Learning Space (57.25 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1210 - Music Store (5.05 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1211 - General Storeroom (5.58 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1212 - General Learning Space (51.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1213 - General Storeroom (5.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1214 - Distribution Board Cupboard (0.73 m2) Note: No inspection of live electrical installation.						
door backing	Flat AC Sheeting	4Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0110/door backing/S19				Chrysotile (white asbestos)		
Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit & live						
B00D - R1215 - General Learning Space (57.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1216 - Staff Study (25.46 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1217 - General Learning Space (52.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1218 - General Learning Space (52.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00D/R0116/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
B00D - R1219 - General Storeroom (10.74 m2)						
No Asbestos						
B00D - R1220 - Staff Study (38.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8457/B00D/R0119/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00D - R1221 - General Learning Space (51.05 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1222 - General Learning Space (44.43 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1223 - Staff - Toilet (3.67 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1224 - Movement (192.24 m2)						
No Asbestos						
B00D - R1225 - Distribution Board Cupboard (0.72 m2) Note: No inspection of live electrical installation.						
door backing	Flat AC Sheeting 8457/B00D/R0110/door backing/S19	4Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Sealed unit & live
B00D - R1226 - Movement (2.86 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1227 - Staff Study (37.88 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00D/R0116/Floor Coverings Res/Textile/S17	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1228 - Staff Study (9.13 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00D/R0119/Ceiling Structures/Linings/S16					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00E - R0001 - Computer Learning Space (49.55 m2)**

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0002 - Computer Learning Space (48.39 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0003 - Computer Store (8.82 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0004 - Staff Study (56.36 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0005 - Computer Learning Space (52.5 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0006 - General Storeroom (32.62 m2)

Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0007 - General Storeroom (4.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00E - R0008 - Toilets-Girls (13.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Flat AC Sheeting 8457/B00E/R0008/Partition Walls (Cubicles)/S22					No Asbestos Detected
Incinerette	Fibre Cement Pipe	6m	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Sealed unit no access
B00E - R0009 - Duplicating Workroom (17.68 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0010 - Seminar (12.78 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0011 - Workroom (12.78 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0014 - Librarian (12.89 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0015 - Administration - Clerical (44.89 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0016 - Audio Visual Workroom (46.86 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0017 - Toilets-Boys (13.82 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Flat AC Sheeting 8457/B00E/R0008/Partition Walls (Cubicles)/S22					No Asbestos Detected
B00E - R0018 - General Storeroom (5.59 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0019 - General Learning Space (54.36 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0020 - Movement (153.76 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0021 - Distribution Board Cupboard (0.24 m2)					Note: No inspection of live electrical installation.	
door backing	Flat AC Sheeting	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R1020/door backing/S26 Chrysotile (white asbestos)
B00E - R0022 - Cleaning Store - Distributed (4.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R0007/Floor Coverings Res/Textile/S21 Chrysotile (white asbestos)
B00E - R0023 - Maintenance Bulk Store (3.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R0007/Floor Coverings Res/Textile/S21 Chrysotile (white asbestos)
B00E - R0024 - Maintenance Bulk Store (3.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R0007/Floor Coverings Res/Textile/S21 Chrysotile (white asbestos)
B00E - R0025 - Distribution Board Cupboard (0.22 m2)					Note: No inspection of live electrical installation.	
door backing	Flat AC Sheeting	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R1020/door backing/S26 Chrysotile (white asbestos)
B00E - R0026 - Main Area (428.81 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0027 - Stairs (3.38 m2)					No Asbestos	
B00E - R0028 - Stairs (3.4 m2)					No Asbestos	
B00E - R1000 - Chemical Store (32.73 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R0007/Floor Coverings Res/Textile/S21 Chrysotile (white asbestos)
B00E - R1001 - Laboratory L.S. (92.05 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1002 - Preparation (24.31 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8457/B00E/R0007/Floor Coverings Res/Textile/S21 Chrysotile (white asbestos)
B00E - R1003 - Apparatus Store (0.97 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1004 - Laboratory L.S. (86.24 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00E - R1005 - Staff - Toilet (3.43 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00E - R1006 - General Learning Space (51.32 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1007 - Staff Study (13.05 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1008 - General Storeroom (6.42 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1009 - Computer Learning Space (59.29 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1010 - General Learning Space (52.63 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1011 - General Learning Space (54.05 m2)						
Ceiling Structures/Linings	Vermiculite					
8457/B00E/R0020/Ceiling Structures/Linings/S20				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00E - R1012 - Staff Study (26.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1013 - General Learning Space (61.14 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1014 - Staff - Toilet (3.27 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1015 - General Learning Space (52.22 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8457/B00E/R0007/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1016 - General Storeroom (5.89 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1017 - Staff Study (5.17 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1018 - Staff Study (15.48 m2)						
No Asbestos						
B00E - R1020 - Distribution Board Cupboard (1.18 m2)						
Note: No inspection of live electrical installation.						
door backing	Flat AC Sheeting 8457/B00E/R1020/door backing/S26	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1021 - Apparatus Store (12.89 m2)						
Ceiling Structures/Linings	Vermiculite 8457/B00E/R0020/Ceiling Structures/Linings/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8457/B00E/R0007/Floor Coverings Res/Textile/S21	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1022 - Movement (157.87 m2)						
No Asbestos						
B00E - R1023 - Distribution Board Cupboard (1.18 m2)						
Note: No inspection of live electrical installation.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
door backing	Flat AC Sheeting	6Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8457/B00E/R1020/door backing/S26					Chrysotile (white asbestos)	

B00E - R1024 - Stairs (7.58 m2)

No Asbestos

B00E - R1025 - Stairs (7.53 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Lift (2.09 m2)

No Asbestos

B00F - R1001 - Lift (2.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Technological & Applied Studies - 2014 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00G - R0001 - External Movement (267.34 m2)**

No Asbestos

B00G - R0002 - Project Store - Type 1 (38.71 m2)

No Asbestos

B00G - R0003 - Dust Extraction Space (12.2 m2)

No Asbestos

B00G - R0004 - Dark Room (22.26 m2)

No Asbestos

B00G - R0005 - General Learning Space (58.88 m2)

No Asbestos

B00G - R0006 - General Learning Space - Type 9 (58.32 m2)

No Asbestos

B00G - R0007 - Distribution Board Cupboard (1.62 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0009 - Stairs (15.57 m2)

No Asbestos

B00G - R0010 - Materials Workshop - Type 2 (113.12 m2)

No Asbestos

B00G - R0011 - Materials Workshop - Type 2 (113.37 m2)

No Asbestos

B00G - R0012 - External Stairs (11.75 m2)

No Asbestos

B00G - R0013 - General Learning Space - Type 8 (58.83 m2)

No Asbestos

B00G - R0014 - General Learning Space - Type 8 (58.91 m2)

No Asbestos

B00G - R0015 - Project Store - Type 1 (39.66 m2)

No Asbestos

B00G - R0016 - Welding Area (13.03 m2)

No Asbestos

B00G - R0017 - L.P.G. Store (1.08 m2)

No Asbestos

B00G - R0018 - Distribution Board Cupboard (2.3 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0019 - Darkroom Space (2.22 m2)

No Asbestos

B00G - R0020 - External Movement (2.78 m2)

No Asbestos

B00G - R0021 - External Stairs (8.68 m2)

No Asbestos

B00G - R1001 - External Movement (256.29 m2)

No Asbestos

B00G - R1002 - External Stairs (10.04 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	B00G - R1003 - Staff Study (51.47 m2)					
	No Asbestos					
	B00G - R1004 - Visual Arts Store (25.99 m2)					
	No Asbestos					
	B00G - R1005 - Project Store - Type 3 (26.84 m2)					
	No Asbestos					
	B00G - R1006 - Visual Arts Workshop (117.1 m2)					
	No Asbestos					
	B00G - R1007 - General Learning Space (56.68 m2)					
	No Asbestos					
	B00G - R1008 - General Learning Space - Type 5 (56.88 m2)					
	No Asbestos					
	B00G - R1009 - Distribution Board Cupboard (1.61 m2)				Note: No inspection of live electrical installation.	
	No Asbestos					
	B00G - R1011 - External Stairs (11.99 m2)					
	No Asbestos					
	B00G - R1012 - Visual Arts Workshop (97.41 m2)					
	No Asbestos					
	B00G - R1013 - General Learning Space - Type 4 (58.88 m2)					
	No Asbestos					
	B00G - R1014 - General Learning Space - Type 4 (58.88 m2)					
	No Asbestos					
	B00G - R1015 - Access Staff Shower/Toilet (7.99 m2)					
	No Asbestos					
	B00G - R1016 - Project Store - Type 3 (29.94 m2)					
	No Asbestos					
	B00G - R1017 - Kiln Space (15.56 m2)					
	No Asbestos					
	B00G - R1018 - Visual Arts Store (19.1 m2)					
	No Asbestos					
	B00G - R9001 - Outdoor Workshop (162.25 m2)					
	No Asbestos					
	B00G - R9002 - Dust Extraction Space (3.05 m2)					
	No Asbestos					
	B00G - R9003 - Distribution Board Cupboard (2.05 m2)				Note: No inspection of live electrical installation.	
	No Asbestos					
	B00G - R9005 - Cleaning Store - Distributed (5.86 m2)					
	No Asbestos					
	B00G - R9006 - Stairs (17.76 m2)					
	No Asbestos					
	B00G - R9007 - Materials Store (24.07 m2)					
	No Asbestos					
	B00G - R9009 - Lift (2.27 m2)					
	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Staff Facilities/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00H/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Ends	Flat AC Sheeting	5m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00H/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - General Learning Space (42.14 m2)**

No Asbestos

B00H - R0002 - Staff Study (14.75 m2)

No Asbestos

B00H - R0004 - Stairs (3.04 m2)

No Asbestos

B00H - R0005 - Movement (3.36 m2)

No Asbestos

B00H - R0006 - Movement (14.81 m2)

No Asbestos

B00H - R0007 - Staff Study (10.17 m2)

No Asbestos

B00H - R0008 - Study Space (22.27 m2)

No Asbestos

B00H - R0009 - Staff Shower (5.36 m2)

No Asbestos

B00H - R0010 - Study Space (26.6 m2)

No Asbestos

B00H - R0011 - Toilets-Girls (6.77 m2)

No Asbestos

B00H - R0012 - General Storeroom (0.5 m2)

No Asbestos

B00H - R0016 - Study Space (17.75 m2)

No Asbestos

B00H - R0017 - Movement (15.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8457/B00H/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00H - R0018 - Staff Kitchen (19.53 m2)

No Asbestos

B00H - R0019 - Distribution Board Cupboard (0.34 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R9008 - Movement (11.05 m2)

No Asbestos

B00H - R9009 - Movement (4.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting
 8457/B00H/R9008/Ceiling Structures/Linings/S23 **No Asbestos Detected**

B00H - R9010 - Stairs (0.34 m2)

No Asbestos

B00H - R9011 - Staff - Toilet (8.23 m2)

No Asbestos

B00H - R9012 - Staff Study (36.79 m2)

No Asbestos

B00H - R9013 - General Storeroom (3.46 m2)

No Asbestos

B00H - R9014 - General Storeroom (43.32 m2)

Ceiling Structures/Linings Flat AC Sheeting 44m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
 8457/B00H/R9014/Ceiling Structures/Linings/S25 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00H - R9015 - General Storeroom (14.15 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Multi Purpose Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00K - R0001 - Multi-Purpose Space (650.86 m2)**

No Asbestos

B00K - R0002 - Movement (22.19 m2)

No Asbestos

B00K - R0003 - Staff Study (16.11 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00K - R0004 - Tiered Learning Area (277.71 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00K - R0005 - General Storeroom (76.37 m2)**

No Asbestos

B00K - R0006 - Control Room (4.92 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00K - R0007 - Ramp (3.4 m2)**

No Asbestos

B00K - R0008 - Public Entry (60.27 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00K - R0009 - Administration - Clerical (5.88 m2)**

No Asbestos

B00K - R0010 - Staff Kitchen (9.23 m2)

No Asbestos

B00K - R0011 - Shower/Change (22.04 m2)

No Asbestos

B00K - R0020 - Main Switchroom (2.02 m2)

No Asbestos

B00K - R0021 - Shower/Change (21.8 m2)

No Asbestos

B00K - R0022 - Sport Equipment Store (20.33 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00K - R0023 - Chair Store (22.64 m2)**

No Asbestos

B00K - R9006 - Movement (8.41 m2)

No Asbestos

B00K - R9007 - Ramp (1.32 m2)

No Asbestos

B00K - R9008 - Movement (11.18 m2)

No Asbestos

B00K - R9009 - Tiered Learning Store (35.82 m2)

No Asbestos

B00K - R9010 - Staff Toilet (1.68 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00K - R9013 - Movement (37.04 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00K - R9014 - Toilets-Girls (8.76 m2)						
No Asbestos						
B00K - R9016 - Toilets-Disabled (2.77 m2)						
No Asbestos						
B00K - R9017 - Toilets-Boys (9.36 m2)						
No Asbestos						
B00K - R9020 - Tiered Learning Store (27.97 m2)						
No Asbestos						
B00K - R9021 - Tiered Learning Store (23.76 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 600 - D10162 - Learning Unit - Small : Placement Date - 16/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 601 - D10562 - Learning Unit - Standard/Withdrawal : Placement Date - 16/04/2013

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

NS 220 - D13228 - Science Learning/Preparation Space : Placement Date - 3/01/2007

Exterior

No Asbestos Found.

Interior

R1 - Laboratory L.S.

No Asbestos Found.

R2 - Preparation

No Asbestos Found.

R3 - Entry

No Asbestos Found.

OS 600 - D13437 - Learning Unit - Small : Placement Date - 16/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 600 - D13988 - Learning Unit - Small : Placement Date - 16/12/2016

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
OS 840 - D14176 - Girls Toilet : Placement Date - 10/03/2009						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Toilets-Girls						
No Asbestos Found.						
OS 601 - D14533 - Learning Unit - Standard/Withdrawal : Placement Date - 27/11/2008						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 841 - D16090 - Boys Toilet : Placement Date - 10/03/2009						
Exterior						
No Asbestos Found.						
Interior						
R1 - Toilets-Boys						
No Asbestos Found.						
OS 601 - D17665 - Learning Unit - Standard/Withdrawal : Placement Date - 27/11/2007						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						
OS 601 - D17670 - Learning Unit - Standard/Withdrawal : Placement Date - 27/11/2008						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
OS 601 - D17889 - Learning Unit - Standard/Withdrawal : Placement Date - 15/04/2013						
Exterior						
No Asbestos Found.						
Interior						
R1 - Entry						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8457_ASB_070211_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017