


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Koorungal High School (8483)  
**Region :** Riverina  
**State Electorate :** Wagga Wagga  
**Local Government Area :** Wagga Wagga

**Initial Survey :** Noel Arnold & Associates : 01 - May - 2008  
**Reviewed By :** Greencap-NAA : 18 - Feb - 2015

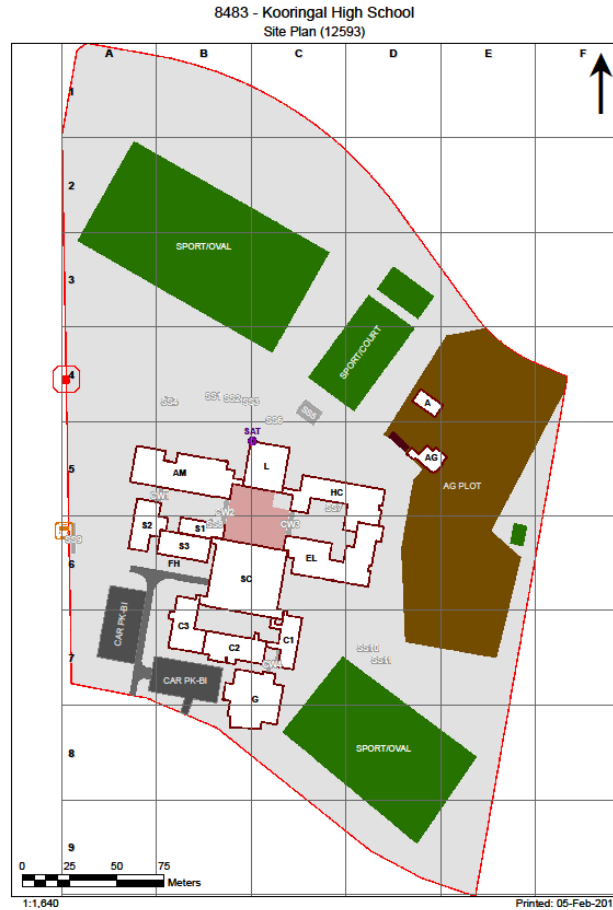

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Agricultural Science - 2005 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00A - R0001 - Machine Storage (107.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Performing Arts - 2007 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Raked Ceiling  
Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab on Ground

**Interior****B00G - R0001 - Performance Workspace (331.99 m2)**

No Asbestos

**B00G - R0002 - Cleaning Supplies Store (4.88 m2)**

No Asbestos

**B00G - R0003 - Toilets-Boys (17.47 m2)**

No Asbestos

**B00G - R0004 - Store (22.28 m2)**

No Asbestos

**B00G - R0005 - Control Room (12.04 m2)**

No Asbestos

**B00G - R0006 - Movement (8.36 m2)**

No Asbestos

**B00G - R0007 - Change (34.88 m2)**

No Asbestos

**B00G - R0008 - Change (36.26 m2)**

No Asbestos

**B00G - R0011 - Movement (8.56 m2)**

No Asbestos

**B00G - R0012 - Store (34.85 m2)**

No Asbestos

**B00G - R0013 - Other (19.53 m2)**

No Asbestos

**B00G - R0014 - Toilets-Girls (17.76 m2)**

No Asbestos

**B00G - R0015 - Toilets-Disabled (5.5 m2)**

No Asbestos

**B00G - R0017 - Plant (31.15 m2)**

No Asbestos

**B00G - R0018 - Distribution Board Cupboard (0.53 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0021 - Covered Area (78.67 m2)**

No Asbestos

**B00G - R0022 - Covered Area (34.99 m2)**

No Asbestos

**B00G - R0023 - External Movement (17.03 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 1977 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

**Interior****B00L - R0002 - Cleaning Store - Distributed (1.67 m2)**

No Asbestos

**B00L - R0003 - General Storeroom (5.8 m2)**

No Asbestos

**B00L - R0004 - Staff - Toilet (4.04 m2)**

No Asbestos

**B00L - R0005 - Workroom (47.1 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0006 - Main Area (206.14 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0007 - Librarian (15.05 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0008 - Staff - Toilet (4.08 m2)**

No Asbestos

**B00L - R0009 - General Storeroom (7.58 m2)**

No Asbestos

**B00L - R0010 - Audio Visual Workroom (46.32 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0011 - External Movement (57.49 m2)**

No Asbestos

**B00L - R0012 - Stairs (0.19 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0013 - Movement (57.84 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R0014 - Stairs (0.19 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R1001 - Seminar (15.4 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works***B00L - R1003 - Seminar (15.4 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1004 - Seminar (15.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1005 - Workroom (15.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1006 - Seminar (15.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1007 - External Movement (55.92 m2)</b>						
No Asbestos						
<b>B00L - R1008 - Cleaning Store - Distributed (0.93 m2)</b>						
No Asbestos						
<b>B00L - R1010 - General Learning Space (37.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1011 - Computer Learning Space (58.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1013 - Distribution Board Cupboard (0.93 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00L - R1014 - Main Area (126.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1015 - Stairs (3.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1016 - Stairs (3.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0AG - Agricultural Science - 1977 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior****B0AG - R0001 - Shower/Change (7.47 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	

**B0AG - R0002 - Machine Storage (33.56 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	

**B0AG - R0003 - Animal Space (8.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	
Stored Cement Sheeting	Compressed AC Sheet	8483/B0AG/R0003/Stored Cement Sheeting/S22			<b>No Asbestos Detected</b>	

**B0AG - R0004 - Plant (7.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	
Bench Top	Compressed AC Sheet	8483/B0AG/R0004/Bench Top/S23			<b>No Asbestos Detected</b>	

**B0AG - R0006 - Agriculture Covered Area (56.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	

**B0AG - R0007 - External Movement (2.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	

**B0AG - R0008 - Agriculture Covered Area (6.18 m2)**

No Asbestos

**B0AG - R0009 - Class Tools Storage (13.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AG/R0009/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0AM - General Learning/Administration - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

**Interior**

**B0AM - R0002 - Cleaning Supplies Store (9.04 m2)**

No Asbestos

**B0AM - R0004 - Staff - Toilet (5.05 m2)**

No Asbestos

**B0AM - R0005 - Staff - Toilet (5.05 m2)**

No Asbestos

**B0AM - R0006 - Deputy Principal Office (22.25 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0007 - General Storeroom (9.48 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8						<b>Chrysotile (white asbestos)</b>

**B0AM - R0008 - Ancillary Staff (26.34 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0010 - Cleaning Store - Distributed (5.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8						<b>Chrysotile (white asbestos)</b>

**B0AM - R0011 - Commonroom (117.36 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0012 - General Storeroom (10.42 m2)**

No Asbestos

**B0AM - R0013 - External Movement (26.93 m2)**

No Asbestos

**B0AM - R0014 - Leading Teacher (14.62 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0015 - Clinic - Girls (14.57 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0016 - Commonroom (100.36 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0017 - Staff Study (13.57 m2)**

Ceiling Structures/Linings Vermiculite  
 8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0AM - R0018 - Staff Study (13.57 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0019 - General Storeroom (3.42 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0AM - R0022 - Interview/Office - Type 1 (12.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0023 - Toilets-Boys (6.04 m2)</b>						
No Asbestos						
<b>B0AM - R0024 - Toilets-Girls (6.41 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 8483/B0HC/R1004/Partition Walls (Cubicles)/S4	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0AM - R0025 - Movement (53.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0026 - Staff Study (11.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0027 - Staff Study (11.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0028 - Commonroom (10.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0AM - R0030 - Clinic-Waiting (5.71 m2)</b>						
No Asbestos						
<b>B0AM - R0031 - Distribution Board Cupboard (1.43 m2)</b>						
No Asbestos						
<b>B0AM - R0032 - Duplicating Workroom (13.86 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0AM - R0033 - Staff - Toilet (3.37 m2)</b>						
No Asbestos						
<b>B0AM - R0034 - General Storeroom (1.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0AM - R0035 - Principal Office (22.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0AM - R0036 - Public Entry (46.61 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R0037 - External Movement (101.67 m2)</b>						
No Asbestos						
<b>B0AM - R0038 - External Movement (12.51 m2)</b>						
No Asbestos						
<b>B0AM - R0039 - External Movement (12.76 m2)</b>						
No Asbestos						
<b>B0AM - R0040 - External Movement (8.85 m2)</b>						
No Asbestos						
<b>B0AM - R0041 - Clerical Office (41.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R0042 - Public Entry (15.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R0043 - External Stairs (14.63 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B0AM - R0044 - External Stairs (13.04 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B0AM - R0045 - Clerical Office (25.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R0046 - Movement (3.48 m2)</b>						
No Asbestos						
<b>B0AM - R0047 - Staff - Toilet (16.13 m2)</b>						
No Asbestos						
<b>B0AM - R0048 - Movement (3.61 m2)</b>						
No Asbestos						
<b>B0AM - R0049 - No Access (17.1 m2)</b>						
No Asbestos						
<b>B0AM - R1001 - Staff Study (30.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R1003 - Interview/Office - Type 1 (12.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R1004 - Leading Teacher (16.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0AM - R1005 - Resources Store (6.2 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B0AM - R1006 - Leading Teacher (16.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B0AM - R1007 - Clinic - Boys (12.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B0AM - R1008 - Toilets-Girls (18.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4				<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4				<b>Chrysotile (white asbestos)</b>		
<b>B0AM - R1009 - Distribution Board Cupboard (0.88 m2)</b>						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0AM - R1010 - Toilets-Boys (17.49 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0AM - R1011 - Cleaning Store - Distributed (1.68 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0AM - R1012 - General Storeroom (39.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		
<b>B0AM - R1013 - Movement (75.35 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B0AM - R1014 - External Movement (60.13 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0AM - R1015 - General Learning Space (53.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1016 - General Learning Space (62.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1017 - General Learning Space (62.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1018 - General Learning Space (53.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1019 - General Learning Space (20.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0AM/R1005/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1020 - General Learning Space (53.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1021 - General Learning Space (52.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1022 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0AM - R1023 - External Movement (79.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0AM - R1024 - External Stairs (9.28 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0AM - R1025 - External Stairs (10.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C1 - Technological & Applied Studies - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab  
on Ground

**Interior****B0C1 - R0001 - Darkroom Space (23.44 m2)**

No Asbestos

**B0C1 - R0002 - Art Learning Space (79.76 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Sheet  
8483/B0C1/R0002/Floor Coverings Res/Textile/S15 **No Asbestos Detected**

**B0C1 - R0003 - Art Learning Space (75.61 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Sheet  
8483/B0C1/R0003/Floor Coverings Res/Textile/S16 **No Asbestos Detected**

**B0C1 - R0004 - Movement (4.2 m2)**

Ceiling Structures/Linings Flat AC Sheeting 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
8483/B0HC/R1014/Ceiling Structures/Linings/S5 **Chrysotile (white asbestos)**

**B0C1 - R0005 - Distribution Board Cupboard (0.62 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0C1 - R0006 - Staff Study (11.22 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

Floor Coverings Res/Textile Vinyl Tiles 12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
8483/B0SC/R1014/Floor Coverings Res/Textile/S14 **Chrysotile (white asbestos)**

**B0C1 - R0008 - External Movement (37.83 m2)**

No Asbestos

**B0C1 - R0009 - Kiln Space (10.4 m2)**

Kiln Encapsulated Insulation material within unit  
8483/B0C1/R0009/Interior of electric kiln/S17 **No Asbestos Detected**

**B0C1 - R0010 - External Movement (4.97 m2)**

No Asbestos

**B0C1 - R0011 - Lift (2.52 m2)**

No Asbestos

**B0C1 - R0012 - Movement (4.97 m2)**

Ceiling Structures/Linings Flat AC Sheeting 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)  
8483/B0HC/R1014/Ceiling Structures/Linings/S5 **Chrysotile (white asbestos)**

**B0C1 - R0013 - External Movement (7.93 m2)**

No Asbestos

**B0C1 - R0014 - Movement (1.29 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1001 - Staff Study (19.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8483/B0HC/R0008/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
<b>B0C1 - R1002 - Design L.S. (69.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8483/B0HC/R0008/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B0C1 - R1005 - Computer Learning Space (69.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8483/B0HC/R0008/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
<b>B0C1 - R1006 - Movement (5.25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1007 - Distribution Board Cupboard (0.62 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B0C1 - R1008 - Staff Study (13.5 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8483/B0HC/R0008/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)	
<b>B0C1 - R1010 - External Movement (55.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1011 - Movement (2.35 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1012 - External Movement (7.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1013 - Movement (4.59 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1014 - Lift (2.52 m2)</b>						
No Asbestos						
<b>B0C1 - R1015 - Movement (1.29 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
<b>B0C1 - R1016 - Computer Store (11.79 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0C1/R1016/Ceiling Structures/Linings/S26					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0SC/R1014/Floor Coverings Res/Textile/S14	11.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C2 - Technological & Applied Studies - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

**Interior****B0C2 - R0001 - Art Learning Space (65.04 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0SC/R1014/Floor Coverings Res/Textile/S14	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B0C2 - R0005 - Dust Extraction Space (8.77 m2)**

No Asbestos

**B0C2 - R0007 - Cleaning Store - Distributed (5.9 m2)**

No Asbestos

**B0C2 - R0008 - Distribution Board Cupboard (0.81 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0C2 - R0009 - External Movement (62.29 m2)**

No Asbestos

**B0C2 - R0013 - Materials Store (28.08 m2)**

No Asbestos

**B0C2 - R0017 - Project Store - Type 1 (12.49 m2)**

No Asbestos

**B0C2 - R0018 - Project Store - Type 1 (12.45 m2)**

No Asbestos

**B0C2 - R0019 - Wood Technology Bay (194.55 m2)**

Recently Modified Space Requires Inspection

**B0C2 - R1001 - Cleaning Store - Distributed (11.07 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0SC/R1014/Floor Coverings Res/Textile/S14	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B0C2 - R1002 - General Learning Space (31.53 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0SC/R1014/Floor Coverings Res/Textile/S14	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B0C2 - R1007 - Food Technology L.S. (94.29 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0SC/R1014/Floor Coverings Res/Textile/S14	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B0C2 - R1008 - Distribution Board Cupboard (0.62 m2)**

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0C2 - R1009 - External Movement (63.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0C2 - R1010 - Kitchen - Type 2 (101.62 m2)</b>						
No Asbestos						
<b>B0C2 - R1011 - Other (14.68 m2)</b>						
No Asbestos						
<b>B0C2 - R1012 - Preparation - Materials (15.1 m2)</b>						
No Asbestos						
<b>B0C2 - R1013 - Pantry (8.43 m2)</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C3 - Technological & Applied Studies - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab on Ground

**Interior**

**B0C3 - R0003 - Distribution Board Cupboard (0.61 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0C3 - R0010 - General Assistants (13.16 m2)**

No Asbestos

**B0C3 - R0011 - Staff - Toilet (4.29 m2)**

No Asbestos

**B0C3 - R0012 - External Movement (52.21 m2)**

No Asbestos

**B0C3 - R0015 - Materials Store (18.63 m2)**

No Asbestos

**B0C3 - R0016 - Welding Store (20.6 m2)**

No Asbestos

**B0C3 - R0017 - Welding Area (122 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0C1/R1016/Ceiling Structures/Linings/S26

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0C3 - R0018 - Design L.S. (63.91 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0C1/R1016/Ceiling Structures/Linings/S26

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0C3 - R0019 - Workshop Area (69.43 m2)**

No Asbestos

**B0C3 - R0020 - Project Store - Type 1 (11.19 m2)**

No Asbestos

**B0C3 - R1001 - Staff Study (55.71 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1

Limited Samples Taken

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile	Vinyl Tiles	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0SC/R1014/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B0C3 - R1002 - Staff - Toilet (10.32 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B0C3 - R1003 - Staff - Toilet (10.35 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Incinerette	Millboard	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Area inaccessible**

**B0C3 - R1004 - Distribution Board Cupboard (0.63 m2)** Note: No inspection of live electrical installation.

No Asbestos

**B0C3 - R1005 - General Learning Space (66.23 m2)**

Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B0C3 - R1006 - Computer Learning Space (22.94 m2)**

Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0SC/R1014/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B0C3 - R1007 - General Learning Space (66.33 m2)**

Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B0C3 - R1008 - Pupil Entry (7.12 m2)**

Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Sheet					
	8483/B0SC/R0024/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>

**B0C3 - R1009 - External Movement (51.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0EL - Senior Learning - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible

**Interior**

**B0EL - R0001 - General Learning Space (53.78 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0002 - General Learning Space (49.98 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	49.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0003 - General Learning Space (67.01 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	67.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0004 - General Learning Space (52.4 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	52.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0005 - Staff Study (45.93 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0006 - General Storeroom (5.6 m2)**

Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

**B0EL - R0007 - Distribution Board Cupboard (0.76 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0EL - R0008 - Cleaning Store - Distributed (0.53 m2)**

No Asbestos

**B0EL - R0009 - Staff Study (25.36 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0010 - General Learning Space (52.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	52.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0011 - General Learning Space (54.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	54.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0012 - General Storeroom (22.1 m2)</b>						
No Asbestos						
<b>B0EL - R0013 - Toilets-Boys (25.46 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 8483/B0HC/R1004/Partition Walls (Cubicles)/S4	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0014 - Cleaning Store - Distributed (2.54 m2)</b>						
No Asbestos						
<b>B0EL - R0015 - Toilets-Girls (24.72 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 8483/B0HC/R1004/Partition Walls (Cubicles)/S4	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0016 - General Learning Space (53.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	53.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0017 - Maintenance Bulk Store (16.95 m2)</b>						
No Asbestos						
<b>B0EL - R0020 - Student Drinking Facilities (5.79 m2)</b>						
No Asbestos						
<b>B0EL - R0021 - General Storeroom (17.65 m2)</b>						
No Asbestos						
<b>B0EL - R0022 - General Learning Space (63.44 m2)</b>						
No Asbestos						
<b>B0EL - R0023 - External Movement (159.98 m2)</b>						
No Asbestos						
<b>B0EL - R0024 - External Stairs (8.49 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R0025 - Stairs (0.28 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0EL - R0026 - External Movement (47.49 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0EL - R1001 - General Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	52.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1002 - General Learning Space (50.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	50.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1003 - General Learning Space (65.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	65.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1004 - General Learning Space (52.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1005 - Staff Study (44.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	44.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1006 - General Storeroom (4.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	4.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0EL/R1009/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B0EL - R1007 - Distribution Board Cupboard (0.73 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B0EL - R1008 - Cleaning Store - Distributed (0.52 m2)</b>						
No Asbestos						
<b>B0EL - R1009 - Staff Study (25.45 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1010 - General Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	52.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1011 - Art Learning Space (53.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1012 - General Learning Space (52.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	52.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1013 - General Learning Space (53.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0EL/R1009/Floor Coverings Res/Textile/S7	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1017 - External Movement (158.37 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	165m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1018 - External Stairs (16.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1019 - External Stairs (7.75 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0EL - R1020 - External Movement (42.96 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0HC - General Learning - 1977 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground

Ceiling Voids - Flat Roof Non Accessible Area  
- Area inaccessible**Interior****B0HC - R0001 - General Learning Space (66.25 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0HC - R0002 - General Learning Space (66.85 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0HC - R0003 - General Storeroom (18.34 m2)**

No Asbestos

**B0HC - R0006 - No Access (13.43 m2)**

No Asbestos

**B0HC - R0007 - Cleaning Store - Distributed (2.33 m2)**

No Asbestos

**B0HC - R0008 - Special Learning Space (52.69 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles  
8483/B0HC/R0012/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

**B0HC - R0009 - General Learning Space (52.83 m2)**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

Floor Coverings Res/Textile Vinyl Tiles  
8483/B0HC/R0012/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

**B0HC - R0010 - Distribution Board Cupboard (0.72 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0HC - R0011 - Staff Study (42.07 m2)**

Floor Coverings Res/Textile Vinyl Tiles  
8483/B0HC/R0012/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0HC - R0012 - General Storeroom (4.08 m2)**

Floor Coverings Res/Textile Vinyl Tiles  
8483/B0HC/R0012/Floor Coverings Res/Textile/S3 **No Asbestos Detected**

Ceiling Structures/Linings Vermiculite  
8483/B0HC/R0008/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B0HC - R0013 - Cleaning Store - Distributed (0.52 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0HC - R0014 - Resources (26.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0HC - R0015 - General Learning Space (51.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R0016 - External Movement (203.07 m2)</b>						
No Asbestos						
<b>B0HC - R0017 - Student Drinking Facilities (6.23 m2)</b>						
No Asbestos						
<b>B0HC - R0019 - Special Learning Space (17.17 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8483/B0HC/R0018/Wall Linings Internal/S2					No Asbestos Detected
<b>B0HC - R0021 - External Stairs (7.17 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0HC - R0022 - External Stairs (11.26 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
<b>B0HC - R0023 - External Movement (18.2 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8483/B0HC/R0023/Ceiling Structures/Linings/S24					No Asbestos Detected
<b>B0HC - R0024 - Movement (4.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8483/B0HC/R0023/Ceiling Structures/Linings/S24					No Asbestos Detected
<b>B0HC - R0026 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B0HC - R0027 - Movement (5.29 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8483/B0HC/R0023/Ceiling Structures/Linings/S24					No Asbestos Detected
<b>B0HC - R0028 - External Movement (10.86 m2)</b>						
No Asbestos						
<b>B0HC - R0029 - Toilets-Disabled (9.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8483/B0HC/R0023/Ceiling Structures/Linings/S24					No Asbestos Detected
<b>B0HC - R0030 - Movement (3.68 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B0HC - R0031 - Toilets-Girls (1.41 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B0HC - R0032 - Toilets-Boys (1.41 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B0HC - R1001 - General Learning Space (65.89 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R1002 - General Learning Space (65.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R1004 - Toilets-Girls (23.38 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B0HC - R1005 - Cleaning Store - Distributed (2.33 m2)</b>						
No Asbestos						
<b>B0HC - R1006 - General Learning Space (52.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R1007 - Computer Learning Space (73.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R1008 - Distribution Board Cupboard (0.77 m2)</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B0HC - R1009 - Resources (19.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B0HC - R1010 - General Storeroom (5.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0HC/R0012/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B0HC - R1011 - Cleaning Store - Distributed (0.57 m2)</b>						
No Asbestos						
<b>B0HC - R1012 - Staff Study (24.26 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Limited Samples Taken</b>	
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles					
	8483/B0HC/R0012/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>	
<b>B0HC - R1013 - General Learning Space (52.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8483/B0HC/R0008/Ceiling Structures/Linings/S1				<b>Limited Samples Taken</b>	
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles					
	8483/B0HC/R0012/Floor Coverings Res/Textile/S3				<b>No Asbestos Detected</b>	
<b>B0HC - R1014 - External Movement (175.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	186m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1015 - External Stairs (26.05 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1016 - External Stairs (13.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1017 - External Movement (13.07 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1018 - Movement (4.2 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1019 - Movement (5.28 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0HC - R1020 - External Movement (9.62 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0S1 - Science Learning - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids Non Accessible Area  
- Area inaccessible

Underfloor Voids - Slab  
on Ground

**Interior****B0S1 - R0001 - General Storeroom (15.31 m2)**

No Asbestos

**B0S1 - R0002 - Toilets-Girls (20.43 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B0S1 - R0003 - Toilets-Boys (17.62 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B0S1 - R0004 - Cleaning Store - Distributed (1.68 m2)**

No Asbestos

**B0S1 - R0005 - Staff Study (26.05 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite					
8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B0S1 - R0006 - Distribution Board Cupboard (0.86 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0S1 - R0007 - General Storeroom (37.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B0S1 - R0008 - External Movement (41.46 m2)**

No Asbestos

**B0S1 - R0009 - External Stairs (5.67 m2)**

No Asbestos

**B0S1 - R1001 - General Storeroom (19.71 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

**B0S1 - R1002 - General Storeroom (17.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>	

**B0S1 - R1003 - Chemical Store (8.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1004 - Growing/Breeding (12.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1005 - Movement (4.34 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1006 - Distribution Board Cupboard (0.88 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B0S1 - R1007 - Apparatus Store (36.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1008 - Cleaning Store - Distributed (1.6 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1009 - External Movement (35.3 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S1 - R1010 - External Stairs (8.28 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B0S2 - Science Learning - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

**Interior**

**B0S2 - R0001 - General Storeroom (13.2 m2)**

No Asbestos

**B0S2 - R0002 - Laboratory L.S. (93.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1		<b>Limited Samples Taken</b>		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0S2 - R0003 - Preparation (45.59 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1		<b>Limited Samples Taken</b>		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0S2 - R0004 - Distribution Board Cupboard (0.61 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0S2 - R0005 - General Storeroom (3.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1		<b>Limited Samples Taken</b>		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0S2 - R0006 - Laboratory L.S. (93.73 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1		<b>Limited Samples Taken</b>		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B0S2 - R0007 - Student Drinking Facilities (7.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		

**B0S2 - R0008 - External Movement (54.79 m2)**

No Asbestos

**B0S2 - R0009 - External Stairs (10.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		

**B0S2 - R1001 - Laboratory L.S. (92.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0S2 - R1002 - Distribution Board Cupboard (0.55 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B0S2 - R1003 - Laboratory L.S. (92.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0S2 - R1004 - Preparation (45.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0S2 - R1005 - Apparatus Store (3.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8483/B0AM/R1005/Floor Coverings Res/Textile/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8483/B0HC/R0008/Ceiling Structures/Linings/S1					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B0S2 - R1006 - External Movement (57.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B0S2 - R1007 - External Stairs (13.07 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8483/B0HC/R1014/Ceiling Structures/Linings/S5	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0S3 - Science Learning - 1973 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof

Underfloor Voids - Slab on Ground

**Interior****B0S3 - R0001 - Laboratory L.S. (93.93 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R0002 - Preparation (50.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R0003 - Lift (3.6 m2)**

No Asbestos

**B0S3 - R0004 - Laboratory L.S. (94.02 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R0005 - Apparatus Store (0.86 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R0006 - External Movement (64.47 m2)**

No Asbestos

**B0S3 - R1001 - Laboratory L.S. (92.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R1002 - Preparation (50.09 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	8483/B0HC/R0008/Ceiling Structures/Linings/S1			<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B0S3 - R1004 - Apparatus Store (3.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0S3 - R1005 - Laboratory L.S. (90.53 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8483/B0HC/R0008/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B0S3 - R1006 - External Movement (64.47 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0S3 - R1007 - Lift (0.88 m2)</b>						
No Asbestos						
<b>B0S3 - R1008 - Plant (0.64 m2)</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0SC - Multi Purpose Facilities/Pupil Facilities - 1973 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground

Ceiling Voids - Flat Roof

**Interior**

**B0SC - R0001 - Sport Equipment Store (61.79 m2)**

No Asbestos

**B0SC - R0003 - Sport Equipment Store (8.29 m2)**

No Asbestos

**B0SC - R0004 - Main Switchroom (9.57 m2)**

No Asbestos

**B0SC - R0005 - Cleaning Store - Distributed (2.02 m2)**

No Asbestos

**B0SC - R0006 - Sport Equipment Store (8.59 m2)**

No Asbestos

**B0SC - R0007 - Performance Workspace (99.28 m2)**

No Asbestos

**B0SC - R0008 - Performing Arts Changeroom (17.9 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B0SC - R0009 - Sport Equipment Store (4.98 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8483/B0SC/R0009/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>

**B0SC - R0012 - Shower/Change (3.25 m2)**

No Asbestos

**B0SC - R0014 - Shower/Change (11.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0SC/R0014/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

**B0SC - R0015 - Staff - Toilet (11.09 m2)**

Incinerette	Millboard	1Unit	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						

Floor Coverings Res/Textile	Vinyl Sheet	11.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0AM/R1005/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B0SC - R0016 - Pantry (11.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8483/B0SC/R0016/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

**B0SC - R0018 - Chair Store (33.72 m2)**

No Asbestos

**B0SC - R0020 - External Movement (341.96 m2)**

No Asbestos

**B0SC - R0021 - General Storeroom (7.97 m2)**

No Asbestos

**B0SC - R0022 - External Stairs (0.49 m2)**

No Asbestos

**B0SC - R0023 - Movement (26.63 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B0SC - R0024 - Staff Study (8.95 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8483/B0SC/R0024/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B0SC - R0025 - Staff Study (25.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8483/B0SC/R0024/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>
<b>B0SC - R0026 - Multi-Purpose Space (459.51 m2)</b>						
No Asbestos						
<b>B0SC - R0027 - General Storeroom (44.27 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R0028 - Staff Toilet (5.72 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R0029 - Toilets - Girls (5.92 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1004/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R0030 - Change (34.3 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0SC/R0014/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R0031 - External Stairs (0.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R0032 - General Storeroom (7.25 m2)</b>						
No Asbestos						
<b>B0SC - R0033 - Movement (3.67 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B0SC - R0034 - Student Canteen (51.47 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B0SC - R1001 - Sport Equipment Store (41.96 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	41.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R1002 - Performing Arts Store (12.95 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles	12.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0SC/R1014/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R1003 - Performing Arts Store (11.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
<b>B0SC - R1004 - Control Room (13.97 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1005 - Music Learning Space (78.93 m2)</b>						
No Asbestos						
<b>B0SC - R1006 - Music Learning Space (66.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8483/B0SC/R1008/Ceiling Structures/Linings/S13				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B0SC - R1007 - Practice/Seminar (5.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8483/B0SC/R1008/Ceiling Structures/Linings/S13				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B0SC - R1008 - Music Store (9.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8483/B0SC/R1008/Ceiling Structures/Linings/S13				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B0SC - R1009 - Staff Study (13.46 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1010 - Maintenance Bulk Store (12.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1011 - Staff Study (11.56 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Tiles	11.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting					
8483/B0SC/R1011/Wall Linings Internal/S25				<b>No Asbestos Detected</b>		
<b>B0SC - R1012 - Toilets-Boys (6.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1013 - Cleaning Store - Distributed (2.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1014 - Shower/Change (34.08 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1015 - Shower/Change (45.38 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5				<b>Chrysotile (white asbestos)</b>		
<b>B0SC - R1016 - Shower/Change (32.41 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0SC/R1014/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>	
<b>B0SC - R1017 - Cleaning Store - Distributed (2.72 m2)</b>						
No Asbestos						
<b>B0SC - R1018 - Toilets-Boys (6.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0SC - R1019 - Movement (21.92 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0SC - R1020 - External Movement (290.54 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	120m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8483/B0HC/R1014/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B0SC - R1021 - Control Room (25.45 m2)</b>						
No Asbestos						
<b>B0SC - R1022 - External Stairs (7.19 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Build+1 - The PAV**

**Exterior**

No Asbestos

**Interior**

**Build+1 - Room+1 - All rooms**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017