


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kanahooka High School (8489)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 18 - Dec - 2009
Reviewed By : Grencap-NAA : 26 - Aug - 2014

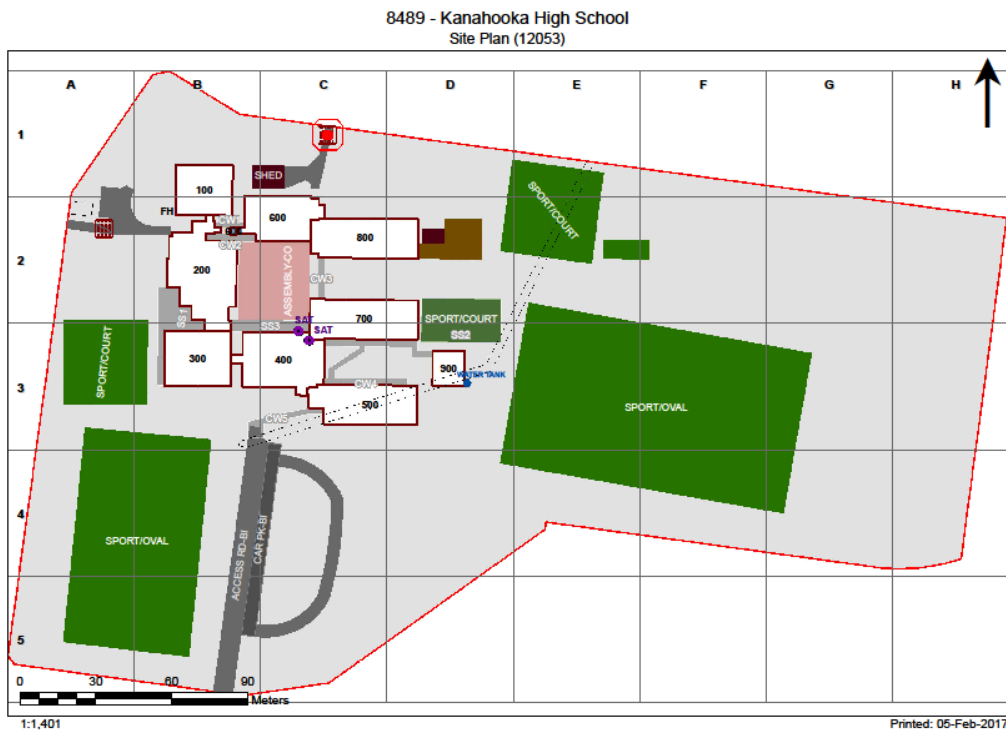

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B100 - Technological & Applied Studies/Art - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B100 - R0001 - Materials Technology L.S. (82.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	82.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B100/R1005/Ceiling Structures/Linings/S34				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							

B100 - R0002 - Toilets-Boys (67 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B300/R0001/Partition Walls (Cubicles)/S4						Chrysotile (white asbestos)

B100 - R0003 - Distribution Board Cupboard (2.61 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

B100 - R0004 - Cleaning Store - Distributed (1.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

B100 - R0005 - Movement (37.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B100/R1005/Ceiling Structures/Linings/S34				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							

B100 - R0006 - Art Learning Space (77.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B100/R1005/Ceiling Structures/Linings/S34				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							

B100 - R0007 - Resources Store (7.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B100/R1005/Ceiling Structures/Linings/S34				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							

B100 - R0008 - General Storeroom (18.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8489/B100/R1003/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B100/R1005/Ceiling Structures/Linings/S34				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>							

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B100 - R0009 - Materials Technology L.S. (82.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R0010 - Materials Store (20.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R0011 - Welding Area (10.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R0012 - External Movement (1.64 m2)						
No Asbestos						
B100 - R0013 - External Movement (6.39 m2)						
No Asbestos						
B100 - R1001 - Materials Technology L.S. (82.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1002 - Distribution Board Cupboard (0.88 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1002/Ceiling Structures/Linings/S37					Chrysotile (white asbestos)
B100 - R1003 - Materials Store (12.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1004 - Design L.S. (52.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1005 - Movement (51.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1006 - External Movement (1.62 m2)						
No Asbestos						
B100 - R1007 - Staff Study (25.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1007/Floor Coverings Res/Textile/S35					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	25.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1007/Floor Coverings Res/Textile/S36					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1008 - Design L.S. (52.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1009 - Materials Store (12.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1010 - Cleaning Store - Distributed (0.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B100/R1003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1011 - Materials Technology L.S. (82.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1012 - Materials Store (21.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B100 - R1013 - Materials Store (10.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B100/R1005/Ceiling Structures/Linings/S34					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B200 - Multi Purpose Facilities/Pupil Facilities - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B200 - R0001 - Multi-Purpose Space (309.14 m2)

Ceiling Structures/Linings	Vermiculite 8489/B200/R1001/Ceiling Structures/Linings/S28	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B200 - R0002 - Movement (74.19 m2)

Ceiling Structures/Linings	Vermiculite 8489/B200/R1001/Ceiling Structures/Linings/S28	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B200 - R0003 - Sport Equipment Store (34.11 m2)

No Asbestos

B200 - R0004 - Main Switchroom (10.26 m2)

No Asbestos

B200 - R0005 - Office/Store (6.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B200 - R0006 - General Storeroom (0.95 m2)

No Asbestos

B200 - R0007 - Student Canteen (53.94 m2)

Ceiling Structures/Linings	Vermiculite 8489/B200/R1001/Ceiling Structures/Linings/S28	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B200 - R0008 - Staff - Toilet (3.95 m2)

No Asbestos

B200 - R0009 - Cleaning Supplies Store (5.64 m2)

No Asbestos

B200 - R0010 - Cleaning Store - Distributed (3.21 m2)

No Asbestos

B200 - R0011 - Distribution Board Cupboard (0.78 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board 8489/B200/R0011/Electrical Backing Board/S33	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B200 - R0012 - Sport Equipment Store (15.69 m2)

No Asbestos

B200 - R0013 - Cleaning Store - Distributed (1.06 m2)

No Asbestos

B200 - R0014 - General Storeroom (19.79 m2)

No Asbestos

B200 - R0015 - Stairs (3.23 m2)

No Asbestos

B200 - R0016 - General Storeroom (3.23 m2)

No Asbestos

B200 - R0017 - Movement (51.98 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B200 - R0018 - General Storeroom (3.76 m2)						
No Asbestos						
B200 - R0019 - Stairs (3.76 m2)						
No Asbestos						
B200 - R0020 - External Movement (62.54 m2)						
No Asbestos						
B200 - R0021 - External Movement (50.99 m2)						
No Asbestos						
B200 - R0022 - External Movement (111.65 m2)						
No Asbestos						
B200 - R0023 - External Stairs (4.95 m2)						
No Asbestos						
B200 - R1001 - Movement (65.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B200/R1001/Ceiling Structures/Linings/S28					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B200 - R1002 - Cleaning Store - Distributed (3.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3.42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
Flue	Fibre Cement Pipe	2m	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1002/Flue/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel-High Level	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25					Chrysotile (white asbestos)
B200 - R1003 - Staff Study (9.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
infill panel - high level	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8489/B200/R1003/Floor Coverings Res/Textile/S30					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1003/Floor Coverings Res/Textile/S31					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	9.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1003/Floor Coverings Res/Textile/S32					Chrysotile (white asbestos)
B200 - R1004 - Staff - Toilet (8.43 m2)						
Infill Panel-High Level	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Partition Walls (Cubicles)/S27					Chrysotile (white asbestos)
B200 - R1005 - Shower/Change (62.84 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	60m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B300/R0001/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	62.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Infill panels-High level	Flat AC Sheeting	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25				Chrysotile (white asbestos)	
B200 - R1006 - Shower/Change (62.97 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B300/R0001/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	62.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Infill panels-High level	Flat AC Sheeting	10m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25				Chrysotile (white asbestos)	
B200 - R1007 - Staff - Toilet (7.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8489/B200/R1001/Ceiling Structures/Linings/S28					
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Partition Walls (Cubicles)/S27				Chrysotile (white asbestos)	
Infill panels-High level	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25				Chrysotile (white asbestos)	
B200 - R1008 - Cleaning Supplies Store (9.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8489/B200/R1001/Ceiling Structures/Linings/S28					
Infill panels-High level	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	9.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1003/Floor Coverings Res/Textile/S32				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	9.06m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1003/Floor Coverings Res/Textile/S31				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8489/B200/R1003/Floor Coverings Res/Textile/S30					
B200 - R1009 - Cleaning Store - Distributed (3.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	336m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Flue	Fibre Cement Pipe	3m	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1002/Flue/S29				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Infill Panel-High Level	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B200/R1004/Infill Panel-High Level/S25				Chrysotile (white asbestos)	
B200 - R1010 - Stairs (6.94 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B200 - R1011 - Stairs (7.94 m2)						
No Asbestos						
B200 - R1012 - External Movement (49.79 m2)						
No Asbestos						
B200 - R1013 - External Movement (45.37 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B300 - Technological & Applied Studies - 1974 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground Non Accessible Area

- Area inaccessible

Eaves Linings No Asbestos Found

Interior**B300 - R0001 - Toilets-Girls (65.73 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 52m2 Throughout, Variable positions Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0001/Partition Walls (Cubicles)/S4

Chrysotile (white asbestos)

B300 - R0002 - Movement (73.24 m2)

Floor Coverings Res/Textile Vinyl Tiles 74m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B300 - R0003 - Food Technology L.S. (82.18 m2)

Floor Coverings Res/Textile Vinyl Tiles 83m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B300 - R0004 - External Movement (2.59 m2)

No Asbestos

B300 - R0011 - Computer Learning Space (65.49 m2)

Floor Coverings Res/Textile Vinyl Tiles 66m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B300 - R0012 - General Storeroom (10.33 m2)

Floor Coverings Res/Textile Vinyl Tiles 11m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B300 - R0013 - Cleaning Store - Distributed (5.36 m2)

No Asbestos

B300 - R0014 - Staff Study (32.04 m2)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B300 - R0015 - General Storeroom (4.53 m2)

Floor Coverings Res/Textile Vinyl Tiles 5m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8489/B300/R0002/Floor Coverings Res/Textile/S3

Chrysotile (white asbestos)

Ceiling Structures/Linings Vermiculite
8489/B400/R1001/Ceiling Structures/Linings/S2

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B300 - R0016 - General Storeroom (18.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B300/R0002/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R0017 - Distribution Board Cupboard (0.78 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B300 - R0018 - External Movement (2.14 m2)						
No Asbestos						
B300 - R0019 - Laundry (7.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B500/R0032/Ceiling Structures/Linings/S51				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R0020 - Other (27.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B500/R0032/Ceiling Structures/Linings/S51				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R0021 - Food Technology L.S. (89.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B500/R0032/Ceiling Structures/Linings/S51				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R0022 - Pantry (12.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B500/R0032/Ceiling Structures/Linings/S51				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R0023 - Food/Research Space (17.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B500/R0032/Ceiling Structures/Linings/S51				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1001 - Design L.S. (65.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1002 - Shower/Change (4.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1003 - Design L.S. (65.47 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1004 - General Storeroom (10.15 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1005 - Music Learning Space (64.74 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8489/B400/R1001/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B300 - R1006 - Music Store (32.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1007 - General Learning Space (65.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B300/R0002/Floor Coverings Res/Textile/S3	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1008 - Resources Store (13.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B300/R0002/Floor Coverings Res/Textile/S3	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1009 - Art Learning Space (65.06 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1010 - Art Learning Space (69.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B300/R0002/Floor Coverings Res/Textile/S3	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1011 - Distribution Board Cupboard (0.92 m2)						
Electrical Backing Board	Resinous Board 8489/B300/R1011/Electrical Backing Board/S24	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B300 - R1012 - Movement (61.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B300/R0002/Floor Coverings Res/Textile/S3	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B300 - R1013 - External Movement (1.82 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B400 - Science/Library - 1974 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior

B400 - M1001 - Main Area (164.43 m2)

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B400 - M1002 - Seminar (29.49 m2)

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B400 - M1003 - Seminar (23.94 m2)

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B400 - M1004 - Stairs (4.14 m2)

No Asbestos

B400 - M1005 - Stairs (4.14 m2)

No Asbestos

B400 - R0003 - Preparation (49.13 m2)

Ceiling Structures/Linings	Vermiculite 8489/B400/R0003/Ceiling Structures/Linings/S40	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B400 - R0005 - Distribution Board Cupboard (1.09 m2)

Note: No inspection of live electrical installation.

No Asbestos

B400 - R0006 - Movement (58.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B500/R0023/Floor Coverings Res/Textile/S1						Chrysotile (white asbestos)

B400 - R0011 - Plant (14.37 m2)

No Asbestos

B400 - R0013 - Movement (11.94 m2)

No Asbestos

B400 - R0014 - Stairs (0.58 m2)

No Asbestos

B400 - R0015 - General Storeroom (6.77 m2)

No Asbestos

B400 - R0016 - Lift (2.25 m2)

Non Accessible

B400 - R0017 - External Movement (72.53 m2)

No Asbestos

B400 - R0018 - External Movement (17.86 m2)

No Asbestos

B400 - R0019 - Preparation - Science (47.88 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Behind Wall Tiles						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite	47.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	-------------	---------	------------	--------------------	---------	--------------------

Assumed Asbestos - Above Suspended Ceiling**B400 - R0020 - Laboratory L.S. (87.11 m2)**

Wall Linings Internal	Flat AC Sheeting 8489/B400/R0021/Wall Linings Internal/S39					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	87.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Above Suspended Ceiling**B400 - R0021 - Laboratory L.S. (86.72 m2)**

Wall Linings Internal	Flat AC Sheeting 8489/B400/R0021/Wall Linings Internal/S39					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	86.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Above Suspended Ceiling**B400 - R0022 - Laboratory L.S. (85.84 m2)**

Wall Linings Internal	Flat AC Sheeting 8489/B400/R0021/Wall Linings Internal/S39					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8489/B400/R0003/Ceiling Structures/Linings/S40					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R0023 - Laboratory L.S. (85.64 m2)**

Wall Linings Internal	Flat AC Sheeting 8489/B400/R0021/Wall Linings Internal/S39					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R1001 - General Storeroom (8.33 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)**B400 - R1002 - Staff Kitchen (13.88 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
----------------------------	--	--	--	--	--	------------------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R1003 - Staff - Toilet (4.18 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
----------------------------	--	--	--	--	--	------------------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R1004 - Entry (6.77 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
----------------------------	--	--	--	--	--	------------------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R1005 - External Movement (2.15 m2)**

No Asbestos

B400 - R1006 - Staff - Toilet (4.13 m2)

Ceiling Structures/Linings	Vermiculite 8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
----------------------------	--	--	--	--	--	------------------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B400 - R1007 - Main Area (371.69 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1008 - Seminar (12.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1009 - Seminar (14.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1010 - Distribution Board Cupboard (0.3 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B400 - R1011 - Cleaning Store - Distributed (1.98 m2)						
No Asbestos						
B400 - R1012 - Distribution Board Cupboard (0.94 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B400/R1012/Electrical Backing Board/S42					Chrysotile (white asbestos)
B400 - R1013 - Seminar (13.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1014 - Seminar (14.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1015 - Seminar (12.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1016 - Audio Visual Workroom (35.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1017 - Librarian (9.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B400 - R1018 - Stairs (7.8 m2)						
No Asbestos						
B400 - R1019 - Lift (2.25 m2)						
Non Accessible						
B400 - R1020 - Stairs (0.4 m2)						
No Asbestos						
B400 - R1021 - Stairs (0.4 m2)						
No Asbestos						
B400 - R1022 - External Movement (83.05 m2)						
No Asbestos						
B400 - R1023 - External Movement (5.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8489/B400/R1024/Ceiling Structures/Linings/S41					No Asbestos Detected
B400 - R1024 - External Movement (14.71 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting
 8489/B400/R1024/Ceiling Structures/Linings/S41

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B500 - Administration/General Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B500 - R0001 - Leading Teacher (13.38 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	13.38m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B500 - R0002 - Study Space (11.96 m2)

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	11.96m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B500 - R0003 - General Learning Space (82.48 m2)

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	82.48m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B500 - R0004 - Commonroom (76.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B500 - R0005 - General Storeroom (14.28 m2)

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	14.28m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B500 - R0008 - Interview/Office - Type 1 (9.75 m2)

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	9.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B500 - R0009 - Cleaning Store - Distributed (2.59 m2)

Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B500 - R0010 - Distribution Board Cupboard (0.71 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B500 - R0011 - Duplicating Workroom (15.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B500 - R0012 - General Storeroom (2.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B500 - R0013 - Principal Office (23.16 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	23.16m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R0016 - Interview/Office - Type 1 (20.2 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	20.2m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R0018 - Sick Bay (16.19 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	16.19m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R0019 - Staff - Toilet (9.31 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	9.31m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R0020 - Staff - Toilet (10.12 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B500 - R0021 - Toilets-Girls (10.08 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B500 - R0022 - Toilets-Boys (9.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B500 - R0024 - Stairs (8.21 m2)						
No Asbestos						
B500 - R0025 - External Movement (59.13 m2)						
No Asbestos						
B500 - R0026 - Printing/Photocopying (24.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	24.19m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R0028 - Movement (11.02 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	11.02m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R0029 - Administration - Clerical (13.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R0032/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B500 - R0030 - Administration - Clerical (5.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R0032/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B500 - R0031 - Administration - Clerical (39.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R0032/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B500 - R0032 - Movement (90.74 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R0032/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B500 - R1001 - General Learning Space (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B500 - R1002 - General Learning Space (53.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	53.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1003 - General Storeroom (22.64 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	22.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1004 - General Storeroom (6.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B500 - R1005 - Cleaning Store - Distributed (3.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B500 - R1006 - General Learning Space (59.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	59.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1007 - General Learning Space (59.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	59.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1008 - General Learning Space (53.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	53.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1012 - Study Space (40.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	40.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B500 - R1013 - Staff Study (18.05 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	18.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R1014 - Distribution Board Cupboard (0.68 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board 8489/B500/R1014/Electrical Backing Board/S44	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R1015 - General Learning Space (40.83 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	40.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B500 - R1016 - Movement (57.16 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B500 - R1018 - Stairs (6.17 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B500 - R1019 - External Movement (52.33 m2)						
No Asbestos						
B500 - R1020 - General Learning Space (40.33 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B500/R1020/Ceiling Structures/Linings/S43					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	40.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B600 - Science/Performing Arts - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B600 - R0001 - Cleaning Supplies Store (22.87 m2)**

No Asbestos

B600 - R0002 - Laboratory L.S. (90.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B400/R1001/Ceiling Structures/Linings/S2			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B600 - R0003 - Preparation (48.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite	8489/B400/R1001/Ceiling Structures/Linings/S2			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B600 - R0005 - Cleaning Store - Distributed (1.34 m2)

No Asbestos

B600 - R0006 - Distribution Board Cupboard (0.72 m2)

Note: No inspection of live electrical installation.

No Asbestos

B600 - R0007 - External Movement (12.61 m2)

No Asbestos

B600 - R0008 - External Movement (209.49 m2)

No Asbestos

B600 - R0009 - Lift (2.26 m2)

Non Accessible

B600 - R0010 - Laboratory L.S. (84.47 m2)

Ceiling Structures/Linings	Vermiculite	8489/B400/R1001/Ceiling Structures/Linings/S2			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Wall Linings Internal	Flat AC Sheeting	8489/B600/R0010/Wall Linings Internal/S38			No Asbestos Detected	

B600 - R1001 - Performance Workspace (90.51 m2)

Ceiling Structures/Linings	Vermiculite	8489/B400/R1001/Ceiling Structures/Linings/S2			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B600 - R1003 - Dust Extraction Space (0.94 m2)

No Asbestos

B600 - R1004 - Growing/Breeding (11.21 m2)

Ceiling Structures/Linings	Vermiculite	8489/B400/R1001/Ceiling Structures/Linings/S2			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B600 - R1005 - Chemical Store (11.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B600 - R1007 - Distribution Board Cupboard (0.73 m2)						
Note: No inspection of live electrical installation.						
No Asbestos						
B600 - R1008 - Cleaning Store - Distributed (0.73 m2)						
No Asbestos						
B600 - R1009 - Laboratory L.S. (90.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B500/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B600 - R1010 - Plant (0.9 m2)						
No Asbestos						
B600 - R1011 - External Movement (48.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B400/R1001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B600 - R1012 - External Movement (11.88 m2)						
No Asbestos						
B600 - R1013 - Music Learning Space (48.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B500/R0032/Ceiling Structures/Linings/S51					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B700 - General Learning/Computer Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B700 - R0001 - Special Learning Space (53.14 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B700 - R0002 - Special Learning Space (51.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	51.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B700 - R0003 - Darkroom Space (11.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B700 - R0004 - Cleaning Supplies Store (13.36 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	13.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B700 - R0006 - Cleaning Store - Distributed (2.3 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B700 - R0007 - Teachers Aides (10.81 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B700 - R0008 - Distribution Board Cupboard (0.89 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board 8489/B700/R0008/Electrical Backing Board/S46	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	--	-----	------	--------------------	---------	--

B700 - R0010 - Staff - Toilet (8.12 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B700 - R0011 - General Storeroom (4.57 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B700 - R0013 - General Learning Space (52.92 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R0014 - General Learning Space (53.72 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	53.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R0015 - Special Learning Space (37.94 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	37.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R0016 - Staff Room (52.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0023/Floor Coverings Res/Textile/S1	52.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B700 - R0017 - Movement (89.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B700/R0017/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B700 - R0018 - Staff - Toilet (5.18 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B700 - R0019 - Stairs (5.37 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B700 - R0020 - External Stairs (5.45 m2)						
No Asbestos						
B700 - R0021 - External Movement (80.51 m2)						
No Asbestos						
B700 - R0022 - Deputy Principal Office (18.36 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	18.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R0023 - Deputy Principal Office (18.56 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	18.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R0024 - Chemical Store (12.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected
B700 - R0025 - Apparatus Storage (17.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B500/R0032/Floor Coverings Res/Textile/S50					No Asbestos Detected
B700 - R1001 - Computer Learning Space (53.14 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R1002 - General Learning Space (54.24 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	54.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R1003 - Movement (18.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B700 - R1004 - General Learning Space (54.54 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	54.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R1005 - General Learning Space (54.6 m2)						
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	54.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B700 - R1006 - Distribution Board Cupboard (1.46 m2)						
Electrical Backing Board	Resinous Board 8489/B700/R0008/Electrical Backing Board/S46	1.46m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B700 - R1007 - Cleaning Store - Distributed (3.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1008 - Interview/Office - Type 1 (11.08 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B700 - R1009 - Staff Study (40.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	40.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1010 - Movement (25.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1011 - Computer Learning Space (52.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
B700 - R1012 - General Storeroom (18.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1013 - General Learning Space (53.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1014 - General Learning Space (53.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B700 - R1015 - Staff Study (18.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	18.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B700 - R1016 - Stairs (7.41 m2)

Ceiling Structures/Linings	Vermiculite 8489/B700/R0001/Ceiling Structures/Linings/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B700 - R1017 - External Movement (53.18 m2)

No Asbestos

B700 - R1018 - Stairs (4.73 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B800 - Physical Education/General Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B800 - R0001 - General Learning Space (53.36 m2)**

Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B800 - R0002 - General Learning Space (53.14 m2)

Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B800 - R0003 - Staff Study (24.92 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						
Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B800 - R0004 - General Learning Space (53.58 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						
Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B800 - R0005 - General Storeroom (10.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R0005/Floor Coverings Res/Textile/S6	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B800 - R0006 - General Learning Space (53.73 m2)

Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B800 - R0007 - General Learning Space (53.14 m2)

Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R1007/Floor Coverings Res/Textile/S48	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B800 - R0009 - General Storeroom (4.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8489/B800/R1007/Floor Coverings Res/Textile/S48	4.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Chrysotile (white asbestos)</i>						

B800 - R0010 - Staff - Toilet (4.87 m2)

Ceiling Structures/Linings	Vermiculite 8489/B800/R1001/Ceiling Structures/Linings/S47	Limited Samples Taken				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B800 - R0011 - Staff - Toilet (7.88 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R0012 - Bulk Store (32.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	32.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0013 - Distribution Board Cupboard (0.85 m2)						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	0.5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1013/Electrical Backing Board/S49					Chrysotile (white asbestos)
B800 - R0014 - Staff Study (11.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R0015 - Cleaning Store - Distributed (2.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	2.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0016 - General Learning Space (50.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	50.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0017 - Sport Equipment Store (9.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	9.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0018 - Sport Equipment Store (5.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0019 - Sport Equipment Store (5.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R0020 - Movement (77.32 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B800 - R0021 - Stairs (5.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B800 - R0022 - General Storeroom (7.25 m2)						
No Asbestos						
B800 - R0023 - Stairs (0.62 m2)						
No Asbestos						
B800 - R0024 - External Movement (70.34 m2)						
No Asbestos						
B800 - R1001 - General Learning Space (53.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R1002 - General Learning Space (53.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R1003 - General Storeroom (18.34 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	18.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R1004 - General Learning Space (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R1005 - General Learning Space (53.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)
B800 - R1006 - General Storeroom (18.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	18.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B800 - R1007 - General Learning Space (53.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1008 - Movement (27.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1010 - Staff Study (39.96 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	39.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
B800 - R1011 - Clinic-Waiting (10.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	10.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
B800 - R1012 - Cleaning Store - Distributed (3.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1013 - Distribution Board Cupboard (1.54 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1013/Electrical Backing Board/S49					Chrysotile (white asbestos)	
B800 - R1014 - General Learning Space (54.68 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	54.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
B800 - R1015 - General Learning Space (54.68 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	54.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R1007/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B800 - R1016 - Movement (18.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8489/B800/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1017 - Stairs (13.18 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1018 - Stairs (8.03 m2)						
Ceiling Structures/Linings	Vermiculite					
8489/B800/R1001/Ceiling Structures/Linings/S47					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B800 - R1019 - External Movement (68.53 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B900 - Computer Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B900 - R0001 - External Movement (26.87 m2)

No Asbestos

B900 - R0002 - Computer Learning Space (91.8 m2)

No Asbestos

B900 - R0003 - Computer Resource (19.08 m2)

No Asbestos

B900 - R0004 - Computer Store (10.12 m2)

No Asbestos

B900 - R0005 - Printing/Photocopying (9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017