


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Karabar High School (8524)  
**Region :** Illawarra and South East  
**State Electorate :** Monaro  
**Local Government Area :** Queanbeyan

**Initial Survey :** Noel Arnold & Associates : 27 - Aug - 2014  
**Reviewed By :** Greencap-NAA : 27 - Aug - 2014

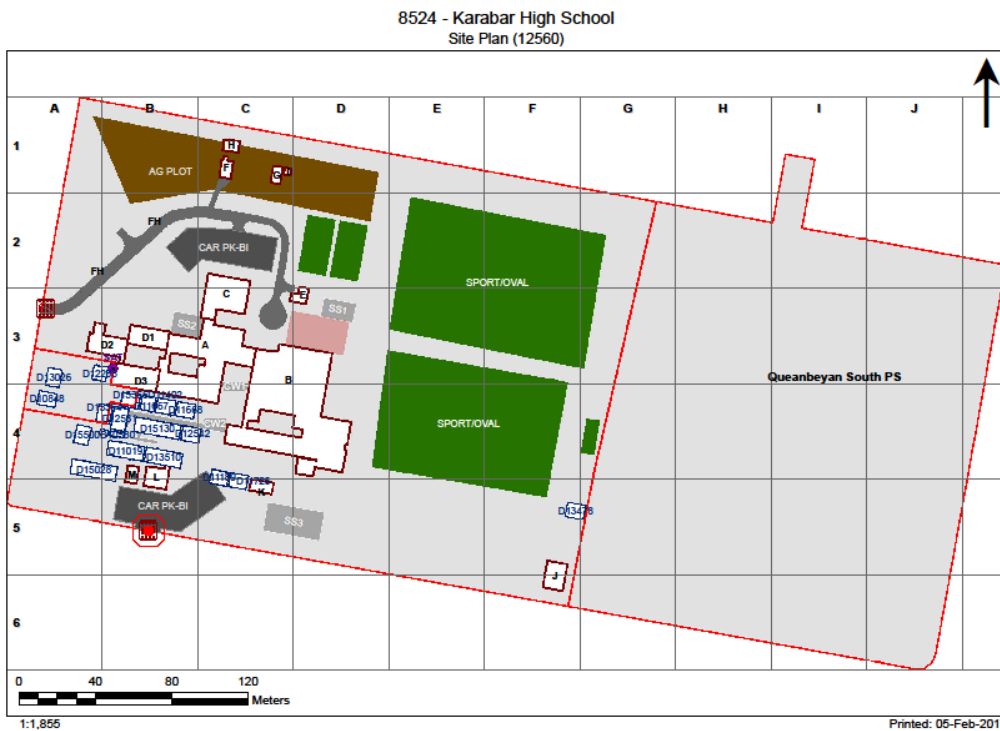

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1977 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting	60m2	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	50m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00G/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Telecommunication Pit	Moulded fibre cement	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/Telecommunication Pit/S32					<b>Chrysotile (white asbestos)</b>

**Interior****B00A - R0002 - Interview/Office - Type 1 (16.11 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0007 - Administration - Clerical (28.84 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0008 - Duplicating Workroom (23.87 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0009 - Main Switchroom (13.5 m2)**

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0009/Electrical Backing Board/S13					<b>Chrysotile (white asbestos)</b>

**B00A - R0010 - General Storeroom (12.85 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0011 - Commonroom (117.78 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B00A - R0012 - Staff - Toilet (8.22 m2)**

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Area inaccessible</b>

**B00A - R0013 - Staff - Toilet (8.22 m2)**

No Asbestos

**B00A - R0014 - Careers Advisers Office (25.91 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0015 - Gymnasium (92.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0016 - Staff - Toilet (2.43 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Cleaning Store - Distributed (2.61 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Interview/Office - Type 1 (12.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0023 - Clinic - Boys (12.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0025 - Movement (5.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00A - R0026 - General Storeroom (2.22 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00A - R0027 - General Storeroom (10.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0028 - Movement (12.98 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Darkroom Space (31.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8524/B00A/R0032/Floor Coverings Res/Textile/S8					No Asbestos Detected
<b>B00A - R0033 - No Access (27.6 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00A - R0034 - Distribution Board Cupboard (0.88 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R0036 - Lift (1.46 m2)</b>						
No Asbestos						
<b>B00A - R0038 - Stairs (5.91 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1033/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)
<b>B00A - R0039 - Stairs (5.44 m2)</b>						
No Asbestos						
<b>B00A - R0040 - Entry (18 m2)</b>						
No Asbestos						
<b>B00A - R0041 - Movement (1.98 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0042 - Pupil Entry (7.89 m2)</b>						
No Asbestos						
<b>B00A - R0043 - Administration - Clerical (52.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0044 - Tea Room (4.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0045 - Deputy Principal Office (18.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0046 - Movement (58.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0047 - Principal Office (24.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0048 - Movement (25.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0049 - Movement (67.72 m2)</b>						
No Asbestos						
<b>B00A - R0050 - Cleaning Store - Distributed (2.29 m2)</b>						
No Asbestos						
<b>B00A - R0051 - Stairs (2.86 m2)</b>						
No Asbestos						
<b>B00A - R0052 - Movement (82.89 m2)</b>						
No Asbestos						
<b>B00A - R0053 - Movement (2.54 m2)</b>						
No Asbestos						
<b>B00A - R0054 - Chemical Store (7.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0055 - Preparation - Science (40.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0056 - Toilets-Disabled (8.83 m2)</b>						
No Asbestos						
<b>B00A - R0057 - Laboratory L.S. (84.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8524/B00A/R0029/Ceiling Structures/Linings/S4			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting 8524/B00A/R0057/Wall Linings Internal/S14					No Asbestos Detected
<b>B00A - R0058 - Laboratory L.S. (84.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8524/B00A/R0057/Wall Linings Internal/S14					No Asbestos Detected
<b>B00A - R1001 - General Learning Space (53.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1002 - General Learning Space (52.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1004 - Staff Study (33.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1005 - General Learning Space (52.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1006 - General Learning Space (52.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1007 - Staff Study (26.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1008 - Computer Learning Space (53.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1009 - Computer Learning Space (52.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1010 - General Learning Space (52.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1011 - General Learning Space (52.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1012 - Distribution Board Cupboard (0.65 m2)</b>						
				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00A - R1014 - Cleaning Store - Distributed (4.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				8524/B00A/R1016/Ceiling Structures/Linings/S15 Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1015/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1015 - General Storeroom (4.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1015/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1016 - General Storeroom (2.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1018 - Preparation (46.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1020 - Staff Study (8.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Upper infill panel	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1021/Upper infill panel/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R1021 - Staff Study (22.28 m2)</b>						
Upper infill panel	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1021/Upper infill panel/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	22.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	22.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1022 - Distribution Board Cupboard (0.88 m2)</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8524/B00A/R1021/Upper infill panel/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R1023 - Staff Study (30.36 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Upper infill panel	Flat AC Sheeting	2m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1021/Upper infill panel/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	30.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1025 - Plant (0.86 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1026 - Lift (1.56 m2)</b>						
No Asbestos						
<b>B00A - R1027 - Stairs (11.68 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1029 - Stairs (6.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1030 - Staff Study (21.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1031 - Movement (180.33 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	181m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Compressed AC Sheet	16m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1032 - Movement (93.16 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	93.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1033 - Stairs (2.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1033/Ceiling Structures/Linings/S18					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1034 - Laboratory L.S. (85.14 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
8524/B00A/R0057/Wall Linings Internal/S14						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00A - R1035 - Laboratory L.S. (85.05 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
8524/B00A/R0057/Wall Linings Internal/S14						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Technological & Applied Studies - 1977 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting	100m2	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids	No Asbestos Found					

**Interior****B00B - R0001 - Multi-Purpose Space (453.51 m2)**

No Asbestos

**B00B - R0002 - Shower/Change (82.38 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00B/R0002/Partition Walls (Cubicles)/S25					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0003 - Staff Study (11.22 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Staff Study (11.22 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Shower/Change (78.76 m2)**

No Asbestos

**B00B - R0006 - Movement (14.2 m2)**

No Asbestos

**B00B - R0007 - Materials Store (37.16 m2)**

No Asbestos

**B00B - R0008 - Chair Store (51.1 m2)**

No Asbestos

**B00B - R0009 - Cleaning Store - Distributed (15.37 m2)**

Flue	Fibre Cement Pipe	5m	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8524/B00B/R0009/Flue/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0010 - Distribution Board Cupboard (0.67 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0011 - Staff Study (20.03 m2)**

No Asbestos

**B00B - R0013 - Staff - Toilet (7.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					

**B00B - R0014 - Office/Store (11.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8524/B00B/R0014/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>

**B00B - R0018 - Welding Area (9.78 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R0019 - Welding Area (3.98 m2)</b>						
No Asbestos						
<b>B00B - R0020 - Resources Store (15.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00B - R0021 - Art Learning Space (62.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00B - R0022 - Art Learning Space (65.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					
	8524/B00B/R0046/Wall Linings Internal/S7					No Asbestos Detected
<b>B00B - R0024 - Toilets-Girls (25.76 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00B/R0025/Partition Walls (Cubicles)/S27					Chrysotile (white asbestos)
<b>B00B - R0025 - Toilets-Boys (25.91 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00B/R0025/Partition Walls (Cubicles)/S27					Chrysotile (white asbestos)
<b>B00B - R0026 - Staff - Toilet (10.47 m2)</b>						
No Asbestos						
<b>B00B - R0027 - Staff - Toilet (10.47 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00B/R0002/Partition Walls (Cubicles)/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0028 - Cleaning Store - Distributed (2.37 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Distribution Board Cupboard (0.91 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R0030 - Movement (3.93 m2)</b>						
No Asbestos						
<b>B00B - R0031 - Cleaning Store - Distributed (2.48 m2)</b>						
No Asbestos						
<b>B00B - R0032 - General Storeroom (3.74 m2)</b>						
No Asbestos						
<b>B00B - R0033 - Staff Study (34.78 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R0034 - Distribution Board Cupboard (0.72 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R0036 - Stairs (27.66 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1016/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)
<b>B00B - R0037 - Stairs (28.5 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1016/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)
<b>B00B - R0038 - Covered Area (205.33 m2)</b>						
No Asbestos						
<b>B00B - R0039 - Movement (98.82 m2)</b>						
Infill panels	Flat AC Sheeting	6m2	Southwest	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8524/B00B/R0039/Infill panels/S31					Chrysotile (white asbestos)
<b>B00B - R0040 - Movement (209.72 m2)</b>						
No Asbestos						
<b>B00B - R0041 - Movement (29.17 m2)</b>						
No Asbestos						
<b>B00B - R0044 - Computer Room (9.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 8524/B00B/R0046/Wall Linings Internal/S7					No Asbestos Detected
<b>B00B - R0045 - Resource/Project Store (18.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 8524/B00B/R0046/Wall Linings Internal/S7					No Asbestos Detected
<b>B00B - R0046 - Art Learning Space (64.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8524/B00B/R0046/Wall Linings Internal/S7					No Asbestos Detected
<b>B00B - R0047 - Kiln Space (5.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0048 - Movement (13.17 m2)</b>						
No Asbestos						
<b>B00B - R0049 - Other-Vacant (8.65 m2)</b>						
No Asbestos						
<b>B00B - R0050 - Materials Store (23.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0051 - Other-Vacant (18.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0052 - Movement (10.33 m2)</b>						
No Asbestos						
<b>B00B - R0053 - Workshop Area (119.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0054 - External Movement (12.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0055 - General Learning Space - Type 6 (73.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0056 - Metal Technology Bay (107.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R0057 - Covered Outdoor Space (80.74 m2)</b>						
No Asbestos						
<b>B00B - R0058 - Student Canteen (49.26 m2)</b>						
No Asbestos						
<b>B00B - R0059 - No Access (25 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Food Technology L.S. (100.52 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	101m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00B - R1006 - Food Technology L.S. (99.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
<b>B00B - R1007 - Music Learning Space (78.01 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1008 - Distribution Board Cupboard (0.69 m2)</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting 8524/B00B/R1008/Ceiling Structures/Linings/S28	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00B - R1009 - Cleaning Store - Distributed (0.68 m2)</b>						
Flue	Fibre Cement Pipe 8524/B00B/R0009/Flue/S26	1m	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00B - R1010 - Distribution Board Cupboard (0.7 m2)</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting 8524/B00B/R1008/Ceiling Structures/Linings/S28	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00B - R1011 - Music Learning Space (80.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1012 - Toilets-Boys (22.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8524/B00A/R1016/Ceiling Structures/Linings/S15	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1013 - Cleaning Store - Distributed (2.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8524/B00A/R1016/Ceiling Structures/Linings/S15	2.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1014 - Toilets-Girls (23.72 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8524/B00A/R1016/Ceiling Structures/Linings/S15	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1017 - Dust Extraction Space (6.02 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8524/B00B/R0014/Floor Coverings Res/Textile/S6					No Asbestos Detected
<b>B00B - R1019 - Design L.S. (66.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1020 - Distribution Board Cupboard (0.72 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00B - R1021 - Resource/Project Store (8.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R1022 - Darkroom Space (10.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8524/B00A/R0029/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8524/B00A/R0029/Floor Coverings Res/Textile/S5	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R1023 - Movement (2.76 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1024 - Design L.S. (66.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00B - R1025 - General Storeroom (25.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1026 - Staff Study (39.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1027 - Cleaning Store - Distributed (2.16 m2)</b>						
No Asbestos						
<b>B00B - R1028 - Design L.S. (52.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1029 - Study Space (17.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1030 - Distribution Board Cupboard (2.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8524/B00B/R1008/Ceiling Structures/Linings/S28					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00B - R1031 - Design L.S. (53.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
<b>B00B - R1032 - Materials Technology L.S. (177.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1033 - Stairs (29.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1034 - Stairs (30.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1035 - Movement (11.94 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1036 - Movement (304.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	305m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1037 - Movement (28.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1038 - Movement (7.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1039 - Resource/Project Store (5.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1040 - Materials Store (7.76 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1041 - Movement (5.57 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1042 - Preparation (23.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1043 - Food/Research Space (14.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1044 - Movement (4.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1045 - Pantry (5.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Library - 1977 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00G/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior****B00C - M0003 - Stairs (3.7 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - M0004 - Stairs (3.69 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - M0005 - Main Area (92.29 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - M0006 - Computer Room (95.29 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - M0007 - Computer Room (48.1 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - M0008 - Computer Store (15.8 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0002 - Seminar (11.93 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0004 - General Storeroom (5.6 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0005 - General Storeroom (5.61 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Audio Visual Workroom (24.58 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00C - R0007 - Workroom (22.53 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8524/B00A/R0029/Ceiling Structures/Linings/S4					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	

**B00C - R0008 - Distribution Board Cupboard (0.9 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0009 - Toilets-Boys (5.81 m2)**

No Asbestos

**B00C - R0010 - Toilets-Girls (5.82 m2)**

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						

**B00C - R0011 - Librarian (13.13 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B00C - R0013 - Seminar (8.86 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B00C - R0016 - Computer Room (47.41 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B00C - R0017 - Main Area (235.02 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B00C - R0018 - Stairs (0.18 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

**B00C - R0019 - Stairs (0.18 m2)**

Ceiling Structures/Linings	Vermiculite	8524/B00A/R0029/Ceiling Structures/Linings/S4				<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>							

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Building Services - 1977 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior****B00E - R0001 - Chair Store (11.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	11.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - General Assistants (16.79 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00E - R0003 - General Storeroom (14.17 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - External Movement (5.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1016/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Agricultural Science - 2004 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Agriculture Covered Area (4.73 m2)**

No Asbestos

**B00F - R0002 - Machine Storage (52.69 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Agricultural Science - 2004 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00G/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior****B00G - R0001 - Machine Storage (27.78 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00G/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - Animal Space (14.25 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00G/R0002/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Agricultural Science - 2004 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Animal Space (45.81 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Agricultural Science - 2004 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Class Tools Storage (13.03 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Support Unit - 2004 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00J - R0001 - Study Space (24 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0003 - Cleaning Supplies Store (3.79 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0004 - Staff - Toilet (2.81 m2)**

No Asbestos

**B00J - R0005 - Toilets-Disabled (2.78 m2)**

No Asbestos

**B00J - R0006 - Commonroom (8.29 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0007 - Home Base Store - S (5.13 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0008 - Home Base Store - S (3.08 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0009 - Movement (55.9 m2)**

No Asbestos

**B00J - R0010 - Movement (23.53 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8524/B00J/R0010/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00J - R0011 - Distribution Board Cupboard (0.34 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00J/R0011/Electrical Backing Board/S30					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Senior Learning - 2006 - Steel (Steel)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Senior Study (35.04 m2)**

No Asbestos

**B00K - R0002 - Senior Study (35.16 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Senior Learning - 2008 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Student Kitchen (13.5 m2)**

No Asbestos

**B00L - R0002 - Senior Study (13.95 m2)**

No Asbestos

**B00L - R0003 - Computer Resource (13.42 m2)**

No Asbestos

**B00L - R0004 - Computer Resource (17.37 m2)**

No Asbestos

**B00L - R0005 - Computer Learning Space (35.91 m2)**

No Asbestos

**B00L - R0006 - Covered Outdoor Space (28.73 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other - 2007 - Steel (Steel)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

**Interior**

**B00M - R0001 - Machine Storage (32.89 m2)**

No Asbestos

**B00M - R0002 - General Storeroom (16.21 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0D1 - General Learning - 1980 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B0D1 - R0001 - Interview/Office - Type 1 (12.67 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B0D1 - R0002 - Interview/Office - Type 1 (12.28 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B0D1 - R0003 - Distribution Board Cupboard (0.7 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0D1 - R0004 - Toilets-Boys (21.11 m2)**

No Asbestos

**B0D1 - R0005 - General Learning Space (47.58 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B0D1 - R0006 - General Learning Space (47.86 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B0D1 - R0007 - Movement (39.86 m2)**

No Asbestos

**B0D1 - R1001 - Staff Study (25.84 m2)**

No Asbestos

**B0D1 - R1002 - Distribution Board Cupboard (0.7 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0D1 - R1003 - Toilets-Girls (20.9 m2)**

No Asbestos

**B0D1 - R1004 - Staff Study (48.8 m2)**

No Asbestos

**B0D1 - R1005 - General Learning Space (46.2 m2)**

No Asbestos

**B0D1 - R1006 - Movement (36.56 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B0D2/R0006/Ceiling Structures/Linings/S20						<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0D2 - General Learning - 1980 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting	60m2	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	15m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction</b>					

**Interior****B0D2 - R0001 - General Learning Space (48.09 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B0D3/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B0D2 - R0002 - Secure Storeroom (4.46 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B0D3/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B0D2 - R0003 - Staff Study (42.74 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B0D3/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B0D2 - R0004 - Staff Study (30.16 m2)**

Ceiling Structures/Linings	Vermiculite					
	8524/B0D3/R0001/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

**B0D2 - R0006 - Stairs (23.75 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B0D2/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B0D2 - R0008 - Movement (56.04 m2)**

Wall Linings Internal	Compressed AC Sheet	12m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>

**B0D2 - R0009 - Movement (4.93 m2)**

No Asbestos

**B0D2 - R1001 - General Learning Space (50.82 m2)**

No Asbestos

**B0D2 - R1002 - General Learning Space (45.63 m2)**

No Asbestos

**B0D2 - R1003 - Secure Storeroom (4.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8524/B00A/R0029/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0D2 - R1004 - Staff Study (24.96 m2)</b>						
No Asbestos						
<b>B0D2 - R1006 - Stairs (23.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B0D2/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	
<b>B0D2 - R1008 - Movement (60.23 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B0D2/R0006/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Compressed AC Sheet	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B00A/R1031/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0D3 - Science Learning - 1980 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

**Interior****B0D3 - R0003 - Distribution Board Cupboard (0.58 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0D3 - R0005 - Cleaning Store - Distributed (4.45 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2						<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8524/B00A/R0029/Floor Coverings Res/Textile/S5	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>

**B0D3 - R0006 - Movement (41.1 m2)**

No Asbestos

**B0D3 - R0007 - Laboratory L.S. (77.27 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2						<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--	---

**B0D3 - R0008 - Preparation - Science (48.95 m2)**

Fire door	Fire door core 8524/B0D3/R0008/Fire door/S23						<b>No Asbestos Detected</b>
Vapour oven	Millboard 8524/B0D3/R0008/Vapour oven/S24	0.1m2	Within	Friable Asbestos (5)	Low (1)	High Priority (6-8)	<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2						<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

**B0D3 - R0009 - Laboratory L.S. (77.43 m2)**

Ceiling Structures/Linings	Vermiculite 8524/B0D3/R0001/Ceiling Structures/Linings/S2						<b>Limited Samples Taken</b> <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--	---

**B0D3 - R1001 - Secure Storeroom (24.21 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8524/B0D3/R1001/Floor Coverings Res/Textile/S22	24.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>
-----------------------------	--	---------	------------	--------------------	---------	--------------------	------------------------------------

**B0D3 - R1002 - Distribution Board Cupboard (0.58 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B0D3 - R1003 - General Learning Space (47.37 m2)**

No Asbestos

**B0D3 - R1004 - General Learning Space (47.37 m2)**

No Asbestos

**B0D3 - R1005 - General Learning Space (48.22 m2)**

No Asbestos

**B0D3 - R1006 - Teachers Aides (8.46 m2)**

No Asbestos

**B0D3 - R1007 - Movement (79.47 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Compressed AC Sheet	40m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B0D3/R1007/Wall Linings Internal/S21					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8524/B0D2/R0006/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 842 - D10580 - Country Toilet - Relta - Boys/Girls : Placement Date - 4/07/1996**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		2.88 m2

### Interior

#### R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

#### R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2

#### R3 - Toilets-Boys

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

#### R4 - Staff Toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2
---------	---------------	------------------	--	------

**NS 110 - D10848 - Learning Unit - Single Secondary/Secure : Placement Date - 12/01/2012**

### Exterior

No Asbestos Found.

### Interior

#### R1 - General Learning Space

No Asbestos Found.

#### R2 - Entry

No Asbestos Found.

#### R3 - Secure Storeroom

No Asbestos Found.

**OS 534 - D11019 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Clerical Office</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - Staff Room</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R3 - Security Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R4 - Principal</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R5 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R6 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R7 - Reading Area</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
<b>R8 - Entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2
<b>OS 602 - D11189 - Learning Unit - Standard With P.A.A. : Placement Date - 16/07/2013</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
<b>R2 - Home Base Store</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
<b>OS 600 - D11402 - Learning Unit - Small : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				8.64 m2
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>OS 601 - D11667 - Learning Unit - Standard/Withdrawal : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D11668 - Learning Unit - Standard/Withdrawal : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D11726 - Learning Unit - Standard/Withdrawal : Placement Date - 26/11/2012</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 600 - D12285 - Learning Unit - Small : Placement Date - 7/12/2005</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - General Learning Space</b>						
No Asbestos Found.						
<b>OS 730 - D12531 - Needlework Textile Learning/Str/Fitting : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				14.4 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Classroom</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				73 m2
<b>R2 - Fitting room</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R3 - Materials Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 751 - D12542 - Learning Unit - ESL : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Esl</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R2 - Esl</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>OS 602 - D13026 - Learning Unit - Standard With P.A.A. : Placement Date - 1/02/2016</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 601 - D13478 - Learning Unit - Standard/Withdrawal : Placement Date - 10/05/2000</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 502 - D13510 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 30/11/1998</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Clerical Office</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R10 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
<b>R2 - Security Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
<b>R3 - Duplicating Wookroom</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
<b>R4 - Clinic-Waiting</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R5 - Staff Room</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R6 - Principal</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R7 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R8 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R9 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2
<b>OS 601 - D13672 - Learning Unit - Standard/Withdrawal : Placement Date - 23/04/2009</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 844 - D14817 - Country Toilet - Reltc - Boys/Girls : Placement Date - 7/12/2005</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Staff Toilet</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2
<b>R2 - Staff Toilet</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2
<b>OS 535 - D15028 - Library/Group Study/Office/A V Store : Placement Date - 19/11/2011</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				28.8 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Clerical Office</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - Staff Room</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R3 - Security Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R4 - Principal</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R5 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R6 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R7 - Reading Area</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2
<b>R8 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2
<b>OS 535 - D15130 - Library/Group Study/Office/A V Store : Placement Date - 23/08/1996</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				28.8 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Interior**

**R1 - Clerical Office**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

**R2 - Staff Room**

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

**R3 - Security Store**

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

**R4 - Principal**

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

**R5 - Staff Toilet**

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

**R6 - Staff Toilet**

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

**R7 - Reading Area**

Ceiling	Flat AC Sheet	Assumed Asbestos				90 m2
---------	---------------	------------------	--	--	--	-------

**R8 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2

**NS 110 - D15354 - Learning Unit - Single Secondary/Secure : Placement Date - 23/08/1996**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**R2 - Entry**

No Asbestos Found.

**R3 - Secure Storeroom**

No Asbestos Found.

**NS 110 - D15355 - Learning Unit - Single Secondary/Secure : Placement Date - 23/08/1996**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

**R2 - Entry**

No Asbestos Found.

**R3 - Secure Storeroom**

No Asbestos Found.

**OS 601 - D15500 - Learning Unit - Standard/Withdrawal : Placement Date - 6/01/2011**

**Exterior**

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
No Asbestos Found.						
<b>R2 - General Learning Space</b>						
No Asbestos Found.						
<b>R3 - Store</b>						
No Asbestos Found.						
<b>OS 520 - D18024 - Staff Study : Placement Date - 14/05/2009</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Staff Room</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017