


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Keira High School (8541)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 18 - Dec - 2009
Reviewed By : Greencap-NAA : 26 - Aug - 2014

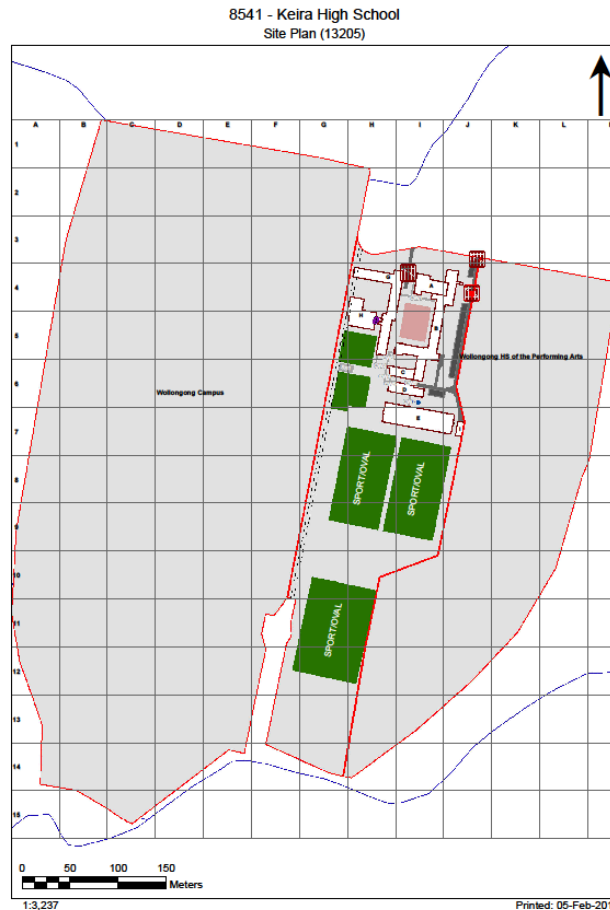

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Physical Education - 1985 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00A - M0001 - Sport Equipment Store (38.08 m2)

No Asbestos

B00A - M0002 - Stairs (2.28 m2)

No Asbestos

B00A - R0001 - Shower/Change (66.57 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8541/B00A/R0001/Partition Walls (Cubicles)/S45	No Asbestos Detected
----------------------------	---	-----------------------------

B00A - R0002 - Shower/Change (71.28 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8541/B00A/R0001/Partition Walls (Cubicles)/S45	No Asbestos Detected
----------------------------	---	-----------------------------

B00A - R0003 - Gymnasium (287.9 m2)

No Asbestos

B00A - R0004 - Sport Equipment Store (16.07 m2)

No Asbestos

B00A - R0005 - Staff - Toilet (3.11 m2)

No Asbestos

B00A - R0006 - Sport Equipment Store (35.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00A - R0007 - Plant Space (6.43 m2)

Flue	Moulded pipe	2m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00A/R0007/Flue/S46					Chrysotile (white asbestos)	

B00A - R0008 - Stairs (0.36 m2)

No Asbestos

B00A - R0009 - Main Switchroom (2.35 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration/General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/Eaves Linings/S43				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Awnings	Flat AC Sheeting				No Asbestos Detected	
	8541/B00B/Awnings/S23					
Roof	Resinous Membrane	160m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/Roof/S44				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Duplicating Workroom (26.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	26.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/R0014/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0002 - Administration - Clerical (38.62 m2)

Floor Coverings Res/Textile	Adhesive	38.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/R0040/Floor Coverings Res/Textile/S38				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/R0040/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)	

B00B - R0003 - Movement (11.93 m2)

No Asbestos

B00B - R0004 - Clinic - Boys (13.57 m2)

No Asbestos

B00B - R0005 - Clinic-Toilets (2.25 m2)

No Asbestos

B00B - R0006 - Clinic - Girls (13.49 m2)

No Asbestos

B00B - R0007 - Clinic-Toilets (2.25 m2)

No Asbestos

B00B - R0009 - Administration - Clerical (10.83 m2)

No Asbestos

B00B - R0010 - Principal Office (22.36 m2)

No Asbestos

B00B - R0011 - Leading Teacher (12.12 m2)

Floor Coverings Res/Textile	Vinyl Sheet				No Asbestos Detected	
	8541/B00B/R0011/Floor Coverings Res/Textile/S41					

B00B - R0012 - Security Store (6.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/R0014/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0013 - Staff Study (14.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00B/R0014/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0014 - Staff - Toilet (7.52 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00B - R0015 - Security Store (0.89 m2)						
No Asbestos						
B00B - R0016 - Security Store (2.89 m2)						
No Asbestos						
B00B - R0018 - Deputy Principal Office (29.4 m2)						
No Asbestos						
B00B - R0019 - Staff - Toilet (7.3 m2)						
No Asbestos						
B00B - R0020 - Security Store (16.16 m2)						
No Asbestos						
B00B - R0022 - Commonroom (52.97 m2)						
No Asbestos						
B00B - R0023 - Cleaning Store - Distributed (1.08 m2)						
No Asbestos						
B00B - R0024 - Deputy Principal Office (21.41 m2)						
No Asbestos						
B00B - R0025 - Movement (16.9 m2)						
No Asbestos						
B00B - R0026 - General Learning Space (53.23 m2)						
No Asbestos						
B00B - R0027 - General Learning Space (53.07 m2)						
No Asbestos						
B00B - R0028 - General Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Adhesive	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S38				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)		
B00B - R0029 - General Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Adhesive	56.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S38				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S37				Chrysotile (white asbestos)		
B00B - R0030 - Staff Study (7.84 m2)						
No Asbestos						
B00B - R0031 - Main Switchroom (7.6 m2)						
Electrical Mounting Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0031/Electrical Mounting Board/S40				Chrysotile (white asbestos)		
B00B - R0032 - General Learning Space (52.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0032/Floor Coverings Res/Textile/S39				Chrysotile (white asbestos)		
B00B - R0033 - Laboratory L.S. (89.93 m2)						
No Asbestos						
B00B - R0034 - Preparation - Science (15.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0035 - Chemical Store (10.73 m2)						
No Asbestos						
B00B - R0036 - Cleaning Store - Distributed (0.7 m2)						
No Asbestos						
B00B - R0038 - Special Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8541/B00B/R0038/Floor Coverings Res/Textile/S36	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0040 - General Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8541/B00B/R0040/Floor Coverings Res/Textile/S37	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8541/B00B/R0040/Floor Coverings Res/Textile/S38	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0041 - Cleaning Store - Distributed (0.88 m2)						
No Asbestos						
B00B - R0042 - Movement (29.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8541/B00B/R0042/Ceiling Structures/Linings/S2	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0044 - Movement (4.12 m2)						
No Asbestos						
B00B - R0045 - Public Entry (48.36 m2)						
Floor Coverings Res/Textile	Adhesive 8541/B00B/R0040/Floor Coverings Res/Textile/S38	4.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8541/B00B/R0040/Floor Coverings Res/Textile/S37	48.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0046 - Movement (52.6 m2)						
Floor Coverings Res/Textile	Adhesive 8541/B00B/R0040/Floor Coverings Res/Textile/S38	52.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8541/B00B/R0040/Floor Coverings Res/Textile/S37	52.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0047 - Stairs (7.3 m2)						
No Asbestos						
B00B - R0048 - External Movement (4.05 m2)						
No Asbestos						
B00B - R0049 - Stairs (6.52 m2)						
No Asbestos						
B00B - R0050 - Toilets-Disabled (6.05 m2)						
No Asbestos						
B00B - R0051 - Withdrawal - S (9.7 m2)						
No Asbestos						
B00B - R0052 - Toilets-Disabled (12.92 m2)						
No Asbestos						
B00B - R0053 - Staff Study (24.15 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	24.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S38					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0040/Floor Coverings Res/Textile/S37					Chrysotile (white asbestos)	
B00B - R0054 - Movement (14.19 m2)						
No Asbestos						
B00B - R0055 - Movement (267.32 m2)						
Electrical Mounting Board	Resinous Board	0.2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0055/Electrical Mounting Board/S35					Chrysotile (white asbestos)	
B00B - R0056 - General Storeroom (9.77 m2)						
No Asbestos						
B00B - R0057 - External Movement (14.39 m2)						
No Asbestos						
B00B - R0058 - Covered Vehicle Area/Porte Cochere (90.1 m2)						
No Asbestos						
B00B - R0059 - External Movement (16.28 m2)						
No Asbestos						
B00B - R1001 - General Storeroom (3.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1002 - Staff - Toilet (2.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1003 - Staff Study (38.64 m2)						
No Asbestos						
B00B - R1004 - Staff - Toilet (7.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1006 - General Storeroom (15.74 m2)						
No Asbestos						
B00B - R1007 - General Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R1008 - General Learning Space (53.07 m2)						
No Asbestos						
B00B - R1009 - General Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R1010 - General Learning Space (53.07 m2)						
No Asbestos						
B00B - R1011 - General Learning Space (53.07 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R1012 - Computer Learning Space (53.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R1013 - General Storeroom (15.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R1014 - Staff - Toilet (15.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
8541/B00B/R1014/Partition Walls (Cubicles)/S3						
B00B - R1015 - General Storeroom (14.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R1016 - Staff - Toilet (16.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R1004/Ceiling Structures/Linings/S42					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
8541/B00B/R1014/Partition Walls (Cubicles)/S3						
B00B - R1017 - Preparation/Printing (19.75 m2)						
No Asbestos						
B00B - R1018 - Commonroom (146.29 m2)						
No Asbestos						
B00B - R1019 - General Learning Space (52.91 m2)						
No Asbestos						
B00B - R1020 - Preparation (15.51 m2)						
No Asbestos						
B00B - R1021 - Laboratory L.S. (89.6 m2)						
No Asbestos						
B00B - R1022 - Apparatus Store (10.47 m2)						
No Asbestos						
B00B - R1023 - Cleaning Store - Distributed (0.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00B/R0014/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00B - R1024 - Cleaning Store - Distributed (0.88 m2)						
No Asbestos						
B00B - R1025 - Movement (8.71 m2)						
No Asbestos						
B00B - R1026 - Cleaning Distributed Store (1.12 m2)						
No Asbestos						
B00B - R1027 - Stairs (3.44 m2)						
No Asbestos						
B00B - R1028 - Movement (251.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R1029 - Stairs (3.44 m2)

No Asbestos

B00B - R1030 - External Movement (1.23 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Science/General Learning - 1952 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Underfloor Voids	No Asbestos Found					
------------------	-------------------	--	--	--	--	--

Ceiling Voids	Non Accessible Area - Area inaccessible					
---------------	--	--	--	--	--	--

Interior**B00C - R0001 - Movement (80.04 m2)**

Ceiling Structures/Linings	Vermiculite 8541/B00C/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Window Sills	Compressed AC Sheet 8541/B00C/R0001/Window Sills/S5	20m	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------	--	-----	-------	--------------------	---------	--

B00C - R0002 - General Storeroom (19.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8541/B00C/R0002/Floor Coverings Res/Textile/S32	19.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	---------	------------	--------------------	---------	--

Ceiling Structures/Linings	Vermiculite 8541/B00C/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00C - R0003 - Laboratory L.S. (85.75 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00C/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Window Sills	Compressed AC Sheet 8541/B00C/R0001/Window Sills/S5	12m	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------	--	-----	-------	--------------------	---------	--

B00C - R0004 - Preparation (20.1 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00C/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 8541/B00C/R0005/Floor Coverings Res/Textile/S6					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

Fume Cupboard	Flat AC Sheeting 8541/B00C/R0004/Fume Cupboard/S7	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
---------------	--	-------	---------------	--------------------	---------	---

Flue	Fibre Cement Pipe	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible
------	-------------------	----	------	--------------------	---------	---

B00C - R0005 - Growing/Breeding (4.8 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00C/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles 8541/B00C/R0005/Floor Coverings Res/Textile/S6					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00C - R0006 - Distribution Board Cupboard (0.33 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0007 - External Movement (6.34 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0008 - External Movement (7.35 m2)						
No Asbestos						
B00C - R0009 - External Movement (2.78 m2)						
No Asbestos						
B00C - R0010 - Stairs (4.98 m2)						
No Asbestos						
B00C - R0011 - Stairs (5.04 m2)						
No Asbestos						
B00C - R0012 - External Movement (4.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00C - R1001 - Apparatus Store (9.27 m2)						
No Asbestos						
B00C - R1002 - Staff - Toilet (6.75 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R1002/Partition Walls (Cubicles)/S33					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
8541/B00C/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1003 - Cleaning Store - Distributed (9.62 m2)						
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
8541/B00C/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1004 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
8541/B00C/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Window Sills	Compressed AC Sheet	8m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R1005 - General Learning Space (52.24 m2)						
Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
8541/B00C/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Window Sills	Compressed AC Sheet	8m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R1006 - Cleaning Store - Distributed (0.27 m2)						
No Asbestos						
B00C - R1008 - Stairs (12.21 m2)						
Window Sills	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R1009 - Stairs (14.23 m2)						
Window Sills	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R1010 - External Movement (2.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
8541/B00C/R1010/Ceiling Structures/Linings/S10						
B00C - R1011 - Movement (62.41 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Workbench	Compressed AC Sheet	63m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8541/B00G/R0025/Workbench/S17					Chrysotile (white asbestos)	
Window Sills	Compressed AC Sheet	20m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	63m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R1011/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00C - R2001 - Staff Study (25.55 m2)						
Window Sills	Compressed AC Sheet	4m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R2002 - Special Learning Space (52.49 m2)						
Window Sills	Compressed AC Sheet	53m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R2003 - General Learning Space (52.17 m2)						
Window Sills	Compressed AC Sheet	8m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R2004 - Distribution Board Cupboard (0.27 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00C - R2005 - General Storeroom (5.98 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R2005/Wall Linings Internal/S34					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	5.98m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R1011/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00C - R2006 - Movement (51.1 m2)						
Window Sills	Compressed AC Sheet	20m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R1011/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00C - R2007 - Stairs (16.06 m2)						
Window Sills	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	
B00C - R2008 - Stairs (15.9 m2)						
Window Sills	Compressed AC Sheet	5m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00C/R0001/Window Sills/S5					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - Cleaning Store - Distributed (13.71 m2)

No Asbestos

B00D - R0002 - Garden Store Room (21.79 m2)

No Asbestos

B00D - R0003 - Sport Equipment Store (30.52 m2)

No Asbestos

B00D - R0004 - General Assistants (18.18 m2)

No Asbestos

B00D - R0005 - Distribution Board Cupboard (0.83 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0006 - Shower/Change (65.57 m2)

Partition Walls (Cubicles) Compressed AC Sheet
8541/B00D/R0006/Partition Walls (Cubicles)/S31

No Asbestos Detected

B00D - R0007 - Shower/Change (100.01 m2)

No Asbestos

B00D - R0008 - Cleaning Store - Distributed (2.99 m2)

No Asbestos

B00D - R0009 - Cleaning Store - Distributed (5.53 m2)

No Asbestos

B00D - R0010 - Staff - Toilet (3.04 m2)

No Asbestos

B00D - R0011 - External Movement (19.73 m2)

No Asbestos

B00D - R0012 - External Movement (49.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies/Art - 1952 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8541/B00E/Eaves Linings/S30					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00E - R0001 - Materials Technology L.S. (134.19 m2)**

Wall Linings Internal	Flat AC Sheeting	25m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00E/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0002 - Materials Technology L.S. (111.38 m2)

Wall Linings Internal	Flat AC Sheeting	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00E/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0003 - Seminar/Technology Space (21.86 m2)

Wall Linings Internal	Flat AC Sheeting	25m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00E/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0004 - Materials Store (16.21 m2)

No Asbestos

B00E - R0005 - Materials Store (7.72 m2)

No Asbestos

B00E - R0006 - Materials Technology L.S. (103.52 m2)

No Asbestos

B00E - R0007 - Materials Store (12.17 m2)

No Asbestos

B00E - R0008 - Materials Store (7.75 m2)

No Asbestos

B00E - R0009 - Cleaning Store - Distributed (3.42 m2)

No Asbestos

B00E - R0010 - Materials Store (27.86 m2)

No Asbestos

B00E - R0011 - Design L.S. (74.72 m2)

No Asbestos

B00E - R0012 - Movement (4.56 m2)

No Asbestos

B00E - R0014 - Staff Study (35.52 m2)

No Asbestos

B00E - R0015 - Staff - Toilet (5.74 m2)

No Asbestos

B00E - R0016 - Staff - Toilet (5.7 m2)

No Asbestos

B00E - R0017 - Design L.S. (80 m2)

No Asbestos

B00E - R0018 - Materials Technology L.S. (103.52 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R0019 - Materials Store (16.18 m2)						
No Asbestos						
B00E - R0020 - Materials Store (7.81 m2)						
No Asbestos						
B00E - R0021 - Movement (143.23 m2)						
No Asbestos						
B00E - R0023 - Art Learning Space (60.06 m2)						
No Asbestos						
B00E - R0024 - Resources Store (13.46 m2)						
No Asbestos						
B00E - R0026 - Darkroom Space (54.52 m2)						
No Asbestos						
B00E - R0027 - Art Learning Space (81.62 m2)						
No Asbestos						
B00E - R0028 - Staff Study (16.16 m2)						
No Asbestos						
B00E - R0031 - Resources Store (17.44 m2)						
No Asbestos						
B00E - R0032 - Distribution Board Cupboard (1.53 m2)						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	0.4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00E/R0032/Electrical Mounting Board/S29					Chrysotile (white asbestos)	
B00E - R0033 - Computer Learning Space (50.64 m2)						
No Asbestos						
B00E - R0034 - Movement (5.54 m2)						
No Asbestos						
B00E - R0035 - Movement (41.27 m2)						
No Asbestos						
B00E - R0036 - Movement (8.24 m2)						
No Asbestos						
B00E - R0037 - Art Learning Space (76.85 m2)						
No Asbestos						
B00E - R0038 - External Movement (4.81 m2)						
No Asbestos						
B00E - R0039 - External Movement (4.78 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Science/Music - 1952 - Concrete Framed (Concrete Framed)**Exterior**

Wall Cladding	Galbestos 8541/B00G/Wall Cladding/S53					No Asbestos Detected
Awnings	Flat AC Sheeting 8541/B00G/Awnings/S25					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 8541/B00G/Underfloor Voids/S47	50m2	South	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00G - R0001 - Cleaning Store - Distributed (5.51 m2)**

No Asbestos

B00G - R0002 - General Storeroom (6.46 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0003 - Cleaning Store - Distributed (6.51 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0004 - Movement (22.1 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0005 - General Learning Space (53.57 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00G - R0006 - General Learning Space (53.87 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00G - R0007 - General Learning Space (52.99 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00G - R0008 - General Learning Space (53.72 m2)

Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	---	--	--	--	--	--

B00G - R0009 - Stage (26.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0010 - Performing Arts Changeroom (7.95 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0011 - Performing Arts Changeroom (7.95 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0012 - Distribution Board Cupboard (0.65 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0014 - Careers Advisers Office (29.65 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0015 - Cleaning Store - Distributed (4.86 m2)						
No Asbestos						
B00G - R0017 - Movement (319.9 m2)						
No Asbestos						
B00G - R0018 - Student Canteen (43.64 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8541/B00G/R0018/Wall Linings Internal/S14	15m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0018/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00G - R0019 - General Storeroom (4.81 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0019/Floor Coverings Res/Textile/S16	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0020 - Staff - Toilet (3.11 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0019/Floor Coverings Res/Textile/S16	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0021 - Disabled Toilet (9.86 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0023 - Distribution Board Cupboard (1.15 m2)				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Electrical Mounting Board	Resinous Board					
8541/B00G/R0023/Electrical Mounting Board/S48					No Asbestos Detected	
B00G - R0024 - Apparatus Store (28.97 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	28.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0024/Floor Coverings Res/Textile/S49					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
8541/B00G/R0024/Floor Coverings Res/Textile/S50					No Asbestos Detected	
B00G - R0025 - Laboratory L.S. (87.14 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Workbench	Flat AC Sheeting	2m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8541/B00G/R0025/Workbench/S17					Chrysotile (white asbestos)	
B00G - R0026 - Preparation (29.34 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0027 - Growing/Breeding (9.57 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0028 - Laboratory L.S. (87.41 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Workbench	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0025/Workbench/S17					Chrysotile (white asbestos)	
B00G - R0029 - General Storeroom (5.5 m2)						
No Asbestos						
B00G - R0030 - External Movement (71.52 m2)						
No Asbestos						
B00G - R0031 - Stairs (5.24 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0032 - Interview (7.07 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0033 - Movement (27.88 m2)						
Ceiling Structures/Linings	Vermiculite					
8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0034 - Stairs (4.5 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R0035 - General Storeroom (4.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
B00G - R0036 - Stairs (9.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R0037 - Stairs (4.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R0038 - External Movement (2.13 m2)						
No Asbestos						
B00G - R0040 - Lift (2.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8541/B00G/R2041/Ceiling Structures/Linings/S52					No Asbestos Detected
B00G - R0041 - Movement (119.29 m2)						
Floor Coverings Res/Textile	Adhesive					
	8541/B00G/R0024/Floor Coverings Res/Textile/S50					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0024/Floor Coverings Res/Textile/S49					Chrysotile (white asbestos)
B00G - R1001 - Movement (16.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
B00G - R1002 - Cleaning Store - Distributed (3.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00G - R1003 - Communication Space (17.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	47.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
B00G - R1005 - Study Space (12.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1006 - Study Space (12.99 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R1006/Floor Coverings Res/Textile/S18	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1007 - General Learning Space (66.88 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1008 - Study Space (12.96 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1009 - Study Space (12.99 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1010 - Staff Study (56.96 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1011 - Distribution Board Cupboard (0.66 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1013 - Staff Study (27.67 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R1006/Floor Coverings Res/Textile/S18	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1014 - General Learning Space (54.31 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1015 - General Storeroom (24.05 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 8541/B00G/R1015/Wall Linings Internal/S19					No Asbestos Detected
B00G - R1016 - General Learning Space (55.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 8541/B00G/R1015/Wall Linings Internal/S19					No Asbestos Detected
B00G - R1017 - Computer Learning Space (81.1 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1018 - Computer Learning Space (53.94 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1019 - Staff Study (29.08 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R1006/Floor Coverings Res/Textile/S18	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1020 - Staff - Toilet (9.86 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit Assumed Asbestos - Area inaccessible	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Partition Walls (Cubicles)	Compressed AC Sheet 8541/B00G/R1020/Partition Walls (Cubicles)/S20	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1021 - Distribution Board Cupboard (1.15 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1022 - Apparatus Store (24.27 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1023 - Laboratory L.S. (87.21 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Workbench	Compressed AC Sheet 8541/B00G/R0025/Workbench/S17	2m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1026 - Laboratory L.S. (87.73 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Workbench	Compressed AC Sheet 8541/B00G/R0025/Workbench/S17	2m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1027 - External Movement (75.94 m2)						
Infill Panel	Flat AC Sheeting 8541/B00G/R1027/Infill Panel/S51					No Asbestos Detected
B00G - R1028 - Stairs (16.73 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1029 - General Learning Space (53.43 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1030 - General Storeroom (6.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	6.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1031 - General Storeroom (6.31 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	6.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1032 - Movement (7.18 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1033 - Stairs (15.52 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1035 - Stairs (16.46 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1036 - Staff Study (38.95 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1037 - Stairs (16.99 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1038 - Lift (2.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8541/B00G/R2041/Ceiling Structures/Linings/S52					No Asbestos Detected
B00G - R1039 - Movement (213.72 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	213.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00G - R2001 - Movement (16.87 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2002 - External Movement (73.94 m2)						
No Asbestos						
B00G - R2003 - Cleaning Store - Distributed (3.87 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	3.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00G - R2004 - Senior Study (17.6 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00G - R2005 - General Learning Space (53.36 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2006 - General Learning Space (53.58 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00G - R2007 - General Learning Space (53.58 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R2008 - General Storeroom (12.99 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2009 - General Storeroom (6.37 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2010 - General Storeroom (6.33 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2011 - General Learning Space (57.85 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2013 - Distribution Board Cupboard (0.59 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8541/B00G/R2025/Ceiling Structures/Linings/S22	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2014 - Practice/Seminar (53.95 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2015 - Secure Storeroom (12.8 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2016 - Resources (26.49 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2017 - Practice/Seminar (26.57 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2018 - General Learning Space (64.97 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2019 - Practice/Seminar (28.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R2020 - Computer Learning Space (53.5 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	53.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2021 - Staff Study (26.79 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Ceiling Structures/Linings/S13					No Asbestos Detected
B00G - R2022 - Staff - Toilet (9.74 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8541/B00G/R1020/Partition Walls (Cubicles)/S20	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2023 - Movement (76.52 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2025 - Distribution Board Cupboard (1.15 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8541/B00G/R2025/Ceiling Structures/Linings/S22	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2026 - General Learning Space (51.43 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2027 - General Storeroom (6.33 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8541/B00G/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R2028 - General Storeroom (6.37 m2)						
Ceiling Structures/Linings	Vermiculite 8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2029 - General Learning Space (53.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2030 - General Learning Space (53.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2031 - General Storeroom (5.13 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2032 - General Learning Space (53.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2033 - Cleaning Store - Distributed (2.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2034 - General Storeroom (5.13 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00G - R2035 - Stairs (16.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00G - R2036 - Movement (7.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8541/B00G/R0004/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8541/B00G/R0004/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R2037 - Staff Study (27.46 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R1006/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)
B00G - R2038 - Stairs (14.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00G - R2039 - Stairs (15.74 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00G - R2040 - Stairs (16.44 m2)						
No Asbestos						
B00G - R2041 - Lift (2.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8541/B00G/R2041/Ceiling Structures/Linings/S52					No Asbestos Detected
B00G - R2042 - Movement (135.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8541/B00G/R0004/Ceiling Structures/Linings/S13					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	135.38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8541/B00G/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library/Technological & Applied Studies - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Awnings	Flat AC Sheeting 8541/B00H/Awnings/S24	20m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00H - R0003 - Toilets-Girls (14 m2)**

No Asbestos

B00H - R0004 - Distribution Board Cupboard (2.07 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0005 - Food Technology L.S. (102.93 m2)

No Asbestos

B00H - R0006 - Preparation - Materials (18.43 m2)

No Asbestos

B00H - R0007 - Laundry (11.94 m2)

No Asbestos

B00H - R0008 - Food Technology L.S. (103.08 m2)

No Asbestos

B00H - R0009 - Design L.S. (65.85 m2)

No Asbestos

B00H - R0011 - General Learning Space (67.35 m2)

No Asbestos

B00H - R0012 - External Movement (9.24 m2)

No Asbestos

B00H - R0014 - Staff Kitchen (5.46 m2)

No Asbestos

B00H - R0015 - Staff Study (17.52 m2)

No Asbestos

B00H - R0016 - External Movement (23.48 m2)

No Asbestos

B00H - R0017 - Movement (81.3 m2)

No Asbestos

B00H - R0018 - Food Technology L.S. (41.2 m2)

No Asbestos

B00H - R0019 - Materials Store (18.79 m2)

No Asbestos

B00H - R1001 - Toilets-Boys (17.27 m2)

No Asbestos

B00H - R1002 - Movement (13.74 m2)

No Asbestos

B00H - R1003 - Distribution Board Cupboard (1.47 m2)

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R1004 - Toilets-Girls (17.27 m2)						
No Asbestos						
B00H - R1005 - Main Area (444.79 m2)						
No Asbestos						
B00H - R1006 - Workroom (42.44 m2)						
No Asbestos						
B00H - R1007 - Audio Visual Workroom (43.5 m2)						
No Asbestos						
B00H - R1008 - Librarian (13.72 m2)						
No Asbestos						
B00H - R1009 - Seminar (14.4 m2)						
No Asbestos						
B00H - R1010 - Seminar (14.7 m2)						
No Asbestos						
B00H - R1011 - Seminar (14.44 m2)						
No Asbestos						
B00H - R1012 - External Movement (2.01 m2)						
No Asbestos						
B00H - R1014 - External Movement (22 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Building Services - 2007 - Steel (Steel)

Exterior

Ceiling Voids No Asbestos Found

Interior

B00I - R0001 - General Storeroom (97.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8541_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017