


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Lord Howe Island Central School (1921)
Region : North Coast
State Electorate : Port Macquarie
Local Government Area : Unincorporated

Initial Survey : Noel Arnold & Associates : 10 - Jun - 2008
Register Issue Date : 22 - Mar - 2017

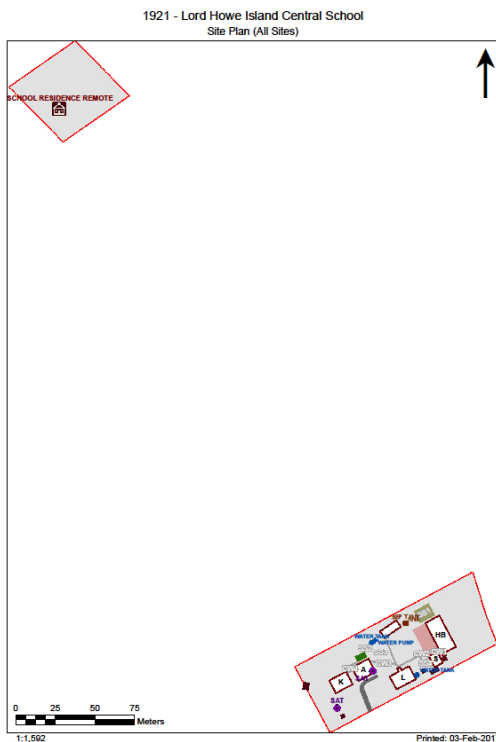

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/Staff Facilities - 1927 - Timber (Timber)**Exterior**

In-fill-panel	Flat AC Sheeting	4m2	North, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Debris beneath Stairs	Flat AC Sheeting	1m2	North (beneath stairs)	Poor Condition (4)	Low (1)	Low Priority (2-3)
	1921/B00A/Debris beneath Stairs/S10					Chrysotile (White asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00A - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
In-fill-panel	Flat AC Sheeting	4m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					

B00A - R0002 - Principal

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Wall Linings Internal	Flat AC Sheeting	1921/B00A/R0003/Wall Linings Internal/S9			No Asbestos Detected	

B00A - R0003 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	1921/B0HB/R0002/Floor Coverings Res/Textile/S1			No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	1921/B00A/R0003/Wall Linings Internal/S9			No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					

B00A - R0004 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Wall Linings Internal	Flat AC Sheeting	1921/B00A/R0003/Wall Linings Internal/S9			No Asbestos Detected	

B00A - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	1921/B0HB/R0002/Floor Coverings Res/Textile/S1			No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Wall Linings Internal	Flat AC Sheeting	1921/B00A/R0003/Wall Linings Internal/S9			No Asbestos Detected	

B00A - R0006 - Duplicating Workroom

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Wall Linings Internal	Flat AC Sheeting	1921/B00A/R0003/Wall Linings Internal/S9			No Asbestos Detected	
In-fill-panel	Flat AC Sheeting	3m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1992 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00K - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00K - R0002 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00K - R0003 - Practical Activities - 1hb

No Asbestos

B00K - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library/General Learning - 1951 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior

B00L - R0007 - External Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0008 - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0009 - Library Office/Workroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0010 - Reading Area

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0011 - Reading Area

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0012 - Seminar/Study

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00L - R0013 - Communications Room

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00S - Communal Facilities - 1978 - Steel (Steel)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00S - R0002 - External Movement

No Asbestos

B00S - R0003 - Cleaning Distributed Store

No Asbestos

B00S - R0004 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Pupil Facilities - 1978 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior**B00T - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting 1921/B00T/Room+1/Wall Linings Internal/S8	No Asbestos Detected
----------------------------	---	-----------------------------

Wall Linings Internal	Flat AC Sheeting 1921/B00T/Room+1/Wall Linings Internal/S8	No Asbestos Detected
-----------------------	---	-----------------------------

B00T - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 1921/B00T/Room+1/Wall Linings Internal/S8	No Asbestos Detected
----------------------------	---	-----------------------------

Wall Linings Internal	Flat AC Sheeting 1921/B00T/Room+1/Wall Linings Internal/S8	No Asbestos Detected
-----------------------	---	-----------------------------

B00T - R0004 - External Movement

No Asbestos

B00T - R0005 - Disabled Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0HB - General Learning/Special Purpose Learning - 1968 - Steel (Steel)**Exterior**

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

In-fill-panel	Compressed AC Sheet	8m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	---------------------	-----	----------------------	--------------------	---------	--------------------

1921/B0HB/R0001/In-fill-panel/S2

Chrysotile (White asbestos)

Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior**B0HB - R0001 - External Movement**

In-fill-panel	Compressed AC Sheet	6m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	---------------------	----	---------------------	--------------------	---------	--------------------

1921/B0HB/R0001/In-fill-panel/S2

Chrysotile (White asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos**B0HB - R0002 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles					
	1921/B0HB/R0002/Floor Coverings Res/Textile/S1					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting					
	1921/B0HB/R0006/Ceiling Structures/Linings/S7					No Asbestos Detected

B0HB - R0003 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting					
	1921/B0HB/R0006/Ceiling Structures/Linings/S7					No Asbestos Detected

B0HB - R0004 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles					
	1921/B0HB/R0002/Floor Coverings Res/Textile/S1					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting					
	1921/B0HB/R0006/Ceiling Structures/Linings/S7					No Asbestos Detected

B0HB - R0005 - Home Base Store

No Asbestos

B0HB - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	1921/B0HB/R0002/Floor Coverings Res/Textile/S1					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting					
	1921/B0HB/R0006/Ceiling Structures/Linings/S7					No Asbestos Detected

B0HB - R0009 - Kiln Room

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B0HB - R0010 - Store

Recently Modified Space	Requires Inspection
-------------------------	---------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017