


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Laggan Public School (2354)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Upper Lachlan

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 12 - Jul - 2015

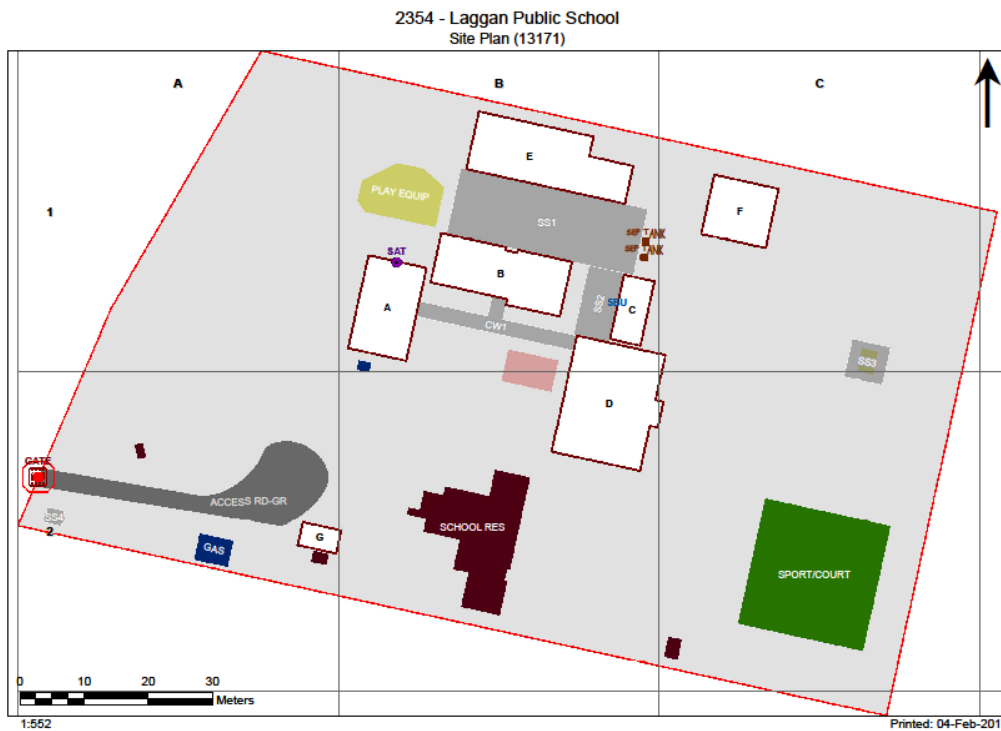

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00A - R0001 - Principal

No Asbestos

B00A - R0002 - Sick Bay

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0003 - Entry Vestibule

No Asbestos

B00A - R0004 - Clerical Office/Workroom

No Asbestos

B00A - R0005 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0007 - Staff Room

No Asbestos

B00A - R0008 - Staff Toilet

No Asbestos

B00A - R0009 - Staff Toilet

No Asbestos

B00A - R0010 - Cleaning Distributed Store

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/R0012/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00A - R0013 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2354/B00A/R0013/Electrical Mounting Board/S7					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1910 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0007/Wall Linings Internal/S2					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00B - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00B - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00B - R0003 - Reading Area

No Asbestos

B00B - R0004 - Movement

Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0007/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00B - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0005/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0006 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0007/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00B - R0007 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00B/R0007/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00B - R0008 - Home Base

Electrical Mounting Board	Resinous Board	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2354/B00B/R0008/Electrical Mounting Board/S9					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00C/Eaves Linings/S10					Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	36m2	False ceiling above corrugated metal	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - No access point to ceiling void during
Underfloor Voids - Slab on Ground	No Asbestos Found					
Awnings	Flat AC Sheeting					No Asbestos Detected
	2354/B00C/Awnings/S11					

Interior**B00C - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00C/Eaves Linings/S10					Chrysotile (white asbestos)

B00C - R0002 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00C/Eaves Linings/S10					Chrysotile (white asbestos)

B00C - R0003 - Toilets - Girls

No Asbestos

B00C - R0004 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - No ceiling access hatch to ceiling void.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00D - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)

B00D - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00D - R0003 - Kiln Room

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected
Insulation to Kiln	Encapsulated Insulation material within unit 2354/B00D/R0003/Insulation to Kiln/S12					
						No Asbestos Detected

B00D - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00D - R0008 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2354/B00D/R0008/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00D - R0009 - Withdrawal Space - 1hb

No Asbestos

B00D - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)

B00D - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00A/Eaves Linings/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1977 - Steel (Steel)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00E - R0001 - Raised Platform**

Wall Linings Internal	Flat AC Sheeting					
	2354/B00E/R0002/Wall Linings Internal/S5					No Asbestos Detected

B00E - R0002 - Communal Space

Wall Linings Internal	Flat AC Sheeting					
	2354/B00E/R0002/Wall Linings Internal/S5					No Asbestos Detected

B00E - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Communal Space

No Asbestos

B00F - R0002 - General Storeroom

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2008 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Ends	Flat AC Sheeting	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2354/B00G/R0001/Wall Linings Internal/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00G - R0001 - Other

Wall Linings Internal	Flat AC Sheeting	34m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2354/B00G/R0001/Wall Linings Internal/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017