


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lake Cargelligo Central School (2359)
Region : Riverina
State Electorate : Barwon
Local Government Area : Lachlan

Initial Survey : Noel Arnold & Associates : 18 - Dec - 2009
Reviewed By : Parsons Brinckerhoff : 14 - Feb - 2017

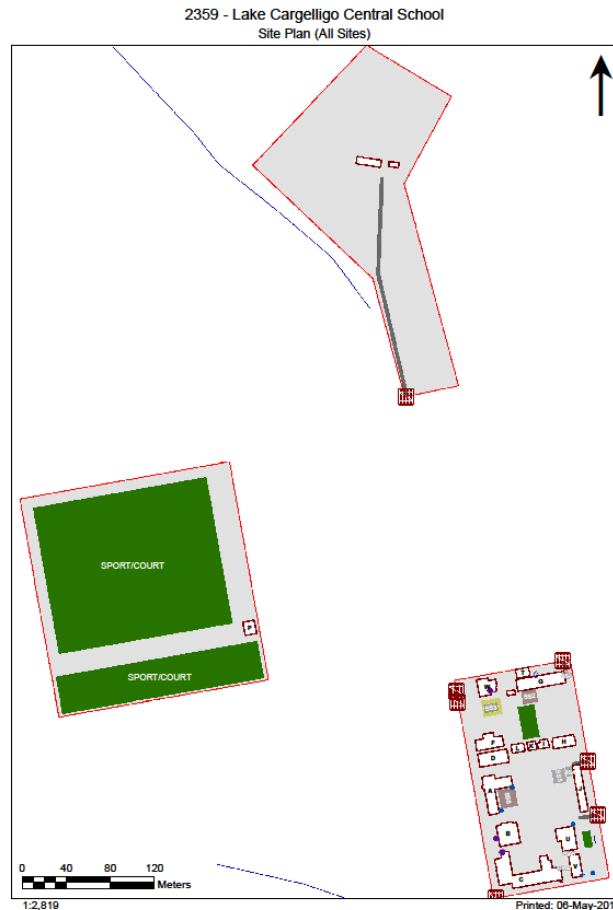

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						
Underfloor Voids	AC Fragments/Debris	60m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2359/B00A/Underfloor Voids/S20					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00A - R0001 - Movement (84.51 m2)						
No Asbestos						
B00A - R0002 - Staff Room Annexe (18.19 m2)						
No Asbestos						
B00A - R0003 - General Storeroom (5.89 m2)						
No Asbestos						
B00A - R0004 - Art Learning Space (88.12 m2)						
No Asbestos						
B00A - R0005 - Kiln Room (9.37 m2)						
No Asbestos						
B00A - R0006 - Resources Store (6.09 m2)						
No Asbestos						
B00A - R0007 - Clerical Office (12.44 m2)						
No Asbestos						
B00A - R0008 - Duplicating Workroom (12.4 m2)						
No Asbestos						
B00A - R0009 - Main Switch Board (3 m2)						
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2359/B00A/R0009/Electrical Mounting Board/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2359/B00A/R0009/Wall Linings Internal/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00A - R0010 - Principal (19.17 m2)						
No Asbestos						
B00A - R0011 - Clerical Office/Workroom (12.61 m2)						
No Asbestos						
B00A - R0012 - External Movement (5.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	2359/B00A/R0012/Ceiling Structures/Linings/S8					No Asbestos Detected
B00A - R0013 - External Movement (2.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2359/B00A/R0013/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0014 - Deputy Principal (12.51 m2)

No Asbestos

B00A - R0015 - Security Store (12.57 m2)

No Asbestos

B00A - R0016 - Staff Toilet (6 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2359/B00A/R0016/Partition Walls (Cubicles)/S10				Chrysotile (white asbestos)		

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00A - R0017 - Staff Toilet (6.04 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not able to be sampled due to no						

B00A - R0018 - Cleaning Supplies (6.04 m2)

No Asbestos

B00A - R0019 - Staff Room (63.93 m2)

No Asbestos

B00A - R0020 - General Learning Space (18.85 m2)

No Asbestos

B00A - R0021 - General Learning Space (15.16 m2)

No Asbestos

B00A - R0022 - Sick Bay (9.45 m2)

No Asbestos

B00A - R0023 - Movement (21.68 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Library - 1979 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						

Interior**B00B - R0001 - External Movement (13.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00B - R0002 - Staff Toilet (2.86 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0003 - Distribution Board (0.66 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to live electrical						

B00B - R0004 - Cleaning Distributed Store (1.58 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0005 - Staff Toilet (3.58 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0006 - Entry Vestibule (29.17 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0007 - K.L.A. Store (12.9 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0008 - Communications Room (12.83 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0009 - K.L.A. Store (12.79 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0010 - Seminar/Study (12.83 m2)

Ceiling Structures/Linings	Vermiculite					
	2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0011 - Reading Area (160.66 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting	15m2	South facing, East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0012 - Reading Area (52.95 m2)

Ceiling Structures/Linings	Vermiculite 2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting	4m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00B - R0013 - Library Office/Workroom (6 m2)

Ceiling Structures/Linings	Vermiculite 2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00B - R0014 - Library Office/Workroom (19.72 m2)

Ceiling Structures/Linings	Vermiculite 2359/B00C/R0007/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1972 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00C - R0001 - Garden Store (14.8 m2)

No Asbestos

B00C - R0002 - Staff Room Annexe (42.39 m2)

Ceiling Structures/Linings Vermiculite
 2359/B00C/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Staff Toilet (3.97 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00C - R0004 - Staff Toilet (3.95 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
-------------	--	----------	-------------	----------------------	---------	--------------------

Assumed Asbestos - Not able to be sampled due to no

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00C - R0005 - Darkroom Space (27.53 m2)

No Asbestos

B00C - R0006 - Sports Store (26.8 m2)

No Asbestos

B00C - R0007 - Laboratory L.S. (91.88 m2)

Ceiling Structures/Linings Vermiculite
 2359/B00C/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 2359/B00C/R0007/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

B00C - R0008 - Preparation (48.87 m2)

Ceiling Structures/Linings Vermiculite
 2359/B00C/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0009 - Laboratory L.S. (92.6 m2)

Ceiling Structures/Linings Vermiculite
 2359/B00C/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles
 2359/B00C/R0007/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

B00C - R0010 - General Learning Space (60.54 m2)

Ceiling Structures/Linings Vermiculite
 2359/B00C/R0007/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0011 - Cleaning Distributed Store (3.91 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0012 - Apparatus Store (18.35 m2)						
No Asbestos						
B00C - R0013 - Distribution Board (0.67 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0014 - Plant (12.29 m2)						
No Asbestos						
B00C - R0015 - Resource/Project Store (10.47 m2)						
No Asbestos						
B00C - R0016 - Materials Store (16.23 m2)						
No Asbestos						
B00C - R0017 - Materials Technology L.S. (144.65 m2)						
Ceiling Structures/Linings	Vermiculite					
		2359/B00C/R0007/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Welding Area (4.23 m2)						
No Asbestos						
B00C - R0019 - Staff Room Annexe (16.71 m2)						
Ceiling Structures/Linings	Vermiculite					
		2359/B00C/R0007/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0020 - General Storeroom (14.27 m2)						
No Asbestos						
B00C - R0022 - External Movement (147.02 m2)						
No Asbestos						
B00C - R0023 - Stairs (6.14 m2)						
No Asbestos						
B00C - R0024 - External Stairs (6.24 m2)						
No Asbestos						
B00C - R0025 - Dust Extraction Space (3.02 m2)						
No Asbestos						
B00C - R0026 - Materials Store (14.28 m2)						
No Asbestos						
B00C - R0027 - External Movement (66.38 m2)						
No Asbestos						
B00C - R1001 - Special Programs Room (51.88 m2)						
No Asbestos						
B00C - R1002 - Plant (20.35 m2)						
No Asbestos						
B00C - R1003 - General Storeroom (5.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		2359/B00C/R0007/Floor Coverings Res/Textile/S2				No Asbestos Detected
B00C - R1004 - Staff Room Annexe (33.07 m2)						
No Asbestos						
B00C - R1005 - Movement (21.29 m2)						
No Asbestos						
B00C - R1006 - General Learning Space (51.15 m2)						
No Asbestos						
B00C - R1007 - General Learning Space (50.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R1008 - General Learning Space (51.66 m2)

No Asbestos

B00C - R1009 - General Learning Space (50.78 m2)

No Asbestos

B00C - R1010 - Distribution Board (0.73 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	----------------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00C - R1011 - Plant (11.83 m2)

No Asbestos

B00C - R1012 - Cleaning Supplies (12.61 m2)

Floor Coverings Res/Textile

Vinyl Tiles

2359/B00C/R0007/Floor Coverings Res/Textile/S2

No Asbestos Detected

B00C - R1013 - Movement (8.15 m2)

No Asbestos

B00C - R1019 - General Learning Space (7.85 m2)

Floor Coverings Res/Textile

Vinyl Tiles

2359/B00C/R0007/Floor Coverings Res/Textile/S2

No Asbestos Detected

B00C - R1020 - Plant (13.17 m2)

No Asbestos

B00C - R1021 - External Movement (124.52 m2)

No Asbestos

B00C - R1022 - External Stairs (22.23 m2)

No Asbestos

B00C - R1023 - External Stairs (22.87 m2)

No Asbestos

B00C - R1024 - Food/Research Space (19.63 m2)

No Asbestos

B00C - R1025 - Laundry (1.15 m2)

No Asbestos

B00C - R1026 - Change (2.17 m2)

No Asbestos

B00C - R1027 - Movement (5.04 m2)

No Asbestos

B00C - R1028 - Pantry (11.45 m2)

No Asbestos

B00C - R1029 - Kitchen - Type 1 (114.27 m2)

No Asbestos

B00C - R1030 - Food/Research Space (15.14 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Physical Education - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris					
	2359/B00D/Underfloor Voids/S21					No Asbestos Detected

Interior

B00D - R0001 - Toilets-Disabled (3.44 m2)

No Asbestos

B00D - R0002 - Toilets - Boys/Girls (4.81 m2)

No Asbestos

B00D - R0003 - Sports Store (10.7 m2)

No Asbestos

B00D - R0004 - Staff Kitchen (11.23 m2)

No Asbestos

B00D - R0005 - Multi-Purpose Space (273.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1972 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00F - R0001 - Movement (58.15 m2)

No Asbestos

B00F - R0002 - Staff Room Annexe (12.52 m2)

No Asbestos

B00F - R0003 - Home Base (44.9 m2)

No Asbestos

B00F - R0004 - General Learning Space (44.97 m2)

No Asbestos

B00F - R0005 - Home Base (44.96 m2)

No Asbestos

B00F - R0006 - Personal Effects Storage (1.3 m2)

No Asbestos

B00F - R0007 - Personal Effects Storage (1.3 m2)

No Asbestos

B00F - R0008 - Personal Effects Storage (1.41 m2)

No Asbestos

B00F - R0009 - Sports Store (8.08 m2)

Wall Linings Internal Flat AC Sheeting
2359/B00F/R0009/Wall Linings Internal/S4

No Asbestos Detected

Ceiling Structures/Linings Flat AC Sheeting
2359/B00F/R0009/Wall Linings Internal/S4

No Asbestos Detected

B00F - R0010 - Security Store (8.85 m2)

No Asbestos

B00F - R0011 - Staff Room Annexe (9.44 m2)

No Asbestos

B00F - R0012 - Cleaning Distributed Store (8.25 m2)

Wall Linings Internal Flat AC Sheeting 10m2 East facing Good Condition (1) Low (1) Low Priority (2-3)
2359/B00F/R0012/Wall Linings Internal/S3 **Chrysotile (white asbestos)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						
Eaves Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						
Window In-fill-panel	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Window In-fill-panel	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Ceiling Voids	AC Fragments/Debris	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2359/B00G/Ceiling Voids/S19					Chrysotile (white asbestos)	

Interior

B00G - R0001 - Practical Activities - 1hb (20.13 m2)

No Asbestos

B00G - R0002 - Home Base (54.31 m2)

No Asbestos

B00G - R0003 - Plant (3.19 m2)

No Asbestos

B00G - R0004 - Home Base (84.62 m2)

No Asbestos

B00G - R0005 - Practical Activities - 1hb (16.55 m2)

No Asbestos

B00G - R0006 - Toilets - Boys/Girls (3.24 m2)

No Asbestos

B00G - R0007 - Shower/Change (19.05 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00G - R0008 - Staff Toilet (4.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to no access to						
B00G - R0009 - Movement (11.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0010 - Plant (0.73 m2)						
No Asbestos						
B00G - R0011 - Toilets - Girls (22.21 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0012 - Drinking Facilities (65.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0013 - Staff Toilet (2.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0014 - No Access (0.57 m2)						
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to live electrical						
B00G - R0015 - No Access (0.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0016 - General Storeroom (14.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
B00G - R0017 - General Storeroom (0.79 m2)						
No Asbestos						
B00G - R0018 - Toilets - Boys (19.94 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<p>Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and</p>						

B00G - R0019 - Movement (8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<p>Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and</p>						

B00G - R0020 - Cleaning Distributed Store (1.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<p>Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and</p>						

B00G - R0021 - External Movement (70.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<p>Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and</p>						

Window In-fill-panel	Flat AC Sheeting	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<p>Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and</p>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - General Learning - 1890 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						

Interior**B00H - R0001 - External Movement (43.1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00H - R0002 - Home Base (53.98 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00H - R0003 - Home Base (67.35 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00H - R0004 - Movement (3.46 m2)

No Asbestos

B00H - R0005 - Staff Room Annexe (13.36 m2)

No Asbestos

B00H - R0006 - General Storeroom (9.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Support Unit - 1972 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						
In-fill-panel	Flat AC Sheeting	1m2	At Air Vent	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Interior

B00I - R0001 - External Movement (13.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Wall Linings Internal	Flat AC Sheeting	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00I - R0002 - Home Base - M (41.49 m2)

No Asbestos

B00I - R0003 - Toilet - M (10.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						

Interior

B00J - R0001 - Staff Toilet (4 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2359/B00C/R0007/Ceiling Structures/Linings/S1	No Asbestos Detected				
Incinerator	Encapsulated Insulation material within unit 2359/B00C/R0007/Ceiling Structures/Linings/S1	No Asbestos Detected				

B00J - R0002 - Canteen Office/Store (3.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00J - R0003 - Canteen (38.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00J - R0004 - External Movement (16.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00J - R0005 - General Storeroom (61.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2359/B00C/R0007/Ceiling Structures/Linings/S1	No Asbestos Detected				
----------------------------	---	-----------------------------	--	--	--	--

B00J - R0006 - Toilets - Boys (22.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00J - R0007 - Staff Toilet (3.91 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

B00J - R0008 - Shower/Change (17.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0009 - Distribution Board (0.69 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0010 - External Movement (6.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0011 - Cleaning Distributed Store (3.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0012 - Plant (1.67 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0013 - Toilets - Girls (24.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
-------------	--	----------	--------------	----------------------	---------	--------------------

Assumed Asbestos - Not sampled due to no access to

B00J - R0015 - Seminar/Study (25.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0016 - External Movement (36.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and

B00J - R0017 - Plant (4.95 m2)

No Asbestos

B00J - R0018 - Movement (1.99 m2)

No Asbestos

B00J - R0019 - Staff - Toilet (2.14 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1913 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to height of eaves >						
In-fill-panel	Flat AC Sheeting	1m2	At Air Vent	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to proximity of students and staff, should be sampled when students and						

Interior

B00K - R0001 - External Movement (15.34 m2)	No Asbestos					
B00K - R0002 - General Learning Space (30.05 m2)	No Asbestos					
B00K - R0003 - General Learning Space (10.74 m2)	No Asbestos					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1972 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Interior

B00L - R0001 - External Movement (22.46 m2)

No Asbestos

B00L - R0002 - Home Base (50.94 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	---------------	--------------------	---------	--------------------

Assumed Asbestos - Not sampled due to proximity of staff

B00L - R0003 - Movement (3.65 m2)

No Asbestos

B00L - R0004 - Withdrawal Space - 1hb (6.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Agricultural Science - 1940 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00M - R0001 - Movement (10.66 m2)

No Asbestos

B00M - R0002 - General Storeroom (7.04 m2)

No Asbestos

B00M - R0003 - Staff Toilet (2.16 m2)

No Asbestos

B00M - R0004 - No Access (2.5 m2)

No Asbestos

B00M - R0005 - Movement (2.89 m2)

No Asbestos

B00M - R0006 - Movement (25.95 m2)

No Asbestos

B00M - R0007 - Animal Space (24.49 m2)

No Asbestos

B00M - R0008 - Garden Store (35.3 m2)

No Asbestos

B00M - R0009 - External Movement (14.87 m2)

Wall Linings Internal Flat AC Sheeting
2359/B00M/R0009/Wall Linings Internal/S5

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Agricultural Science - 1913 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Interior

B00N - R0001 - Garden Store (13.45 m2)

No Asbestos

B00N - R0002 - General Storeroom (13.27 m2)

No Asbestos

B00N - R0003 - Other-Vacant (13.4 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 1979 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Electrical mounting board	Resinous Board	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Not able to be sampled due to live

Interior

B00P - R0001 - Toilets - Boys (48.4 m2)

No Asbestos

B00P - R0002 - Plant (21.06 m2)

No Asbestos

B00P - R0003 - Toilets - Girls (48.1 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
-------------	--	----------	--------------	----------------------	---------	--------------------

Assumed Asbestos - Not sampled due to no access to

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Building Services - 2006 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00T - R0001 - Garage/Carport (66.78 m2)

No Asbestos

B00T - R0002 - General Assistants (21.14 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B00U - R0001 - General Learning Space (59.98 m2)

No Asbestos

B00U - R0002 - Science Laboratory (59.89 m2)

No Asbestos

B00U - R0003 - Preparation - Science (30.31 m2)

No Asbestos

B00U - R0004 - Staff Room (21.11 m2)

No Asbestos

B00U - R0005 - Seminar - Type 2 (21.11 m2)

No Asbestos

B00U - R0006 - Chemical Store (12.2 m2)

No Asbestos

B00U - R0007 - Apparatus Storage (6.18 m2)

No Asbestos

B00U - R0008 - Movement (13.8 m2)

No Asbestos

B00U - R0009 - Main Switch Board (0.62 m2)

No Asbestos

B00U - R0010 - External Movement (83.3 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - General Learning - 2015 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found
Ceiling Voids - Raked Ceiling	No Asbestos Found

Interior

B00V - R0001 - Movement (40.33 m2)

No Asbestos

B00V - R0002 - General Learning Space (70.62 m2)

No Asbestos

B00V - R0003 - General Learning Space (46.61 m2)

No Asbestos

B00V - R0004 - General Learning Space (22.52 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017