


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lakemba Public School (2360)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 14 - Jan - 2010
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

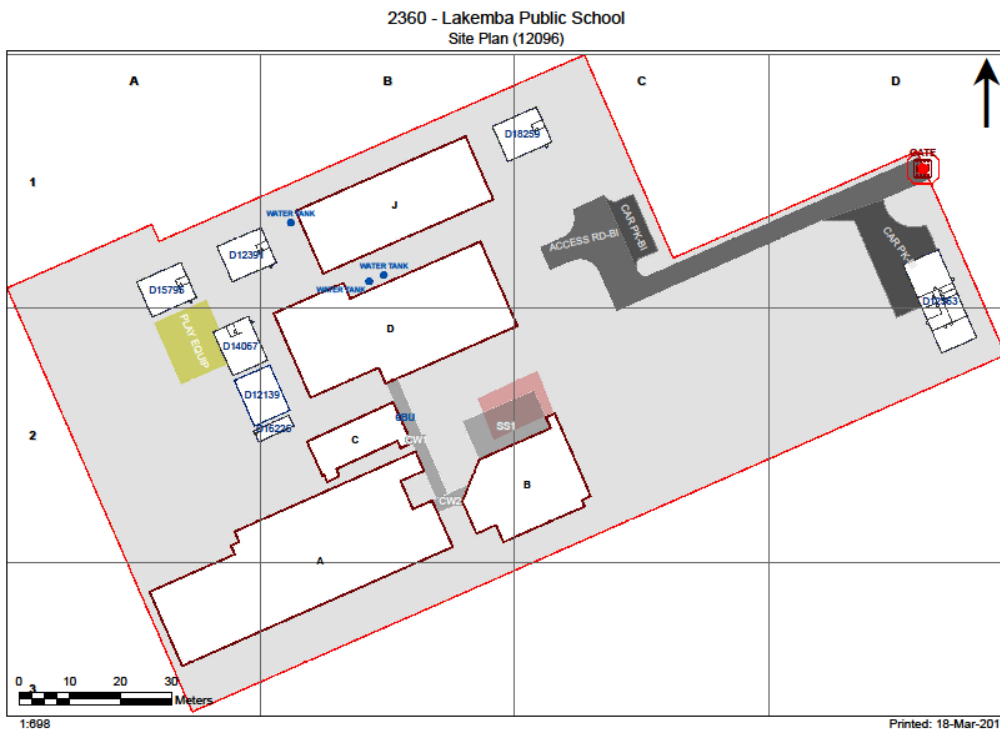

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Tiered Learning - 1922 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/Ceiling Voids/S14				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids	Vinyl Tiles	1m2	Scattered Throughout Western side	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/Underfloor Voids/S25				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Movement (12.79 m2)**

No Asbestos

B00A - R0002 - Cleaning Supplies (12.14 m2)

No Asbestos

B00A - R0003 - Toilets - Boys (20.3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found					

B00A - R0004 - General Storeroom (3.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R0004/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)	

B00A - R0005 - Distribution Board (0.57 m2)

Note: No inspection of live electrical installation.

Non Accessible

B00A - R0006 - Toilets - Girls (23.54 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1002/Partition Walls (Cubicles)/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found					

B00A - R0007 - Special Programs Room (35.26 m2)

Ceiling Structures/Linings	Vermiculite					
	2360/B00A/R0007/Ceiling Structures/Linings/S17				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00A - R0008 - Withdrawal Space - 1hb (12.33 m2)

Ceiling Structures/Linings No Asbestos Found

B00A - R0009 - Home Base (59.75 m2)

No Asbestos

B00A - R0010 - Home Base Store (5.42 m2)

Ceiling Structures/Linings No Asbestos Found

B00A - R0011 - Home Base (59.8 m2)

Ceiling Structures/Linings No Asbestos Found

B00A - R0012 - Home Base Store (5.29 m2)

Ceiling Structures/Linings No Asbestos Found

B00A - R0013 - Movement (64.51 m2)

Ceiling Structures/Linings	Vermiculite					
	2360/B00A/R0013/Ceiling Structures/Linings/S15				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Ceiling Structures/Linings No Asbestos Found

B00A - R0014 - Practical Activities - 1hb (22.8 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Withdrawal Space - 1hb (12.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2360/B00A/R0015/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	
B00A - R0016 - Personal Effects Storage (13.39 m2)						
No Asbestos						
B00A - R0017 - Home Base (61.5 m2)						
No Asbestos						
B00A - R0018 - Home Base Store (5.13 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R0019 - Home Base (62.24 m2)						
No Asbestos						
B00A - R0020 - Home Base Store (5.42 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R0021 - Practical Activities - 1hb (31.62 m2)						
Panel to ceiling around duct	No Asbestos Found					
B00A - R0022 - Movement (9.66 m2)						
No Asbestos						
B00A - R0023 - Movement (1.9 m2)						
No Asbestos						
B00A - R0024 - General Storeroom (4.79 m2)						
No Asbestos						
B00A - R0025 - Personal Effects Storage (7.22 m2)						
No Asbestos						
B00A - R0026 - Withdrawal Space - 1hb (12.01 m2)						
No Asbestos						
B00A - R0027 - Home Base (62.41 m2)						
No Asbestos						
B00A - R0028 - Home Base Store (5.41 m2)						
No Asbestos						
B00A - R0029 - Practical Activities - 1hb (31.43 m2)						
Panel to ceiling around duct	No Asbestos Found					
B00A - R0030 - Home Base (61.19 m2)						
No Asbestos						
B00A - R0031 - Home Base Store (5.4 m2)						
No Asbestos						
B00A - R0032 - Main Switch Board (12.72 m2)						
No Asbestos						
B00A - R0033 - Movement (9.72 m2)						
No Asbestos						
B00A - R0034 - Movement (2.02 m2)						
No Asbestos						
B00A - R0035 - General Storeroom (5.44 m2)						
No Asbestos						
B00A - R0036 - Lift (1.61 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0037 - External Movement (159.48 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Recently Modified Space	Requires Inspection					
B00A - R0038 - Stairs (5.5 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0039 - Stairs (7.67 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0040 - Stairs (7.27 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1001 - Movement (13.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1001/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1002 - Toilets - Boys (20.23 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1002/Partition Walls (Cubicles)/S3			Chrysotile (white asbestos)		
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1003 - General Storeroom (3.81 m2)						
Ceiling Structures/Linings	Vermiculite	2360/B00A/R1003/Ceiling Structures/Linings/S27			Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1004 - Cleaning Distributed Store (0.74 m2)						
No Asbestos						
B00A - R1005 - Toilets - Girls (23.52 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1002/Partition Walls (Cubicles)/S3			Chrysotile (white asbestos)		
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1006 - Special Programs Room (47.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1001/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1007 - Practical Activities - 1hb (23.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1007/Ceiling Structures/Linings/S18			Chrysotile (white asbestos)		
B00A - R1008 - Home Base Store (6.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1008/Ceiling Structures/Linings/S19			Chrysotile (white asbestos)		
B00A - R1009 - Security Store (16.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1009/Ceiling Structures/Linings/S20			Chrysotile (white asbestos)		
B00A - R1010 - Movement (53.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00A/R1010/Ceiling Structures/Linings/S21			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite	2360/B00A/R1010/Ceiling Structures/Linings/S22			Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R1011 - Movement (17.55 m2)						
Ceiling Structures/Linings	No Asbestos Found					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1012 - Movement (3.4 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1013 - Home Base (62.18 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1014 - Practical Activities - 1hb (43.95 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1015 - Home Base (61.42 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1016 - Home Base Store (5.33 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1017 - Movement (7.95 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1018 - Home Base (61.13 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1019 - Home Base Store (5.33 m2)						
No Asbestos						
B00A - R1020 - General Storeroom (12.6 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1021 - Practical Activities - 1hb (43.71 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1022 - Home Base (60.95 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1023 - Home Base Store (5.12 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1024 - Personal Effects Storage (12.44 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1025 - Movement (3.56 m2)						
Ceiling Structures/Linings	No Asbestos Found					
B00A - R1026 - Stairs (19.26 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1027 - Stairs (12.55 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1028 - Stairs (12.56 m2)						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00B - Administration/Library - 1964 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2360/B00B/Eaves Linings/S2					No Asbestos Detected

Interior**B00B - R0001 - Interview (13.22 m2)**

No Asbestos

B00B - R0002 - Interview (12.97 m2)

No Asbestos

B00B - R0003 - Distribution Board (1.44 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0005 - Principal (21.81 m2)

No Asbestos

B00B - R0006 - Duplicating Workroom (22.35 m2)

No Asbestos

B00B - R0007 - Security Store (9.69 m2)

No Asbestos

B00B - R0008 - Plant (0.32 m2)

No Asbestos

B00B - R0009 - Staff Room (58.74 m2)

No Asbestos

B00B - R0014 - Sick Bay (8.63 m2)

No Asbestos

B00B - R0015 - Clerical Office/Workroom (13.26 m2)

No Asbestos

B00B - R0016 - Entry Vestibule (28.9 m2)

No Asbestos

B00B - R0017 - Movement (2.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2360/B00B/Eaves Linings/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00B - R0018 - Access Shower/Toilet (5.49 m2)

No Asbestos

B00B - R0019 - Toilet - Lobby (2.29 m2)

No Asbestos

B00B - R0020 - Staff Toilet (2.17 m2)

No Asbestos

B00B - R0021 - Toilet - Lobby (1.3 m2)

No Asbestos

B00B - R0022 - Staff Toilet (1.72 m2)

No Asbestos

B00B - R0023 - Toilet - Lobby (1.3 m2)

No Asbestos

B00B - R0024 - Staff Toilet (1.72 m2)

No Asbestos

B00B - R0025 - Deputy Principal (19.02 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0026 - Entry Vestibule (22.6 m2)						
No Asbestos						
B00B - R0027 - Lift (1.61 m2)						
No Asbestos						
B00B - R0028 - External Movement (48.66 m2)						
No Asbestos						
B00B - R0029 - Stairs (12.84 m2)						
No Asbestos						
B00B - R1001 - Reading Area (169.29 m2)						
No Asbestos						
B00B - R1002 - Distribution Board (1.61 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R1003 - Movement (18.14 m2)						
No Asbestos						
B00B - R1004 - K.L.A. Store (22.4 m2)						
No Asbestos						
B00B - R1005 - Communications Room (12.11 m2)						
No Asbestos						
B00B - R1006 - Library Office/Workroom (24.59 m2)						
No Asbestos						
B00B - R1007 - Stairs (12.84 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Staff Facilities - 1922 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/Eaves Linings/S5					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - No Access due to height restriction					
Underfloor Voids	Non Accessible Area - Unable to locate access panel					

Interior**B00C - R0001 - Staff Room Annexe (17.3 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0002 - Staff Toilet (2.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0003 - Movement (8.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0004 - Movement (2.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/Eaves Linings/S5					Chrysotile (white asbestos)

B00C - R0005 - Practical Activities - 1hb (17.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0006 - Home Base (54.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0007 - Home Base Store (10.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0008 - Distribution Board (0.35 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0009 - Personal Effects Storage (5.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/R0001/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)

B00C - R0010 - Movement (2.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00C/Eaves Linings/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Pupil Facilities - 1964 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2360/B00D/Eaves Linings/S7					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Movement (159.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	160m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00D/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Boys (12.92 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00D/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00D - R0003 - Cleaning Supplies (6.86 m2)

No Asbestos

B00D - R0004 - Toilets - Girls (12.94 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/B00D/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00D - R0005 - General Storeroom (25.32 m2)

No Asbestos

B00D - R0006 - Canteen Office/Store (3.11 m2)

No Asbestos

B00D - R0007 - Staff Toilet (3.09 m2)

No Asbestos

B00D - R0008 - Canteen Office/Store (5.29 m2)

No Asbestos

B00D - R0009 - Canteen (26.74 m2)

No Asbestos

B00D - R0010 - Communal Space (156.5 m2)

No Asbestos

B00D - R0011 - Hall Chair Store (2.41 m2)

No Asbestos

B00D - R0012 - Movement (2.46 m2)

No Asbestos

B00D - R0013 - Movement (2.46 m2)

No Asbestos

B00D - R0014 - General Storeroom (11.73 m2)

No Asbestos

B00D - R0015 - Raised Platform (31.7 m2)

No Asbestos

B00D - R0016 - Distribution Board (0.75 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0017 - Sports Store (19.97 m2)

No Asbestos

B00D - R0018 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0019 - General Storeroom (4.39 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00D - R0020 - Practical Activities - 1hb (38.55 m2)

No Asbestos

B00D - R0021 - Home Base Store (5.36 m2)

No Asbestos

B00D - R0022 - Home Base Store (4.78 m2)

No Asbestos

B00D - R0023 - Home Base (59.43 m2)

No Asbestos

B00D - R0024 - Movement (10.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

2360/B00D/R0001/Ceiling Structures/Linings/S6

Chrysotile (white asbestos)

B00D - R0025 - Withdrawal Space - 1hb (10.12 m2)

No Asbestos

B00D - R0026 - Movement (9.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

2360/B00D/R0001/Ceiling Structures/Linings/S6

Chrysotile (white asbestos)

B00D - R0027 - Home Base (59.55 m2)

No Asbestos

B00D - R0028 - Home Base Store (4.85 m2)

No Asbestos

B00D - R0029 - General Assistant/Bulk Store (11.64 m2)

No Asbestos

B00D - R0030 - Movement (12.55 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00J - R0001 - Practical Activities/Movement - 1hb (19.04 m2)**

No Asbestos

B00J - R0002 - Home Base (60.56 m2)

No Asbestos

B00J - R0003 - Home Base Store (6.09 m2)

No Asbestos

B00J - R0004 - Withdrawal Space - 2hb (11.68 m2)

No Asbestos

B00J - R0005 - Practical Activities/Movement - 1hb (19.14 m2)

No Asbestos

B00J - R0006 - Home Base (60.44 m2)

No Asbestos

B00J - R0007 - Home Base Store (6.12 m2)

No Asbestos

B00J - R0008 - Practical Activities/Movement - 1hb (18.61 m2)

No Asbestos

B00J - R0009 - Home Base (60.56 m2)

No Asbestos

B00J - R0010 - Home Base Store (6.09 m2)

No Asbestos

B00J - R0011 - Withdrawal Space - 2hb (11.75 m2)

No Asbestos

B00J - R0012 - Practical Activities - 1hb (19.12 m2)

No Asbestos

B00J - R0013 - Home Base (60.57 m2)

No Asbestos

B00J - R0014 - Home Base Store (6.12 m2)

No Asbestos

B00J - R0015 - External Movement (91.3 m2)

No Asbestos

B00J - R0016 - No Access (0.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - playground

Exterior

Ceiling Voids	Flat AC Sheeting	1m2	North West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2360/Build+1/Ceiling Voids/S26				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 751 - D12139 - Learning Unit - ESL : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2

R2 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2

OS 602 - D12391 - Learning Unit - Standard With P.A.A. : Placement Date - 16/11/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 534 - D12563 - Library/Group Study/Office/A V Store : Placement Date - 11/03/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		23.04 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior**R1 - Clerical Office**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
---------	---------------	------------------	--	--	--	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2
---------	---------------	------------------	--	--	--	-------

OS 602 - D14067 - Learning Unit - Standard With P.A.A. : Placement Date - 13/02/2014**Exterior**

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15795 - Learning Unit - Standard With P.A.A. : Placement Date - 14/03/2013**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Interior**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
---------	---------------	------------------	--	--	--	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2

OS 840 - D16225 - Girls Toilet : Placement Date - 25/07/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Toilets-Girls**

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
OS 602 - D18259 - Learning Unit - Standard With P.A.A. : Placement Date - 18/01/2017						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2360_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017