


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lansdowne Public School (2370)
Region : North Coast
State Electorate : Port Macquarie
Local Government Area : Greater Taree

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Oct - 2016

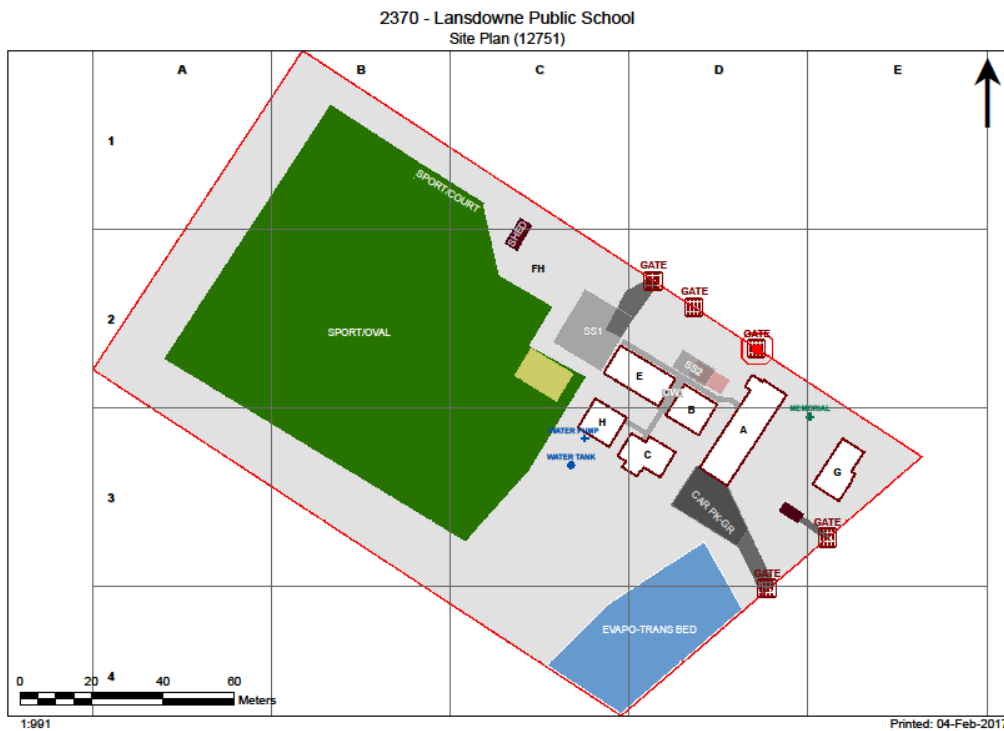

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00A/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	40m	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00A/Gable verge lining/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00A - R0001 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00A/R0001/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00A - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00A/R0001/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00A - R0003 - Home Base

No Asbestos

B00A - R0006 - Entry Vestibule

No Asbestos

B00A - R0007 - Clerical Office

No Asbestos

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0012 - Cleaning Distributed Store

No Asbestos

B00A - R0013 - Movement

No Asbestos

B00A - R0014 - Principal

No Asbestos

B00A - R0015 - Access Shower/Toilet

No Asbestos

B00A - R0016 - Staff Toilet

No Asbestos

B00A - R0017 - Security Store

No Asbestos

B00A - R0018 - Staff Room

No Asbestos

B00A - R0019 - Staff Kitchen

No Asbestos

B00A - R0020 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00A/R0020/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Staff Facilities - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00B/R0001/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00B - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/R0002/Wall Linings Internal/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/R0002/Ceiling Structures/Linings/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Staff Room

Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/R0002/Wall Linings Internal/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/R0002/Ceiling Structures/Linings/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00B/R0001/Floor Coverings Res/Textile/S12					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1913 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2370/B00C/Eaves Linings/S19					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00C - R0002 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 2370/B00C/R0002/Wall Linings Internal/S5					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0002/Ceiling Structures/Linings/S6	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0002/Ceiling Structures/Linings/S6	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00C - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0002/Ceiling Structures/Linings/S6	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	-----	--------------	--------------------	---------	---

B00C - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0002/Ceiling Structures/Linings/S6	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	--------------	--------------------	---------	---

B00C - R0006 - P.E. Store

No Asbestos

B00C - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0002/Ceiling Structures/Linings/S6	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	--------------	--------------------	---------	---

B00C - R0008 - Disabled Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0009/Ceiling Structures/Linings/S3					No Asbestos Detected
Door In-Fill Panel	Flat AC Sheeting 2370/B00C/R0009/Door In-Fill Panel/S4					No Asbestos Detected

B00C - R0009 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2370/B00C/R0009/Ceiling Structures/Linings/S3					No Asbestos Detected
Door lining	Flat AC Sheeting 2370/B00C/R0009/Door In-Fill Panel/S4					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1952 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00B/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	AC Fragments/Debris	1m2	East	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2370/B00E/Ceiling Void/S23				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Void	No Asbestos Found					

Interior

B00E - R0001 - Home Base Store

No Asbestos

B00E - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2370/B00E/R0004/Wall Linings Internal/S14					
Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00E/R0004/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00E - R0003 - Practical Activities - 1hb

No Asbestos

B00E - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2370/B00E/R0004/Wall Linings Internal/S14					
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00E/R0004/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00E - R0006 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2370/B00E/R0006/Ceiling Structures/Linings/S26					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/Eaves Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Power Board	Resinous Board	1Unit	South facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/Power Board/S28				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00G - R0001 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00G/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0002 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00G/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0003 - Kitchen - Pre

Floor Coverings Res/Textile	Vinyl Tiles					
	2370/B00G/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00G/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0004 - K.L.A. Store

No Asbestos

B00G - R0005 - Special Programs Room

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - K.L.A. Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2370/B00G/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2370/B00G/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R0008 - Distribution Board Cupboard				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2370/B00G/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R0009 - Communications Room						
No Asbestos						
B00G - R0010 - Communications Room						
No Asbestos						
B00G - R0011 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2370/B00G/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00H - R0001 - External Movement

No Asbestos

B00H - R0002 - Reading Area

No Asbestos

B00H - R0003 - Practical Activities

No Asbestos

B00H - R0004 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Residence Garage

Exterior

Ceiling Void	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2370/B00I/Eaves Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00I - R0001 - Garage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017