


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : La Perouse Public School (2373)
Region : Sydney
State Electorate : Maroubra
Local Government Area : Randwick

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

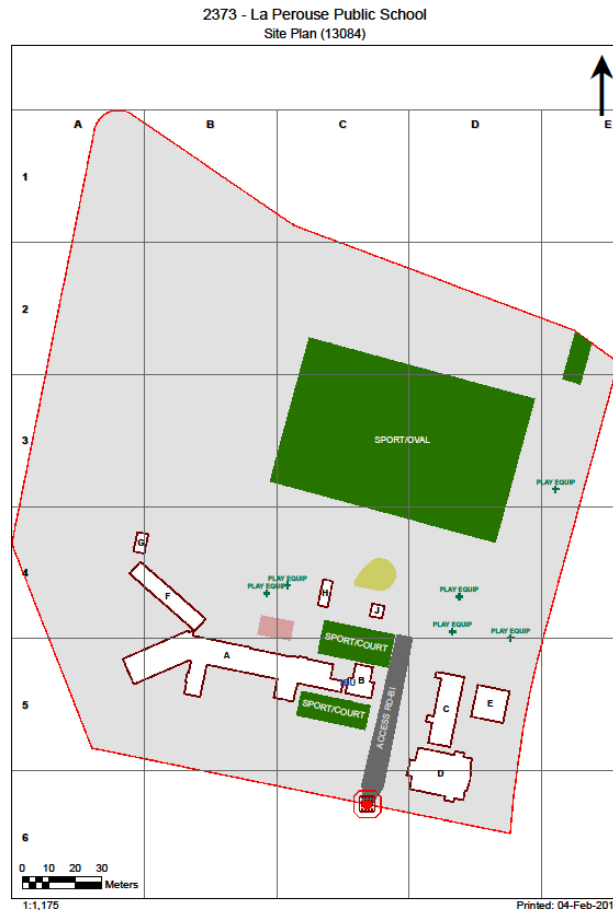

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1952 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2373/B00A/Ceiling Void/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	50m	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2373/B00F/Gable Verge Lining/S33			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00A - R0001 - Outdoor Learning Area**

No Asbestos

B00A - R0002 - Disabled Toilet

Wall Linings Internal	Vinyl Sheet					No Asbestos Detected
	2373/B00A/R0002/Wall Linings Internal/S32					

B00A - R0003 - Practical Activities - 1hb

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - External Movement

No Asbestos

B00A - R0007 - Clerical Office

No Asbestos

B00A - R0008 - Principal

No Asbestos

B00A - R0009 - Staff Toilet

No Asbestos

B00A - R0010 - Security Store

No Asbestos

B00A - R0011 - Other-Community Use

No Asbestos

B00A - R0012 - Home Base

No Asbestos

B00A - R0013 - Home Base

No Asbestos

B00A - R0014 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	46m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00C/R0004/Floor Coverings Res/Textile/S12			Chrysotile (white asbestos)		

B00A - R0015 - Outdoor Learning Area

No Asbestos

B00A - R0016 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0017 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00H/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
2373/B00H/R0001/Partition Walls (Cubicles)/S6						
B00A - R0018 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00H/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
2373/B00H/R0001/Partition Walls (Cubicles)/S6						
B00A - R0019 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00A/R0019/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)		
B00A - R0020 - Cleaning Distributed Store						
No Asbestos						
B00A - R0021 - External Movement						
No Asbestos						
B00A - R0022 - External Movement						
No Asbestos						
B00A - R0023 - External Movement						
No Asbestos						
B00A - R0024 - P.E. Store						
No Asbestos						
B00A - R0025 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00A/R0025/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)		
B00A - R0026 - Home Base						
No Asbestos						
B00A - R0027 - Practical Activities - 1hb						
No Asbestos						
B00A - R0028 - Home Base Store						
No Asbestos						
B00A - R0029 - Home Base Store						
No Asbestos						
B00A - R0030 - Home Base						
No Asbestos						
B00A - R0031 - Practical Activities - 1hb						
No Asbestos						
B00A - R0032 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0033 - Movement						
No Asbestos						
B00A - R0034 - External Movement						
No Asbestos						
B00A - R0035 - External Movement						
No Asbestos						
B00A - R0036 - Stairs						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0037 - Stairs						
No Asbestos						
B00A - R1001 - Practical Activities - 1hb						
No Asbestos						
B00A - R1002 - Home Base						
No Asbestos						
B00A - R1003 - Movement						
No Asbestos						
B00A - R1004 - General Storeroom						
No Asbestos						
B00A - R1005 - Craft Store						
No Asbestos						
B00A - R1006 - Interview						
No Asbestos						
B00A - R1007 - Staff Toilet						
No Asbestos						
B00A - R1008 - Security Store						
Manhole in Ceiling		Flat AC Sheeting				
		2373/B00A/R1008/Manhole in Ceiling/S30				No Asbestos Detected
B00A - R1009 - Reading Area						
No Asbestos						
B00A - R1010 - Library Office/Workroom						
No Asbestos						
B00A - R1011 - Home Base						
No Asbestos						
B00A - R1012 - General Storeroom						
No Asbestos						
B00A - R1013 - Movement						
No Asbestos						
B00A - R1014 - General Storeroom						
No Asbestos						
B00A - R1015 - Home Base						
No Asbestos						
B00A - R1016 - Practical Activities - 1hb						
No Asbestos						
B00A - R1017 - Music Store						
No Asbestos						
B00A - R1018 - Cleaning Distributed Store						
No Asbestos						
B00A - R1019 - Personal Effects Storage						
No Asbestos						
B00A - R1020 - Home Base Store						
No Asbestos						
B00A - R1021 - Home Base						
No Asbestos						
B00A - R1022 - Practical Activities - 1hb						
No Asbestos						
B00A - R1023 - Stairs						
No Asbestos						
B00A - R1024 - Stairs						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1952 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2373/B00B/Eaves Linings/S22					No Asbestos Detected
Ceiling Void	No Asbestos Found					

Interior**B00B - R0001 - External Movement**

Wall Linings Internal	Flat AC Sheeting 2373/B00B/R0004/Wall Linings Internal/S18					No Asbestos Detected
-----------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

B00B - R0002 - Canteen

No Asbestos

B00B - R0003 - Canteen Office/Store

No Asbestos

B00B - R0004 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 2373/B00B/R0004/Wall Linings Internal/S18					No Asbestos Detected
-----------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1956 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 2373/B00C/Eaves Linings/S23	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Linings	Flat AC Sheeting 2373/B00H/GABLE VERGE LINING/S4	15m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Underfloor Voids	Flat AC Sheeting 2373/B00C/Underfloor Voids/S26	10m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
					Chrysotile (white asbestos)	
Underfloor Voids	Compressed AC Sheet 2373/B00C/Underfloor Voids/S27				No Asbestos Detected	
Ceiling Void	No Asbestos Found					

Interior**B00C - R0001 - Home Base Store**

No Asbestos

B00C - R0002 - Home Base

Panel behind heater	Flat AC Sheeting 2373/B00C/R0002/backing board to heater/S14	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0003 - Personal Effects Storage

No Asbestos

B00C - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 2373/B00C/R0004/Floor Coverings Res/Textile/S12	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00C - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2373/B00C/R0005/Ceiling Structures/Linings/S8				No Asbestos Detected	
In-fill panel above door	Flat AC Sheeting 2373/B00C/R0005/infill above door/S9	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0006 - Home Base Store

No Asbestos

B00C - R0007 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles 2373/B00C/R0008/Floor Coverings Res/Textile/S13				No Asbestos Detected	
-----------------------------	----------------------------------------------------------------	--	--	--	-----------------------------	--

B00C - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 2373/B00C/R0008/Floor Coverings Res/Textile/S13				No Asbestos Detected	
-----------------------------	----------------------------------------------------------------	--	--	--	-----------------------------	--

B00C - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2373/B00C/R0005/Ceiling Structures/Linings/S8				No Asbestos Detected	
In-fill panel above door	Flat AC Sheeting 2373/B00C/R0005/infill above door/S9	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0010 - Practical Activities - 1hb

No Asbestos

B00C - R0011 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill Panel behind Heater	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00C/R0011/Infill Panel behind Heater/S31				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R9001 - General Storeroom

No Asbestos

B00C - R9002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting					
2373/B00C/R9002/Ceiling Structures/Linings/S17				No Asbestos Detected		

B00C - R9003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Toilets - Girls

No Asbestos

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Shower/Change

No Asbestos

B00D - R0005 - Raised Platform

No Asbestos

B00D - R0006 - Shower/Change

No Asbestos

B00D - R0007 - Toilets - Boys

No Asbestos

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - Communal Space

No Asbestos

B00D - R0010 - External Movement

No Asbestos

B00D - R0011 - External Movement

No Asbestos

B00D - R9001 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2373/B00D/R9001/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces, Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2373/B00D/R9001/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)	

B00D - R9002 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-Community Use - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	Non Accessible Area - No key to building on site

Interior

B00E - R0001 - Other-Community Use

No Asbestos

B00E - R0002 - Other-Community Use

No Asbestos

B00E - R0003 - Other-Community Use

No Asbestos

B00E - R0004 - Other-Community Use

No Asbestos

B00E - R0005 - Other-Community Use

No Asbestos

B00E - R0006 - Other-Community Use

Linings to Incinerette	Encapsulated Insulation material within unit	1Unit(s)	West facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
------------------------	----------------------------------------------	----------	-------------	----------------------	---------	--------------------

Assumed Asbestos - No key to building at school

B00E - R0007 - Other-Community Use

No Asbestos

B00E - R0008 - Other-Community Use

No Asbestos

B00E - R0009 - Other-Community Use

No Asbestos

B00E - R0010 - Other-Community Use

No Asbestos

B00E - R0011 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Building Services/Other-Community Use - 1952 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/Eaves Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Linings	Flat AC Sheeting	15m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/GABLE VERGE LINING/S4			Chrysotile (white asbestos)		
Wall Cladding	Flat AC Sheeting 2373/B00F/R0002/Wall Linings Internal/S19					
	No Asbestos Detected					
Gable Verge Lining	Flat AC Sheeting	15m	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2373/B00F/Gable Verge Lining/S33			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00F - R0001 - Other-Community Use**

No Asbestos

B00F - R0002 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 2373/B00F/R0002/Wall Linings Internal/S19					
	No Asbestos Detected					
Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0006/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0003/Ceiling Structures/Linings/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

B00F - R0004 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 2373/B00F/R0002/Wall Linings Internal/S19					
	No Asbestos Detected					
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0006/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0003/Ceiling Structures/Linings/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0006 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0006/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0007 - Other-Community Use

Non Accessible

B00F - R0008 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00F/R0003/Ceiling Structures/Linings/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R0009 - Other-Community Use

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00F/R0003/Ceiling Structures/Linings/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/Eaves Linings/S3				Chrysotile (white asbestos)	
Gable Verge Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/GABLE VERGE LINING/S4				Chrysotile (white asbestos)	
Ceiling Void	AC Fragments/Debris	3m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2373/B00G/Ceiling Void/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B00G - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2373/B00H/R0001/Partition Walls (Cubicles)/S6					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/Eaves Linings/S3				Chrysotile (white asbestos)	
Gable Verge Linings	Flat AC Sheeting	5m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/GABLE VERGE LINING/S4				Chrysotile (white asbestos)	
Ceiling Void	AC Fragments/Debris	2m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2373/B00H/Ceiling Void/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B00H - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2373/B00H/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2373/B00H/R0001/Partition Walls (Cubicles)/S6					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2373/B00J/Eaves Linings/S1					Chrysotile (white asbestos)	

Interior

B00J - R0001 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2373/B00J/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00J - R0002 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2373/B00J/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017