


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Laurieton Public School (2377)
Region : North Coast
State Electorate : Port Macquarie
Local Government Area : Port Macquarie-Hastings

Initial Survey : Noel Arnold & Associates : 14 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 31 - Oct - 2016

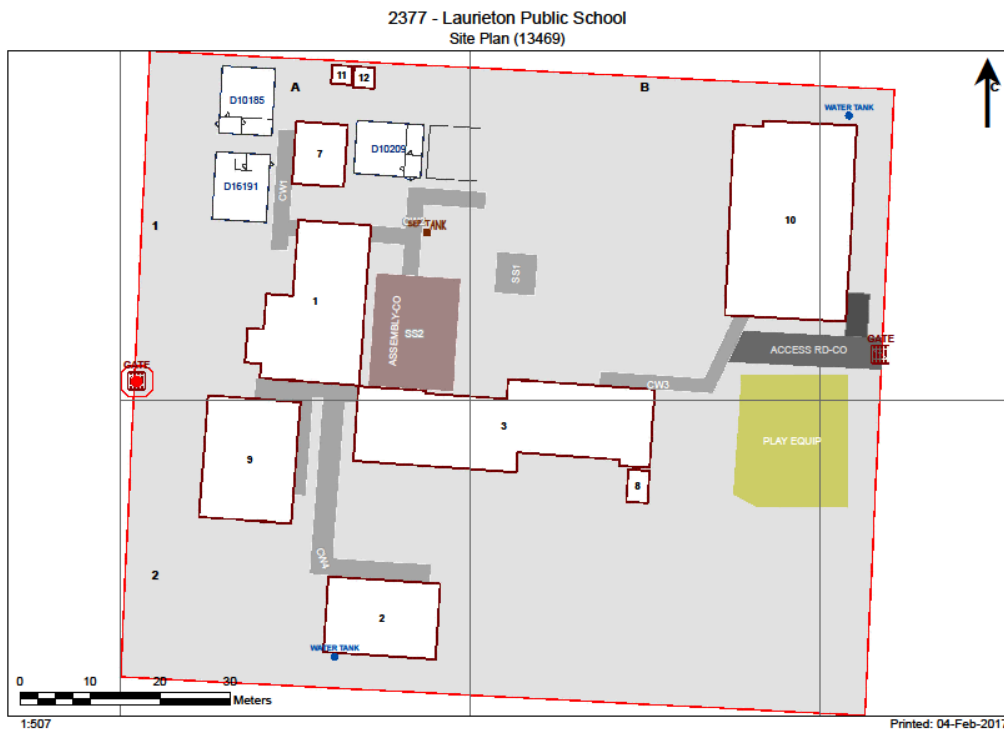

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Administration - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B001/R0011/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	2377/B003/Wall Cladding/S1					
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	2377/B001/Gable Verge Lining/S8					
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B001 - R0001 - Cleaning Supplies

Ceiling Hatch	AC Fragments/Debris					No Asbestos Detected
	2377/B001/R0001/Ceiling Hatch/S12					

B001 - R0002 - Staff Toilet

No Asbestos

B001 - R0003 - Staff Toilet

No Asbestos

B001 - R0004 - Entry Vestibule

No Asbestos

B001 - R0006 - General Storeroom

No Asbestos

B001 - R0007 - Cleaning Supplies

No Asbestos

B001 - R0008 - Sick Bay

No Asbestos

B001 - R0009 - Clerical Office

No Asbestos

B001 - R0010 - General Storeroom

No Asbestos

B001 - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B001/R0011/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B001/R0011/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0012 - Home Base

No Asbestos

B001 - R0013 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	2377/B003/R0008/Floor Coverings Res/Textile/S4					

B001 - R0014 - Personal Effects Storage

No Asbestos

B001 - R0015 - Movement

No Asbestos

B001 - R0016 - Movement

No Asbestos

B001 - R0017 - External Movement

No Asbestos

B001 - R0018 - Sick Bay

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B001 - R0019 - Security Store

No Asbestos

B001 - R0020 - Security Store

No Asbestos

B001 - R0021 - Clerical Office

No Asbestos

B001 - R0022 - Entry Vestibule

No Asbestos

B001 - R0023 - Interview

No Asbestos

B001 - R0024 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B002 - R0001 - External Movement

No Asbestos

B002 - R0002 - Reading Area

No Asbestos

B002 - R0003 - Library Office/Workroom

No Asbestos

B002 - R0004 - Communications Room

No Asbestos

B002 - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 2377/B003/Wall Cladding/S1					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 2377/B003/Gable Verge Lining/S9	20m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Void	AC Fragments/Debris 2377/B003/Ceiling Void/S11	1m2	North	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Void	No Asbestos Found					

Interior

B003 - R0001 - Home Base Store

No Asbestos

B003 - R0002 - Personal Effects Storage

No Asbestos

B003 - R0003 - Home Base

No Asbestos

B003 - R0004 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Sheet 2377/B003/R0004/Floor Coverings Res/Textile/S5	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) <i>Asbestos removed, remediation work completed - 19/01/2015</i>
-----------------------------	---	-----	--------------	--------------------	---------	--

B003 - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet 2377/B003/R0004/Floor Coverings Res/Textile/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) <i>Asbestos removed, remediation work completed - 19/01/2015</i>
-----------------------------	---	-----	--------------	--------------------	---------	--

Ceiling Hatch	Flat AC Sheeting 2377/B003/R0004/Ceiling Hatch/S13					No Asbestos Detected
---------------	---	--	--	--	--	-----------------------------

B003 - R0006 - Toilets - Boys/Girls

No Asbestos

B003 - R0007 - Home Base

No Asbestos

B003 - R0008 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Sheet 2377/B003/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B003 - R0009 - Toilets - Girls

Partition Walls (Cubicles)	Flat AC Sheeting 2377/B003/R0009/Partition Walls (Cubicles)/S14	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

Ceiling Structures/Linings	Flat AC Sheeting 2377/B003/R0011/Ceiling Structures/Linings/S3	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------	--------------------	---------	--

B003 - R0011 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting 2377/B003/R0011/Ceiling Structures/Linings/S3	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------	--------------------	---------	--

B003 - R0015 - Staff Toilet

No Asbestos

B003 - R0016 - P.E. Store

No Asbestos

B003 - R0017 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2377/B003/R0017/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2377/B001/R0011/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B003 - R0018 - Toilets - Boys						
Partition Walls (Cubicles)	Flat AC Sheeting	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2377/B003/R0009/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2377/B003/R0011/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B003 - R0019 - Toilets-Unisex						
No Asbestos						
B003 - R0020 - Canteen						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Special Purpose - 1946 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B007/Eaves Linings/S7					Chrysotile (white asbestos)
Ceiling Void	AC Fragments/Debris	1m2	West	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2377/B007/Ceiling Void/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Void	No Asbestos Found					

Interior

B007 - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B007/Eaves Linings/S7					Chrysotile (white asbestos)

B007 - R0002 - Withdrawal Space - 1hb

No Asbestos

B007 - R0003 - Kiln Room

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2377/B007/Eaves Linings/S7					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Administration - 1999 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B008 - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B009 - R0001 - External Movement

No Asbestos

B009 - R0002 - Practical Activities - 1hb

No Asbestos

B009 - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B009 - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Communal Facilities/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B010 - R0001 - Communal Space

No Asbestos

B010 - R0002 - Raised Platform

No Asbestos

B010 - R0003 - Hall Chair Store

No Asbestos

B010 - R0004 - Communal/Performance Store

No Asbestos

B010 - R0005 - P.E. Store

No Asbestos

B010 - R0006 - Toilet - Lobby

No Asbestos

B010 - R0007 - Toilets - Girls

No Asbestos

B010 - R0008 - Sound Cupboard

No Asbestos

B010 - R0009 - Toilet - Lobby

No Asbestos

B010 - R0010 - Toilets - Boys

No Asbestos

B010 - R0011 - Cleaning Distributed Store

No Asbestos

B010 - R0012 - Plant

No Asbestos

B010 - R0013 - Main Switch Board

No Asbestos

B010 - R0014 - Access Shower/Toilet

No Asbestos

B010 - R0015 - Covered Outdoor Learning Area

No Asbestos

B010 - R0016 - Movement

No Asbestos

B010 - R0017 - Movement

No Asbestos

B010 - R0018 - Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B011 - Administration - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B011 - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B012 - Administration - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B012 - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10185 - Learning Unit - Standard/Withdrawal : Placement Date - 9/04/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D10209 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D16191 - Learning Unit - Standard With P.A.A. : Placement Date - 3/08/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017