


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lavington Public School (2378)
Region : Riverina
State Electorate : Albury
Local Government Area : Albury

Initial Survey : Noel Arnold & Associates : 23 - Feb - 2008
Reviewed By : AECOM : 10 - Oct - 2014

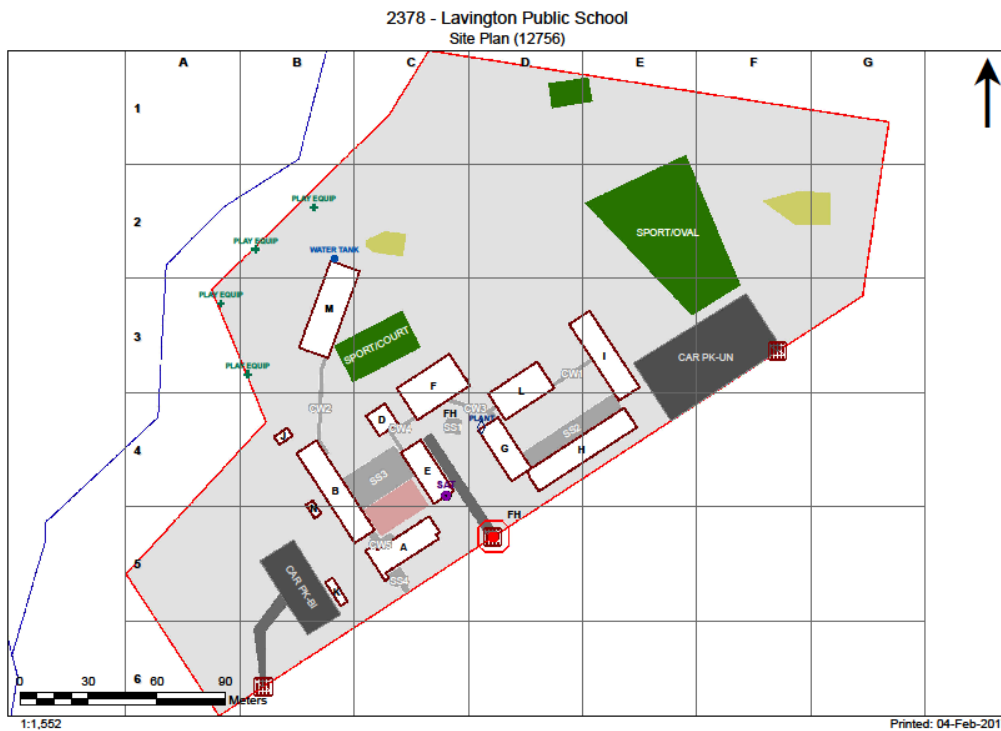

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1968 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting 2378/B00A/Gable verge lining/S20					No Asbestos Detected
Infill panel below window	Flat AC Sheeting 2378/B001/Infill panel below window/S4	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel above window	Flat AC Sheeting 2378/B001/Infill panel below window/S4	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 2378/B001/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Roof	Fibre Cement Pipe	2m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction - rooftop 3-5m.
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 2378/B00A/Underfloor Voids/S9	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00A - R0002 - Staff Toilet**

No Asbestos

B00A - R0003 - Staff Toilet

No Asbestos

B00A - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - Sick Bay

Panel behind ceramic tiles Flat AC Sheeting

2378/B00A/R0006/Panel behind ceramic tiles/S5

No Asbestos Detected**B00A - R0007 - Staff Room Annexe**

No Asbestos

B00A - R0008 - Cleaning Supplies

No Asbestos

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - Staff Room

No Asbestos

B00A - R0011 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2378/B00B/R0002/Ceiling Structures/Linings/S2					

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	1Unit	Cover to ceiling access hatch	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2378/B00A/R0013/Ceiling Structures/Linings/S8					

B00A - R0014 - Duplicating Workroom

No Asbestos

B00A - R0015 - Clerical Office

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - Entry Vestibule						
No Asbestos						
B00A - R0017 - External Movement						
No Asbestos						
B00A - R0018 - Ramp						
Ceiling Structures/Linings	Flat AC Sheeting 2378/B00A/R0018/Ceiling Structures/Linings/S24					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2378/B00A/R0018/Wall Linings Internal/S25					No Asbestos Detected
Infill Panels (under windows)	Flat AC Sheeting 2378/B00A/R0018/Infill Panels (under windows)/S26	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0019 - External Movement						
Infill Panels (above windows)	Flat AC Sheeting 2378/B00A/R0019/Infill Panels (above windows)/S27					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2378/B00A/R0018/Ceiling Structures/Linings/S24					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 2378/B00A/R0018/Wall Linings Internal/S25					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1957 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2378/B001/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Infill panel above window	Flat AC Sheeting 2378/B001/Infill panel below window/S4	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Infill panel below window	Flat AC Sheeting 2378/B001/Infill panel below window/S4	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Roof	Fibre Cement Pipe	4m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction - rooftop 3-5m.						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - General Storeroom

No Asbestos

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00B - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 2378/B00B/R0004/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0004/Ceiling Structures/Linings/S21	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00B - R0005 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00B - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Partition Walls (Cubicles)	Compressed AC Sheet 2378/B00B/R0004/Partition Walls (Cubicles)/S1					No Asbestos Detected

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Kiln Room

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00B - R0010 - Sports Store

No Asbestos

B00B - R0011 - Practical Activities - 1hb

No Asbestos

B00B - R0012 - Practical Activities - 1hb

No Asbestos

B00B - R0013 - Special Programs Room

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1965 - Brick/Veneer (Brick/Veneer)

Exterior

Gable verge lining	Flat AC Sheeting	24m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/Gable verge lining/S22				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting				No Asbestos Detected	
	2378/B00I/R0002/Ceiling Structures/Linings/S3					
Infill panel below window	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00I/Infill panel below window/S4				Chrysotile (white asbestos)	
Infill panel above window	Flat AC Sheeting	2m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00I/Infill panel below window/S4				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 40 cm.					
Ceiling Voids	Flat AC Sheeting	1m2	Collar of manhole above ceiling access hatch	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00D/Ceiling Voids/S10				Chrysotile (white asbestos)	

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	2378/B00I/R0002/Ceiling Structures/Linings/S3					

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1964 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting	34m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/Gable verge lining/S22				Chrysotile (white asbestos)	
Infill panel above window	Flat AC Sheeting	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00I/Infill panel below window/S4				Chrysotile (white asbestos)	
Infill panel below window	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00I/Infill panel below window/S4				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting					No Asbestos Detected
	2378/B00I/R0002/Ceiling Structures/Linings/S3					
Roof	Fibre Cement Pipe	4m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction - rooftop 3-5m.					
Underfloor Voids	Non Accessible Area - Area inaccessible - padlock opened but could not be removed. Clearance approximately 30-40 cm.					
Ceiling Voids	Flat AC Sheeting	1m2	Collar of manhole above ceiling access hatch	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/Ceiling Voids/S11				Chrysotile (white asbestos)	

Interior**B00E - R0001 - Home Base Store**

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Home Base

No Asbestos

B00E - R0004 - Home Base Store

No Asbestos

B00E - R0005 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	1Unit	Cover to ceiling access hatch	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/R0005/Ceiling Structures/Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0007 - General Storeroom

No Asbestos

B00E - R0008 - General Storeroom

No Asbestos

B00E - R0009 - Withdrawal Space - 1hb

No Asbestos

B00E - R0010 - Personal Effects Storage

No Asbestos

B00E - R0011 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting	16.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/R0011/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

B00E - R0012 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	5.3Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/R0011/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

B00E - R0013 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	47.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00E/R0013/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)	
Window putty	Mastic					
	2378/B00E/R0013/Window putty/S15				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1962 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - R0001 - Cleaning Supplies**

No Asbestos

B00F - R0002 - Plant

No Asbestos

B00F - R0003 - Shower/Change

No Asbestos

B00F - R0004 - Toilets - Girls

No Asbestos

B00F - R0005 - Hall Chair Store

No Asbestos

B00F - R0006 - Movement

No Asbestos

B00F - R0007 - Communal Space

No Asbestos

B00F - R0008 - Canteen

No Asbestos

B00F - R0009 - Canteen Office/Store

No Asbestos

B00F - R0010 - P.E. Store

No Asbestos

B00F - R0011 - P.E. Store

No Asbestos

B00F - R0012 - Movement

No Asbestos

B00F - R0013 - Toilets - Boys

No Asbestos

B00F - R0014 - Hall Chair Store

No Asbestos

B00F - R0015 - Raised Platform

No Asbestos

B00F - R0016 - Movement

No Asbestos

B00F - R0017 - Shower/Change

No Asbestos

B00F - R0018 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0019 - Movement

No Asbestos

B00F - R0020 - Movement

No Asbestos

B00F - R0021 - Disabled Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Gable verge lining	Flat AC Sheeting 2378/B00E/Gable verge lining/S22	36m	North facing, south facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Infill panel above window	Flat AC Sheeting 2378/B00I/Infill panel below window/S4	25m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 2378/B00I/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Infill panel below window	Flat AC Sheeting 2378/B00I/Infill panel below window/S4	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Roof	Fibre Cement Pipe	2m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Height Restriction - rooftop 3-5 m.
Ceiling Voids	Flat AC Sheeting 2378/B00E/Ceiling Voids/S11	1Unit	Collar of manhole above ceiling access hatch in GR0008.	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 50 cm. No asbestos identified in vicinity of access hatch.					

Interior**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00G - R0002 - Toilets - Boys/Girls

No Asbestos

B00G - R0003 - Toilets - Boys/Girls

No Asbestos

B00G - R0004 - Withdrawal Space - 1hb

No Asbestos

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Home Base Store

No Asbestos

B00G - R0007 - Home Base Store

No Asbestos

B00G - R0008 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00A/R0013/Ceiling Structures/Linings/S8	1Unit	Cover to ceiling access hatch	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00G - R0009 - Home Base

No Asbestos

B00G - R0010 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00G/R0011/Ceiling Structures/Linings/S23					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00G - R0011 - Staff Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00G/R0011/Ceiling Structures/Linings/S23					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00G - R0012 - Cleaning Supplies

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting		2378/B00G/R0011/Ceiling Structures/Linings/S23			No Asbestos Detected
B00G - R0013 - Garden Store						
Ceiling Structures/Linings	Flat AC Sheeting		2378/B00G/R0011/Ceiling Structures/Linings/S23			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1968 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2378/B001/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Roof	Fibre Cement Pipe	5m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction - rooftop 3-5 m.						
Underfloor Voids	Non Accessible Area - Area inaccessible - clearance approximately 30-40 cm. No asbestos identified in vicinity of access hatch.					
Ceiling Voids	Non Accessible Area - Height Restriction - height (4 m) and position of manhole in HR0011. Limited access gained via HR0005 however no asbestos identified.					

Interior

B00H - R0001 - Home Base

No Asbestos

B00H - R0002 - General Storeroom

No Asbestos

B00H - R0003 - General Storeroom

No Asbestos

B00H - R0004 - Withdrawal Space - 1hb

No Asbestos

B00H - R0005 - Cleaning Supplies

No Asbestos

B00H - R0006 - Home Base

No Asbestos

B00H - R0007 - Home Base

No Asbestos

B00H - R0008 - General Storeroom

No Asbestos

B00H - R0009 - Movement

No Asbestos

B00H - R0010 - Interview

No Asbestos

B00H - R0011 - Home Base

No Asbestos

B00H - R0012 - Home Base

No Asbestos

B00H - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	105m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Infill panel below window	Flat AC Sheeting 2378/B00I/Infill panel below window/S4	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Infill panel above window	Flat AC Sheeting 2378/B00I/Infill panel below window/S4	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 2378/B00I/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 2378/B00E/Gable verge lining/S22	20m	North facing, south facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting 2378/B00I/R0011/Ceiling Structures/Linings/S16	1Unit	Collar of manhole in ceiling above IR0011.	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	Treads 2378/B00I/Underfloor Voids/S19					No Asbestos Detected

Interior**B00I - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00I/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00I - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00I/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00I - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00I/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00I - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00B/R0002/Ceiling Structures/Linings/S2	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------	--------------------	---------	--

B00I - R0006 - Home Base

No Asbestos

B00I - R0007 - Home Base

No Asbestos

B00I - R0008 - Toilets - Boys/Girls

No Asbestos

B00I - R0009 - Practical Activities - 1hb

No Asbestos

B00I - R0010 - Practical Activities - 1hb

No Asbestos

B00I - R0011 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00I/R0011/Ceiling Structures/Linings/S16	56.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	---------	------------	--------------------	---------	--

Wall Linings Internal	Flat AC Sheeting 2378/B00I/R0013/Wall Linings Internal/S18					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00I - R0012 - Craft Store

Ceiling Structures/Linings	Flat AC Sheeting 2378/B00I/R0013/Ceiling Structures/Linings/S17	8.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	--------	------------	--------------------	---------	--

Wall Linings Internal	Flat AC Sheeting 2378/B00I/R0013/Wall Linings Internal/S18					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R0013 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	8.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B001/R0013/Ceiling Structures/Linings/S17				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
	2378/B001/R0013/Wall Linings Internal/S18				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1989 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 1900 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting	50m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00K/Wall Cladding/S7					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Building not identified on site plan or during inspection. Building presumed removed/demolished and therefore archived.					
Underfloor Voids	Non Accessible Area - Building not identified on site plan or during inspection. Building presumed removed/demolished and therefore archived.					

Interior

B00K - R0001 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2378/B00K/R0001/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00K - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00L - R0002 - Cleaning Distributed Store

No Asbestos

B00L - R0003 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0004 - K.L.A. Store

No Asbestos

B00L - R0005 - Communications Room

No Asbestos

B00L - R0006 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00L - R0007 - Movement

No Asbestos

B00L - R0008 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids Non Accessible Area
 - Area inaccessible - fixed ceilings. Based on apparent age of building it is unlikely that asbestos is present.

Interior

B00M - R0001 - Home Base

No Asbestos

B00M - R0002 - Home Base Store

No Asbestos

B00M - R0003 - Practical Activities

No Asbestos

B00M - R0004 - Withdrawal Space - 2hb

No Asbestos

B00M - R0005 - Home Base

No Asbestos

B00M - R0006 - Practical Activities

No Asbestos

B00M - R0007 - Home Base Store

No Asbestos

B00M - R0008 - Practical Activities

No Asbestos

B00M - R0009 - Home Base Store

No Asbestos

B00M - R0010 - Home Base

No Asbestos

B00M - R0011 - Withdrawal Space - 2hb

No Asbestos

B00M - R0012 - Practical Activities

No Asbestos

B00M - R0013 - Home Base

No Asbestos

B00M - R0014 - Home Base Store

No Asbestos

B00M - R0015 - Security Store

No Asbestos

B00M - R0016 - Security Store

No Asbestos

B00M - R0017 - General Storeroom

No Asbestos

B00M - R0018 - External Movement

No Asbestos

B00M - R0019 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids No Asbestos Found

Interior

B00N - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017