


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Lawson Public School (2381)  
**Region :** Western Sydney  
**State Electorate :** Blue Mountains  
**Local Government Area :** Blue Mountains

**Initial Survey :** Noel Arnold & Associates : 23 - May - 2008  
**Register Issue Date :** 22 - Mar - 2017

2381 - Lawson Public School  
Site Plan (12759)

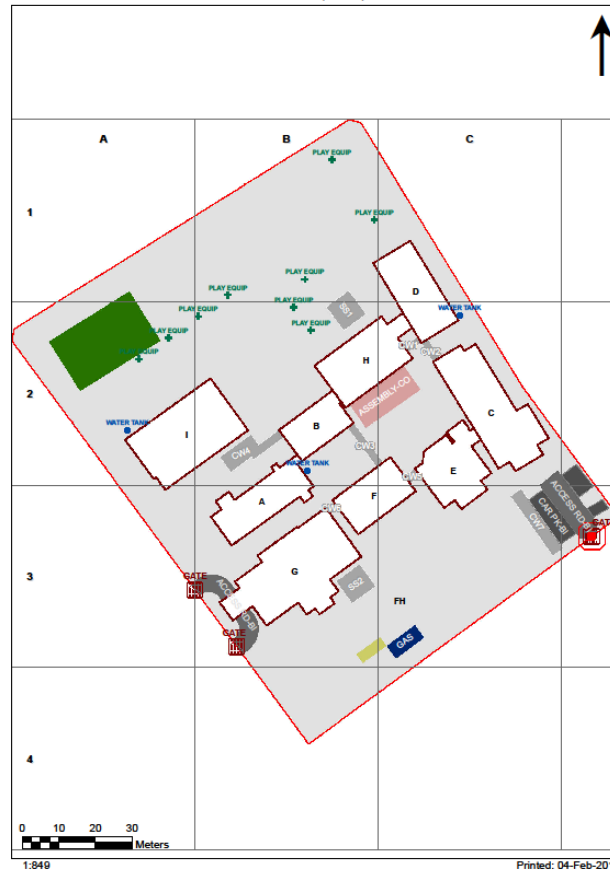

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Staff Facilities - 1918 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

**Interior****B00A - R0001 - Movement**

No Asbestos

**B00A - R0002 - Craft Store**

No Asbestos

**B00A - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00A - R0004 - Home Base**

No Asbestos

**B00A - R0005 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0005/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

**B00A - R0006 - Home Base**

No Asbestos

**B00A - R0007 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0007/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

**B00A - R0008 - Staff Room Annexe**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0007/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

**B00A - R0009 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00A - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00A - R0011 - Garden Store**

No Asbestos

**B00A - R0012 - Stairs**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2381/B00A/R0009/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Tiered Learning/Pupil Facilities - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Toilets - Girls**

No Asbestos

**B00B - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0004 - Special Programs Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0005 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0006 - Toilets - Boys**

No Asbestos

**B00B - R0007 - Kiln Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/General Learning - 1991 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00C - R0001 - Movement**

No Asbestos

**B00C - R0002 - Staff Room**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0003 - Staff Toilet**

No Asbestos

**B00C - R0004 - Staff Toilet**

No Asbestos

**B00C - R0005 - Staff Toilet**

No Asbestos

**B00C - R0006 - Cleaning Distributed Store**

No Asbestos

**B00C - R0007 - Security Store**

No Asbestos

**B00C - R0008 - Interview**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0009 - Entry Vestibule**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0010 - Sick Bay**

No Asbestos

**B00C - R0011 - Staff Shower/Change**

No Asbestos

**B00C - R0012 - Duplicating Workroom**

No Asbestos

**B00C - R0013 - Principal**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0014 - Clerical Office**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0015 - Movement**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0016 - Movement**

No Asbestos

**B00C - R0017 - Distribution Board**

No Asbestos

Note: No inspection of live electrical installation.

**B00C - R0018 - Movement**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0019 - Staff Room Annexe**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00C - R0020 - Staff Room Annexe**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R0021 - Staff Room Annexe</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R0022 - Stairs</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1001 - Movement</b>						
No Asbestos						
<b>B00C - R1002 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00C - R1003 - Distribution Board</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00C - R1004 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00C - R1005 - Home Base</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1006 - Home Base Store</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1007 - Withdrawal Space - 1hb</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1008 - Home Base Store</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1009 - Home Base</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
<b>B00C - R1010 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00C - R1011 - Stairs</b>						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities/Administration - 1990 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0004 - Community Clinic**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0005 - General Assistant/Bulk Store**

No Asbestos

**B00D - R0006 - Cleaning Supplies**

No Asbestos

**B00D - R0007 - Cleaning Supplies**

No Asbestos

**B00D - R0008 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0009 - General Assistant/Bulk Store**

No Asbestos

**B00D - R0010 - Toilets - Boys**

No Asbestos

**B00D - R0011 - Disabled Toilet**

No Asbestos

**B00D - R0012 - Toilets - Girls**

No Asbestos

**B00D - R0013 - Canteen**

No Asbestos

**B00D - R0014 - Canteen Office/Store**

No Asbestos

**B00D - R0015 - Community Clinic**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00D - R0016 - Community Clinic**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1990 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior****B00E - R0002 - Practical Activities - 1hb**

No Asbestos

**B00E - R0003 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0004 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0005 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0006 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0007 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R0008 - Practical Activities - 1hb**

No Asbestos

**B00E - R0009 - Movement**

No Asbestos

**B00E - R0010 - Movement**

No Asbestos

**B00E - R0011 - Movement**

No Asbestos

**B00E - R0012 - Plant**

No Asbestos

**B00E - R0013 - Lift**

No Asbestos

**B00E - R1002 - Practical Activities - 1hb**

No Asbestos

**B00E - R1003 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R1004 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R1005 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R1006 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R1007 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00E - R1008 - Practical Activities - 1hb**

No Asbestos

**B00E - R1009 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00E - R1010 - Lift**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 1918 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00F - R0001 - Movement**

No Asbestos

**B00F - R0002 - Reading Area**

No Asbestos

**B00F - R0003 - K.L.A. Store**

No Asbestos

**B00F - R0004 - Library Office/Workroom**

No Asbestos

**B00F - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2381/B00F/R0005/Wall Linings Internal/S1					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00G - Support Unit - 1990 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior****B00G - R0001 - Movement**

No Asbestos

**B00G - R0002 - Withdrawal - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0003 - Home Base Store - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0004 - Home Base - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0005 - Practical Activities - S - 1hb**

No Asbestos

**B00G - R0006 - Home Base Store - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0007 - Staff Room Annexe**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0008 - Home Base - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0009 - Practical Activities - S - 1hb**

No Asbestos

**B00G - R0010 - Toilet - S**

No Asbestos

**B00G - R0011 - Laundry - S**

No Asbestos

**B00G - R0012 - Toilet - S**

No Asbestos

**B00G - R0013 - Main Switch Board**

No Asbestos

**B00G - R0014 - Staff Kitchen**

No Asbestos

**B00G - R0015 - Practical Activities - S - 1hb**

No Asbestos

**B00G - R0016 - Practical Activities - S - 1hb**

No Asbestos

**B00G - R0017 - Home Base - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0018 - Staff Room Annexe**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0019 - Home Base Store - S**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00G - R0020 - Cleaning Distributed Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00G - R0021 - Wheelchair Store**

No Asbestos

**B00G - R0022 - Covered Vehicle Area/Porte Cochere**

No Asbestos

**B00G - R0023 - Movement**

No Asbestos

**B00G - R0024 - Outdoor Learning Area**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Staff Facilities - 1966 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

**Interior**

**B00H - R0001 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00H - R0002 - Home Base Store**

No Asbestos

**B00H - R0003 - Personal Effects Storage**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00H - R0004 - Movement**

No Asbestos

**B00H - R0005 - Craft Store**

No Asbestos

**B00H - R0006 - Cleaning Distributed Store**

No Asbestos

**B00H - R0007 - Home Base Store**

No Asbestos

**B00H - R0008 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00H - R0009 - Movement**

Vinyl Tiles (Under Floor Covering/Carpet)      No Asbestos Found

**B00H - R0010 - Staff Toilet**

No Asbestos

**B00H - R0011 - Sports Store**

No Asbestos

**B00H - R0014 - Movement**

No Asbestos

**B00H - R0015 - Covered Outdoor Learning Area**

No Asbestos

**B00H - R0016 - Covered Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

### B00I - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

#### Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

#### Interior

##### B00I - R0001 - Communal Space

No Asbestos

##### B00I - R0002 - Raised Platform

No Asbestos

##### B00I - R0003 - Movement

No Asbestos

##### B00I - R0004 - Movement

No Asbestos

##### B00I - R0005 - Movement

No Asbestos

##### B00I - R0006 - Hall Chair Store

No Asbestos

##### B00I - R0007 - Communal/Performance Store

No Asbestos

##### B00I - R0008 - P.E. Store

No Asbestos

##### B00I - R0009 - Toilet - Lobby

No Asbestos

##### B00I - R0010 - Toilets - Girls

No Asbestos

##### B00I - R0011 - Sound Cupboard

No Asbestos

##### B00I - R0012 - Toilet - Lobby

No Asbestos

##### B00I - R0013 - Toilets - Boys

No Asbestos

##### B00I - R0014 - Cleaning Distributed Store

No Asbestos

##### B00I - R0015 - Disabled Shower/Toilet

No Asbestos

##### B00I - R0016 - Main Switch Board

No Asbestos

##### B00I - R0017 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017