


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Leeton Public School (2386)
Region : Riverina
State Electorate : Murray
Local Government Area : Leeton

Initial Survey : Noel Arnold & Associates : 09 - May - 2008
Reviewed By : Greencap-NAA : 18 - May - 2015

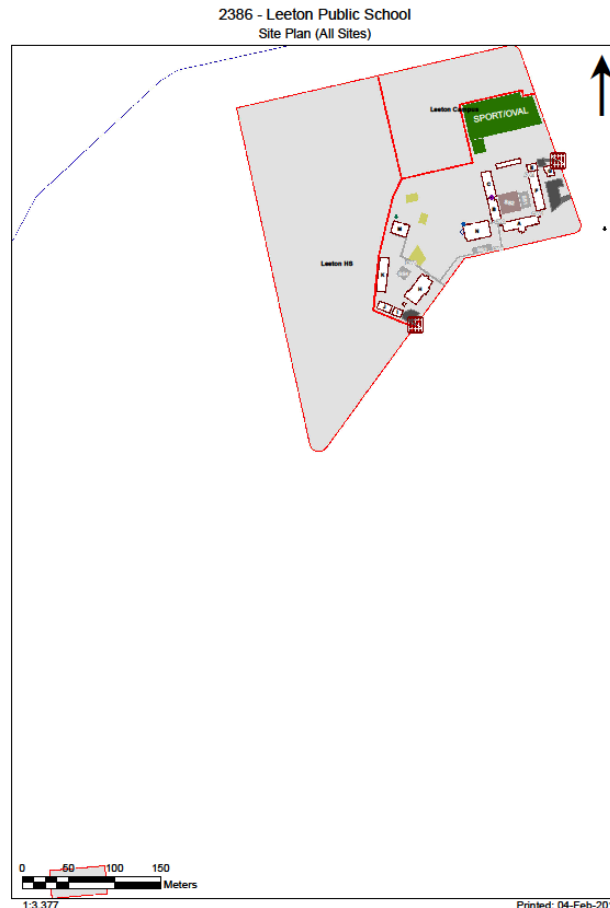

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - Administration/General Learning - 1955 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Area inaccessible. Associated with					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Interior						
B00A - R0001 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	102m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	3m2	West end	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Panels	Compressed AC Sheet					No Asbestos Detected
	2386/B00A/R0001/Floor Panels/S8					
Firebreak infill panels	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
infill panel to floor walkway bulkhead	Flat AC Sheeting					No Asbestos Detected
	2386/B00B/R0001/infill panels to floor walkway/S10					
B00A - R0002 - Deputy Principal						
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0003 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0005 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00A/R0016/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0008 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - Sick Bay						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 2386/B00A/R0013/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00A - R0014 - Staff Room						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00A/R0016/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0015 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0016 - Movement						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0017 - Movement						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0016/Floor Coverings Res/Textile/S1	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 2386/B00A/R0016/Floor Coverings Res/Textile/S1	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0018 - Staff Toilet						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0019 - Interview						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	above suspended ceiling tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0016/Floor Coverings Res/Textile/S1			Chrysotile (white asbestos)		
B00A - R0020 - Security Store						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	above suspended ceiling tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00A/R0023/Wall Linings Internal/S6					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0016/Floor Coverings Res/Textile/S1			Chrysotile (white asbestos)		
B00A - R0021 - Principal						
Wall Linings Internal	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0016/Floor Coverings Res/Textile/S1			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	21m2	above suspended ceiling tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0022 - Distribution Board						
	Note: No inspection of live electrical installation.					
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00A/R0023/Wall Linings Internal/S6					
B00A - R0023 - Movement						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00A/R0023/Wall Linings Internal/S6					
Wall Linings Internal	Flat AC Sheeting	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	37m2	above suspended ceiling tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0024 - Clerical Office/Workroom						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	above suspended ceiling tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1955 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Height Restriction. Associated with					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

Interior**B00B - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
infill panels to floor walkway	Flat AC Sheeting					No Asbestos Detected
	2386/B00B/R0001/infill panels to floor walkway/S10					
Floor Panels	Compressed AC Sheet					No Asbestos Detected
	2386/B00A/R0001/Floor Panels/S8					

B00B - R0002 - Sports Store

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0006 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0007 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0008 - Special Programs Room						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Library - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0001/Ceiling Structures/Linings/S11			Chrysotile (white asbestos)		
Ceiling Voids	Non Accessible Area - Access hatch blocked from shelves					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Gable Ends	Flat AC Sheeting	10m	Packer	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/Gable Ends/S29			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0001/Ceiling Structures/Linings/S11			Chrysotile (white asbestos)		
Infill panel	Flat AC Sheeting	12m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0001/Infill panel/S12			Chrysotile (white asbestos)		

B00C - R0002 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Infill panel behind tiles	Flat AC Sheeting	1m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Infill panel behind tiles/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0006/Floor Coverings Res/Textile/S3			Chrysotile (white asbestos)		

B00C - R0004 - Reading Area

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00C - R0005 - Reading Area

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00C - R0006 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0006/Floor Coverings Res/Textile/S3			Chrysotile (white asbestos)		

B00C - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		
Infill panel behind tiled wall	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Infill panel behind tiles/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0008 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00C/R0002/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00C - R0009 - Reading Area

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00C/R0002/Floor Coverings Res/Textile/S2	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00D - Pupil Facilities - 1955 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Height Restriction. Associated with					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Interior						
B00D - R0001 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0002 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2386/B00D/R0002/Partition Walls (Cubicles)/S14					
B00D - R0003 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	40m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0004 - Handwashing Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	30m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0005 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
2386/B00D/R0002/Partition Walls (Cubicles)/S14						
B00D - R0006 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Area inaccessible. Associated with					

Interior**B00E - R0001 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0007 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0008 - Canteen Office/Store

No Asbestos

B00E - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00A/R0023/Wall Linings Internal/S6					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1955 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 2386/B00A/Eaves Linings/S7	20m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Voids	Asbestos Dust Assumed Asbestos - Area inaccessible. Associated with	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting Assumed Asbestos - Area inaccessible	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Packer in ground soil	Flat AC Sheeting 2386/B00F/Packer in ground soil/S15					No Asbestos Detected

Interior**B00F - R0001 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	23m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	20m2	East facing, West facing	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Medium Priority (4-5)

B00F - R0002 - Uniform Shop

Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	12m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	25m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 2386/B00F/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00F/R0010/Floor Coverings Res/Textile/S16	12m2	Lower portion	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00F - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	10m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	20m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 2386/B00F/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00F/R0010/Floor Coverings Res/Textile/S16	9m2	Lower portion	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00F - R0004 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	54m2	Throughout	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	------	------------	---	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0005 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0006 - Craft Store						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0007 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0008 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0009 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00F - R0010 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00F/R0010/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	adhesive					
	2386/B00F/R0010/Floor Coverings Res/Textile/S17			No Asbestos Detected		
B00F - R0011 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor panels	Compressed AC Sheet					
	2386/B00A/R0001/Floor Panels/S8			No Asbestos Detected		
Floor walkway infill panels	Flat AC Sheeting					
	2386/B00B/R0001/infill panels to floor walkway/S10			No Asbestos Detected		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 1981 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00G/Eaves Linings/S18					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00G/Eaves Linings/S18					Chrysotile (white asbestos)

B00G - R0002 - Dental Clinic

Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00G/R0011/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00G - R0003 - Dental Clinic

No Asbestos

B00G - R0004 - Cleaning Supplies

No Asbestos

B00G - R0005 - Dental Clinic

Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00G/R0011/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00G - R0006 - Dental Clinic

Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00G/R0011/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00G - R0007 - Staff Room

No Asbestos

B00G - R0008 - General Storeroom

No Asbestos

B00G - R0009 - Staff Toilet

Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
-------------	-----------	-------	---------	----------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00G - R0010 - Clerical Office

Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00G/R0011/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00G - R0011 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00G/R0011/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00G - R0012 - Toilets - Boys/Girls

No Asbestos

B00G - R0013 - Movement

No Asbestos

B00G - R0014 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2386/B00G/R0014/Wall Linings Internal/S27					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities/General Learning - 1929 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	Assumed Asbestos - Height Restriction. Associated with					
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

Interior**B00H - R0001 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00H - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00H - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00H - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00H - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
B00H - R0006 - Duplicating Workroom						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
B00H - R0007 - Deputy Principal						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	adhesive	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
B00H - R0008 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0013/Ceiling Structures/Linings/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00H - R0009 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	
B00H - R0010 - Staff Room						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00H/R0011/Wall Linings Internal/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
B00H - R0011 - Communal Space						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2386/B00H/R0011/Wall Linings Internal/S20					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive to VFT	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00H/R0007/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	
B00H - R0012 - Craft Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00H/R0014/Ceiling Structures/Linings/S30					Chrysotile (white asbestos)	
B00H - R0013 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00H/R0013/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00H - R0014 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00H/R0007/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00H/R0014/Ceiling Structures/Linings/S30					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00I - Shed - 1975 - Timber (Timber)

Exterior

Ceiling Voids	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Area inaccessible. Associated with						
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

Interior

B00I - R0001 - External Movement

Floor panels	Compressed AC Sheet 2386/B00I/R0001/Floor panels/S23	No Asbestos Detected				
--------------	---	-----------------------------	--	--	--	--

B00I - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 2386/B00C/R0006/Floor Coverings Res/Textile/S3	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos)						

B00I - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting 2386/B00A/R0021/Wall Linings Internal/S5	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2386/B00C/R0006/Floor Coverings Res/Textile/S3	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Music - 1955 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

Interior

B00J - R0001 - External Movement

Floor panels	Compressed AC Sheet					No Asbestos Detected
2386/B00A/R0001/Floor Panels/S8						

B00J - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5						
Chrysotile (white asbestos) , Amosite (brown asbestos)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00C/R0006/Floor Coverings Res/Textile/S3						
Chrysotile (white asbestos)						

B00J - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	Southwest cornee	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00A/R0021/Wall Linings Internal/S5						
Chrysotile (white asbestos) , Amosite (brown asbestos)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2386/B00C/R0006/Floor Coverings Res/Textile/S3						
Chrysotile (white asbestos)						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00K - Pupil Facilities/General Learning - 1955 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00K - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Panels	Compressed AC Sheet 2386/B00A/R0001/Floor Panels/S8					No Asbestos Detected
Floor walkway infills	Flat AC Sheeting 2386/B00B/R0001/infill panels to floor walkway/S10					No Asbestos Detected

B00K - R0002 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0003 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00K - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet 2386/B00D/R0002/Partition Walls (Cubicles)/S14					No Asbestos Detected

B00K - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00A/R0021/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet 2386/B00D/R0002/Partition Walls (Cubicles)/S14					No Asbestos Detected

B00K - R0006 - Toilets - Boys/Girls

No Asbestos

B00K - R0007 - General Storeroom

No Asbestos

B00K - R0008 - Personal Effects Storage

No Asbestos

B00K - R0009 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00K - R0010 - Home Base						
Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00K - R0011 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00K - R0012 - Withdrawal Space - 1hb						
Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00K - R0013 - Staff Toilet						
No Asbestos						
B00K - R0014 - Movement						
Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00K - R0015 - Distribution Board						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2386/B00K/R0015/Wall Linings Internal/S26					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2386/B00K/R0015/Wall Linings Internal/S26					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00K - R0016 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Sheet					
	2386/B00K/R0012/Floor Coverings Res/Textile/S24					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Shed - 1929 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2386/B00L/R0001/Wall Linings Internal/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00L - R0001 - Cleaning Supplies

Wall Linings Internal	Flat AC Sheeting	10m2	Upper portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2386/B00L/R0001/Wall Linings Internal/S25			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - External Movement

No Asbestos Found

B00M - R0002 - Practical Activities - 1hb

No Asbestos Found

B00M - R0003 - Home Base Store

No Asbestos Found

B00M - R0004 - Home Base

No Asbestos Found

B00M - R0005 - Withdrawal Space - 2hb

No Asbestos Found

B00M - R0006 - Home Base

No Asbestos Found

B00M - R0007 - Home Base Store

No Asbestos Found

B00M - R0008 - Practical Activities - 1hb

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00N - R0001 - Communal Space**

No Asbestos Found

B00N - R0002 - Covered Outdoor Learning Area

No Asbestos Found

B00N - R0003 - Chair Storeroom

No Asbestos Found

B00N - R0004 - Communal/Performance Store

No Asbestos Found

B00N - R0005 - P.E. Store

No Asbestos Found

B00N - R0006 - Toilet - Lobby

No Asbestos Found

B00N - R0007 - Toilets - Girls

No Asbestos Found

B00N - R0008 - Sound Cupboard

No Asbestos Found

B00N - R0009 - Toilet - Lobby

No Asbestos Found

B00N - R0010 - Toilets - Boys

No Asbestos Found

B00N - R0011 - Cleaning Distributed Store

No Asbestos Found

B00N - R0012 - Plant

No Asbestos Found

B00N - R0013 - Main Switch Board

No Asbestos Found

B00N - R0014 - Access Shower/Toilet

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017