


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Leura Public School (2391)
Region : Western Sydney
State Electorate : Blue Mountains
Local Government Area : Blue Mountains

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Greencap-NAA : 22 - Jun - 2015

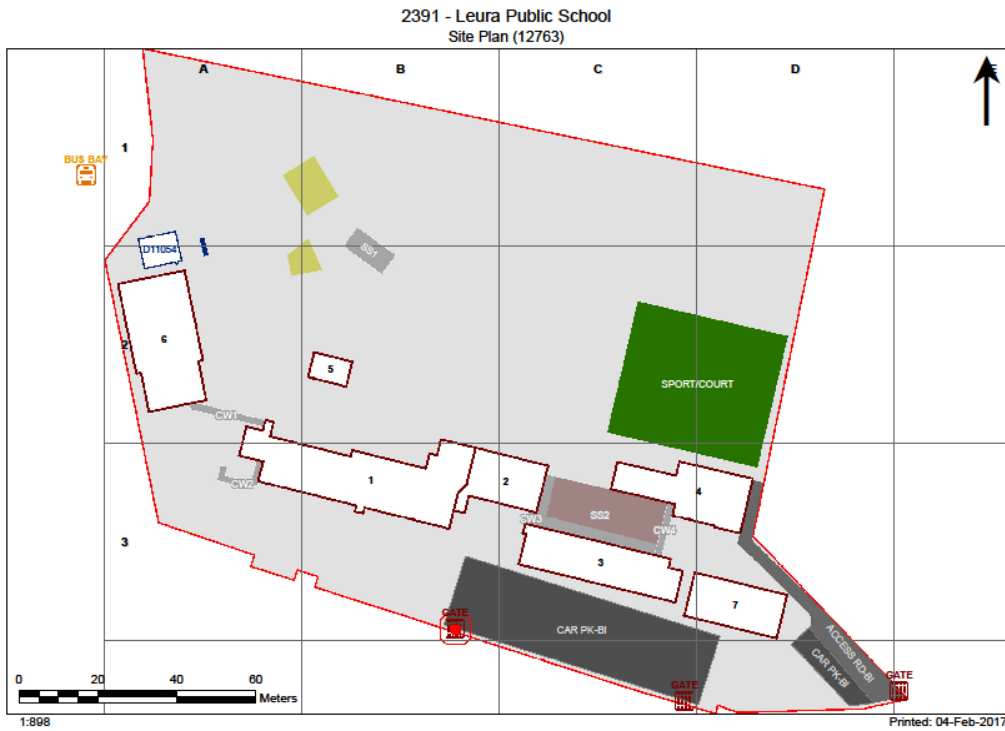

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Support Unit - 1958 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/Eaves Linings/S16					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m	East & North-west	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2391/B001/Gable Verge Lining/S17					Chrysotile (white asbestos)

Interior**B001 - R0001 - Movement (53.69 m2)**

No Asbestos

B001 - R0002 - Home Base (67.9 m2)

No Asbestos

B001 - R0003 - Home Base Store (7.83 m2)

No Asbestos

B001 - R0004 - Security Store (3.8 m2)

No Asbestos

B001 - R0005 - Movement (7.53 m2)

No Asbestos

B001 - R0006 - Security Store (3.8 m2)

No Asbestos

B001 - R0007 - Home Base Store (7.81 m2)

No Asbestos

B001 - R0008 - Home Base (65.89 m2)

No Asbestos

B001 - R0009 - Community Clinic (16.19 m2)

Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet	16.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B001 - R0010 - General Storeroom (2.04 m2)

Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet	2.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B001 - R0011 - General Storeroom (1.9 m2)

Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet	1.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B001 - R0012 - Movement (2.54 m2)

No Asbestos

B001 - R0013 - Movement (3.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B001 - R0014 - Movement (12.11 m2)

Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet	12.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B001 - R0015 - General Storeroom (1.99 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	1.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0016 - Interview (20.3 m2)						
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	20.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0017 - Home Base Store (3.82 m2)						
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	3.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0018 - Home Base Store (7.81 m2)						
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	7.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0019 - Movement (24.05 m2)						
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	24.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0020 - Home Base (66.16 m2)						
No Asbestos						
B001 - R0021 - Home Base (92.32 m2)						
No Asbestos						
B001 - R0022 - Home Base Store (6.28 m2)						
Floor Coverings Res/Textile	Tan coloured vinyl tiles under carpet 2391/B001/R0013/Floor Coverings Res/Textile/S5	6.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0023 - Staff Toilet (1.65 m2)						
No Asbestos						
B001 - R0024 - Movement (7.46 m2)						
No Asbestos						
B001 - R0025 - Personal Effects Storage (6.61 m2)						
No Asbestos						
B001 - R0026 - Main Switch Board (0.58 m2)						
Electrical Mounting Board	Resinous Membrane	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Equipment - Live.						
B001 - R0027 - Movement (75.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2391/B001/R9011/Ceiling Structures/Linings/S11	75.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill panel above door.	Flat AC Sheeting 2391/B001/R9011/Ceiling Structures/Linings/S11	4m2	South-west exit	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0028 - Toilets - Boys (9.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2391/B001/Eaves Linings/S16	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 2391/B001/R0028/Partition Walls (Cubicles)/S15	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B001 - R0029 - Staff Toilet (5.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2391/B001/Eaves Linings/S16	5.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R0030 - Toilets - Girls (7.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/Eaves Linings/S16					Chrysotile (white asbestos)
B001 - R0031 - Cleaning Distributed Store (3.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/Eaves Linings/S16					Chrysotile (white asbestos)
B001 - R0033 - Movement (2.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
In-fill panel above door	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9001 - Cleaning Distributed Store (7.17 m2)						
Joist packing	Flat AC fragments	0.1m2	East & west	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2391/B001/R9001/Joist packing/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R9002 - Movement (4.24 m2)						
No Asbestos						
B001 - R9003 - Staff Room						
Recently Modified Space	Requires Inspection					
B001 - R9004 - Canteen Office/Store (2.02 m2)						
Floor Coverings Res/Textile	Green Vinyl tile	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile					No Asbestos Detected
	2391/B001/R9004/Floor Coverings Res/Textile/S13					
Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9005 - Canteen (24.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9006 - Canteen Office/Store (1.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1.94m2	Southern part of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9007 - Staff Toilet (2.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9008 - Movement (7.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
In-fill panel above & @ side of door	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B001 - R9009 - Movement (64.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	34m2	North half of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)
2391/B001/R9003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Southern part of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)
2391/B001/R9011/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
B001 - R9010 - Staff Room (70.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	70.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2391/B001/R9003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B001 - R9011 - Movement						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - Library - 1963 - Concrete (Concrete)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - No manhole.					
Underfloor Voids	No Asbestos Found					

Interior**B002 - R0002 - Former Comms Room**

No Asbestos

B002 - R0005 - Movement (54.07 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B002 - R0006 - Movement (10.33 m2)

Wall Linings Internal	Flat AC Sheeting	3m2	East lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	10.33m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B002 - R0007 - Home Base (68.07 m2)

No Asbestos

B002 - R0008 - Withdrawal Space - 2hb (6.2 m2)

No Asbestos

B002 - R0009 - Movement (2.45 m2)

No Asbestos

B002 - R0010 - Movement (2.42 m2)

No Asbestos

B002 - R0011 - Home Base Store (4.95 m2)

No Asbestos

B002 - R0012 - Home Base Store (4.96 m2)

No Asbestos

B002 - R0013 - Personal Effects Storage (10.15 m2)

No Asbestos

B002 - R0014 - Home Base (58.48 m2)

No Asbestos

B002 - R0015 - Home Base Store (8.94 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Administration - 1963 - Concrete Framed (Concrete Framed)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - No visible manhole.					
Gable Verge Lining	Flat AC Sheeting	4m	East & west ends of movement R0022	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2391/B003/Gable Verge Lining/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B003 - R0001 - Home Base Store (5.78 m2)**

Floor Coverings Res/Textile	Green vinyl tile under carpet	5.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0016/Floor Coverings Res/Textile/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under green tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					

B003 - R0002 - Deputy Principal (16.07 m2)

Floor Coverings Res/Textile	Green vinyl tile under carpet	16.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0016/Floor Coverings Res/Textile/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under green tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					

B003 - R0003 - Movement (3.4 m2)

Floor Coverings Res/Textile	Green vinyl tile under carpet	3.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0016/Floor Coverings Res/Textile/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under green tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					

B003 - R0004 - Personal Effects Storage (5.43 m2)

Floor Coverings Res/Textile	Green vinyl tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					
Floor Coverings Res/Textile	Adhesive under green tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					

B003 - R0005 - Movement (3.51 m2)

Floor Coverings Res/Textile	Green vinyl tile under carpet	3.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0016/Floor Coverings Res/Textile/S7			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive under green tile under carpet					No Asbestos Detected
	2391/B003/R0016/Floor Coverings Res/Textile/S8					

B003 - R0006 - Home Base Store (5.89 m2)

Floor Coverings Res/Textile	Green vinyl tile under carpet	5.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0016/Floor Coverings Res/Textile/S7			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0007 - Home Base (57.03 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	57.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0008 - Home Base (57.03 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	57.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0009 - Home Base Store (5.15 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	5.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0010 - Personal Effects Storage (4.88 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	4.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0011 - Movement (45.1 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	45.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0012 - Distribution Board (0.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2391/B003/R0012/Ceiling Structures/Linings/S1	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Fibrous Membrane	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Cannot sample - Live.
B003 - R0013 - Principal (17.28 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	17.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0014 - Duplicating Workroom (22.28 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	22.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0015 - General Storeroom (2.89 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	2.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0016 - General Storeroom (6.02 m2)						
Floor Coverings Res/Textile	Green vinyl tile. 2391/B003/R0016/Floor Coverings Res/Textile/S7	6.02m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green vinyl tile. 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0017 - Sick Bay (8.7 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	8.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0018 - Staff Toilet (3.6 m2)						
No Asbestos						
B003 - R0019 - Staff Toilet (3.49 m2)						
No Asbestos						
B003 - R0020 - Staff Room (25.22 m2)						
Floor Coverings Res/Textile	Green vinyl tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S7	25.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green tile under carpet 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0021 - Cleaning Distributed Store (2.72 m2)						
Floor Coverings Res/Textile	Green vinyl tile. 2391/B003/R0016/Floor Coverings Res/Textile/S7	2.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive under green vinyl tile. 2391/B003/R0016/Floor Coverings Res/Textile/S8					No Asbestos Detected
B003 - R0022 - Movement (81.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2391/B003/R0022/Ceiling Structures/Linings/S6	82m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill panels	Flat AC Sheeting 2391/B003/R0022/Ceiling Structures/Linings/S6	6m2	East & west ends of movement above walkway	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting 2391/B003/R0022/Ceiling Structures/Linings/S6	3m2	South-west corner of movement on southern wall	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - General Learning/Pupil Facilities - 1963 - Concrete Framed (Concrete Framed)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	2391/B004/R0001/Ceiling Structures/Linings/S3				No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting	20m	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2391/B003/Gable Verge Lining/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B004 - R0001 - Practical Activities - 1hb (20.41 m2)

Ceiling Structures/Linings	Vermiculite	2391/B004/R0001/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R1001/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B004 - R0002 - Home Base (52.7 m2)

Ceiling Structures/Linings	Vermiculite	2391/B004/R0001/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B004 - R0003 - General Storeroom (7.78 m2)

No Asbestos

B004 - R0004 - Movement (31.63 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R0004/Wall Linings Internal/S2				Chrysotile (white asbestos)	

B004 - R0005 - Distribution Board (0.22 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Membrane	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Cannot sample -Live.						

B004 - R0006 - Movement (36.53 m2)

No Asbestos

B004 - R0007 - Home Base (52.93 m2)

Ceiling Structures/Linings	Vermiculite	2391/B004/R0001/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B004 - R0008 - Practical Activities - 1hb (20.17 m2)

Ceiling Structures/Linings	Vermiculite	2391/B004/R0001/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R1001/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B004 - R0009 - Special Programs Room (73.35 m2)

No Asbestos

B004 - R1001 - Practical Activities - 1hb (19.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R1001/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B004 - R1002 - Home Base (52.78 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B004 - R1003 - Movement (23.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill panels above door	Flat AC Sheeting	1.5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R1004 - Home Base (52.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R1001/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	
B004 - R1005 - Practical Activities - 1hb (20.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R1001/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	
B004 - R1006 - Movement (7.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill panels above door	Flat AC Sheeting	1.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R1007 - Movement (33.7 m2)						
Wall Linings Internal	Flat AC Sheeting	10m2	West upper & lower portions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R0004/Wall Linings Internal/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R1008 - Toilets - Boys (33.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R1009 - Cleaning Supplies (5.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R1010 - Toilets - Girls (31.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B004 - R9001 - Sports Store (37.5 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B005 - Pupil Facilities - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B001/Eaves Linings/S16					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior

B005 - R0001 - Toilets - Girls (26.25 m2)

No Asbestos

B005 - R0002 - Toilets - Boys (26.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B006 - Communal Facilities - 1994 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B006 - R0001 - Movement (204.29 m2)**

No Asbestos

B006 - R0002 - Toilets - Boys (5.83 m2)

No Asbestos

B006 - R0003 - Staff Kitchen (6.47 m2)

No Asbestos

B006 - R0004 - Communal Space (146.55 m2)

No Asbestos

B006 - R0005 - Communal Space (45.09 m2)

No Asbestos

B006 - R0006 - No Access (1.09 m2)

No Asbestos

B006 - R0007 - Plant (0.82 m2)

No Asbestos

B006 - R0008 - General Storeroom (6.49 m2)

No Asbestos

B006 - R0009 - Distribution Board (0.78 m2)

Note: No inspection of live electrical installation.

No Asbestos

B006 - R0010 - Cleaning Supplies (9.24 m2)

No Asbestos

B006 - R0011 - Hall Chair Store (9.97 m2)

No Asbestos

B006 - R0012 - Plant (0.67 m2)

No Asbestos

B006 - R0013 - P.E. Store (12.78 m2)

No Asbestos

B006 - R0014 - General Assistant/Bulk Store (17.38 m2)

No Asbestos

B006 - R0015 - Sports Store (12.75 m2)

No Asbestos

B006 - R0016 - Cleaning Distributed Store (5.81 m2)

No Asbestos

B006 - R0017 - Toilets - Girls (8.34 m2)

No Asbestos

B006 - R0018 - Disabled Toilet (5.55 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - Library - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B007 - R0001 - Reading Area (166.45 m2)**

No Asbestos

B007 - R0002 - Library Office/Workroom (22.72 m2)

No Asbestos

B007 - R0003 - Communications Room (7.68 m2)

No Asbestos

B007 - R0004 - K.L.A. Store (14.6 m2)

No Asbestos

B007 - R0005 - Staff Toilet (4.61 m2)

No Asbestos

B007 - R0006 - Toilet - Lobby (2.44 m2)

No Asbestos

B007 - R0007 - Cleaning Distributed Store (3.23 m2)

No Asbestos

B007 - R0008 - Distribution Board (0.73 m2)

Note: No inspection of live electrical installation.

No Asbestos

B007 - R0009 - External Movement (23.27 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - Walkway frm Buildings 3-4

Exterior

Ceiling Voids	Non Accessible Area - No manhole.					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	3m	Southern end of movement east & west sides	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2391/B003/Gable Verge Lining/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B008 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B003/R0022/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	30m2	East lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2391/B004/R0004/Wall Linings Internal/S2			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - Walkway from Buildings 3-2

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B009 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2391/B003/R0022/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D11054 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 31/03/2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017