


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lidcombe Public School (2394)
Region : South Western Sydney
State Electorate : Auburn
Local Government Area : Auburn

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 07 - Dec - 2016

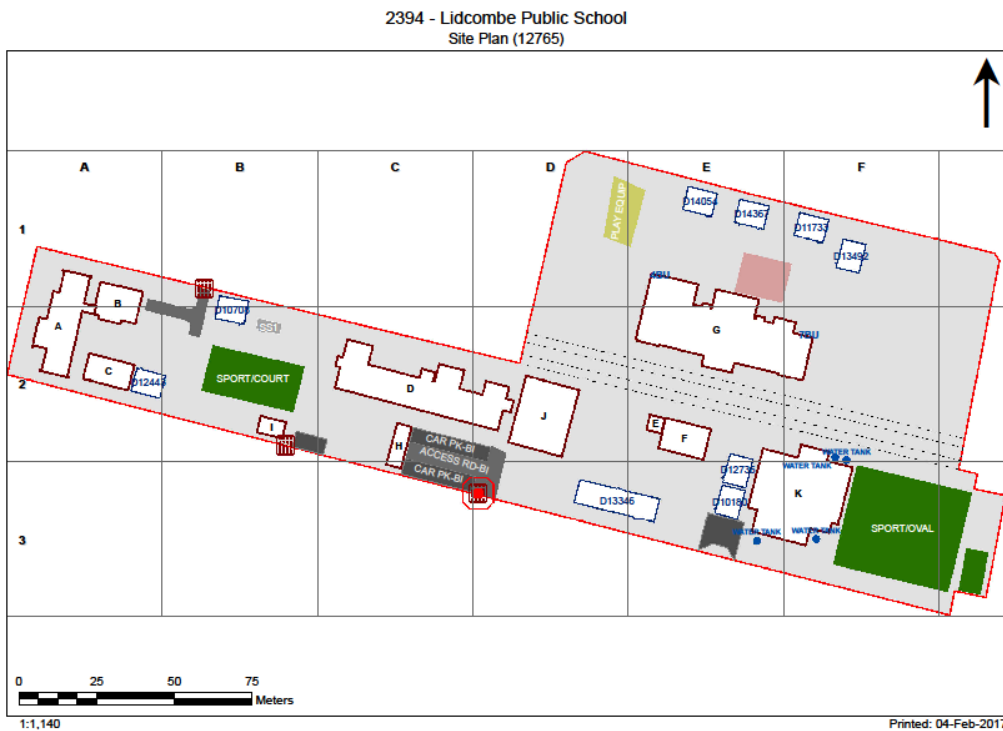

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Support Unit - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00A/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	30m	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00A/Gable Verge Lining/S25			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00A - R0001 - Home Base - M

No Asbestos

B00A - R0002 - Home Base Store - M

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Home Base - M

No Asbestos

B00A - R0005 - Home Base Store - M

No Asbestos

B00A - R0006 - Main Switch Board

Floor Coverings Res/Textile	Vinyl Tiles					
	2394/B00A/R0015/Floor Coverings Res/Textile/S4			No Asbestos Detected		

B00A - R0007 - Entry Vestibule

No Asbestos

B00A - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00A/R0008/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0009 - Toilet - M

No Asbestos

B00A - R0010 - Staff Shower/Change

No Asbestos

B00A - R0011 - Cleaning Distributed Store

Non Accessible

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Toilet - M

No Asbestos

B00A - R0014 - Staff Shower/Change

No Asbestos

B00A - R0015 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2394/B00A/R0015/Floor Coverings Res/Textile/S4			No Asbestos Detected		

B00A - R0016 - Home Base Store - M

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0017 - Home Base - M						
No Asbestos						
B00A - R0018 - Special Programs Room						
No Asbestos						
B00A - R0019 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Other-Community Use/Pupil Facilities - 1879 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00A/Gable Verge Lining/S25				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	Non Accessible Area - Height issues - No Access - Height over 5 metres					
Underfloor Voids	Non Accessible Area - No access - No manhole located					

Interior**B00B - R0001 - Special Programs Room**

Chalk Board	Compressed AC Sheet	4m2	South facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00B/R0001/Chalk Board/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting 2394/B00B/R0001/Wall Linings Internal/S7					
					No Asbestos Detected	

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00B/R0002/Ceiling Structures/Linings/S27				Chrysotile (white asbestos)	

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Special Programs Room

No Asbestos

B00B - R0006 - Raised Platform

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1962 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/Eaves Linings/S19					Chrysotile (white asbestos)
Ceiling Void	Non Accessible Area - No Manhole in building					

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0002 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/R0002/Ceiling Structures/Linings/S28					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North, South & East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/R0002/Wall Linings Internal/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00C - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	2394/B00C/R0003/Floor Coverings Res/Textile/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/R0002/Ceiling Structures/Linings/S28					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North, South & West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00C/R0002/Wall Linings Internal/S33					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Library - 1922 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00D - R0001 - Movement**

No Asbestos

B00D - R0002 - Movement

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Home Base

No Asbestos

B00D - R0010 - Home Base

No Asbestos

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - Withdrawal Space - 2hb

No Asbestos

B00D - R0013 - Movement

No Asbestos

B00D - R0014 - Movement

No Asbestos

B00D - R0015 - General Storeroom

No Asbestos

B00D - R0016 - Movement

No Asbestos

B00D - R0017 - Special Programs Room

No Asbestos

B00D - R0018 - Movement

No Asbestos

B00D - R0019 - Movement

No Asbestos

B00D - R0020 - Cleaning Distributed Store

No Asbestos

B00D - R0021 - Withdrawal Space - 2hb

No Asbestos

B00D - R0022 - Staff Toilet

No Asbestos

B00D - R0023 - Staff Toilet

No Asbestos

B00D - R0024 - General Storeroom

Floor Coverings	Vinyl Tiles
Res/Textile	

2394/B00D/R0024/Floor Coverings Res/Textile/S35

No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0025 - Interview						
No Asbestos						
B00D - R0026 - Stairs						
No Asbestos						
B00D - R0027 - Stairs						
No Asbestos						
B00D - R0028 - Home Base						
No Asbestos						
B00D - R1001 - Security Store						
No Asbestos						
B00D - R1002 - Movement						
No Asbestos						
B00D - R1003 - Home Base						
No Asbestos						
B00D - R1004 - Home Base						
No Asbestos						
B00D - R1005 - Library Office/Workroom						
No Asbestos						
B00D - R1006 - Reading Area						
No Asbestos						
B00D - R1007 - Reading Area						
No Asbestos						
B00D - R1008 - Reading Area						
No Asbestos						
B00D - R1009 - Home Base						
No Asbestos						
B00D - R1010 - Kiln Room						
No Asbestos						
B00D - R1011 - Movement						
No Asbestos						
B00D - R1012 - Home Base Store						
No Asbestos						
B00D - R1013 - Movement						
No Asbestos						
B00D - R1014 - Special Programs Room						
No Asbestos						
B00D - R1015 - Library Office/Workroom						
No Asbestos						
B00D - R1016 - Movement						
No Asbestos						
B00D - R1017 - Movement						
No Asbestos						
B00D - R1018 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2394/B00D/R1018/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00D - R1019 - Craft Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2394/B00D/R1001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00D - R1020 - Stairs						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1021 - Stairs						
No Asbestos						
B00D - R9002 - Movement						
No Asbestos						
B00D - R9003 - Staff Toilet						
No Asbestos						
B00D - R9004 - Cleaning Distributed Store						
No Asbestos						
B00D - R9005 - Movement						
No Asbestos						
B00D - R9006 - General Storeroom						
No Asbestos						
B00D - R9007 - General Storeroom						
No Asbestos						
B00D - R9008 - Toilets - Girls						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration - 1962 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Eaves Linings	Flat AC Sheeting 2394/B00E/Eaves Linings/S20	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting 2394/B00E/Wall Cladding/S12					No Asbestos Detected
Electrical Backing Board	Resinous Board 2394/B00E/Electrical Backing Board/S34	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Community Clinic**

Floor Coverings Res/Textile	Vinyl Tiles 2394/B00E/R0001/Floor Coverings Res/Textile/S14	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2394/B00E/R0001/Ceiling Structures/Linings/S13	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2394/B00E/R0001/Wall Linings Internal/S15					No Asbestos Detected

B00E - R0002 - Interview

Floor Coverings Res/Textile	Vinyl Tiles 2394/B00E/R0001/Floor Coverings Res/Textile/S14	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2394/B00E/R0001/Ceiling Structures/Linings/S13	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2394/B00E/R0001/Wall Linings Internal/S15					No Asbestos Detected

B00E - R0003 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles 2394/B00E/R0001/Floor Coverings Res/Textile/S14	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2394/B00E/R0001/Ceiling Structures/Linings/S13	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2394/B00E/R0001/Wall Linings Internal/S15					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1962 - Steel (Steel)

Exterior

Eaves Linings	Flat AC Sheeting 2394/B00F/Eaves Linings/S21	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Cladding	Flat AC Sheeting 2394/B00F/Wall Cladding/S16					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00F - R0001 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting 2394/B00F/R0001/Ceiling Structures/Linings/S30	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - Home Base

No Asbestos

B00F - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2394/B00F/R0004/Ceiling Structures/Linings/S17	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1922 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2394/B00G/Eaves Linings/S22					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 2394/B00G/Underfloor Voids/S26	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00G - R0001 - Security Store

No Asbestos

B00G - R0002 - Staff Toilet

No Asbestos

B00G - R0003 - Staff Toilet

No Asbestos

B00G - R0004 - Home Base

No Asbestos

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Interview

No Asbestos

B00G - R0008 - General Storeroom

No Asbestos

B00G - R0009 - Entry Vestibule

No Asbestos

B00G - R0010 - Movement

No Asbestos

B00G - R0011 - Interview

No Asbestos

B00G - R0012 - Home Base

No Asbestos

B00G - R0013 - Home Base

No Asbestos

B00G - R0016 - Toilets - Boys

No Asbestos

B00G - R0017 - Toilets - Girls

No Asbestos

B00G - R0018 - Movement

No Asbestos

B00G - R0019 - Cleaning Supplies

No Asbestos

B00G - R0020 - Toilets - Girls

No Asbestos

B00G - R0021 - Movement

No Asbestos

B00G - R0022 - Personal Effects Storage

No Asbestos

B00G - R0024 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2394/B00G/R0024/Ceiling Structures/Linings/S31					Chrysotile (white asbestos)	
B00G - R0025 - Home Base						
Chalk Board	Compressed AC Sheet	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2394/B00G/R0004/Chalk Board/S10					Chrysotile (white asbestos)	
B00G - R0026 - General Storeroom						
No Asbestos						
B00G - R0027 - Movement						
No Asbestos						
B00G - R0031 - Movement						
No Asbestos						
B00G - R0032 - Movement						
No Asbestos						
B00G - R0033 - Movement						
No Asbestos						
B00G - R0035 - General Storeroom						
No Asbestos						
B00G - R0036 - Staff Toilet						
No Asbestos						
B00G - R0037 - Home Base						
No Asbestos						
B00G - R0038 - Movement						
No Asbestos						
B00G - R0039 - Movement						
No Asbestos						
B00G - R0042 - Practical Activities						
No Asbestos						
B00G - R0043 - Special Programs Room						
No Asbestos						
B00G - R0044 - Communal Space						
No Asbestos						
B00G - R0045 - Movement						
No Asbestos						
B00G - R0046 - Home Base						
No Asbestos						
B00G - R9001 - Toilets - Boys						
No Asbestos						
B00G - R9002 - Sports Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00H/Eaves Linings/S23					Chrysotile (white asbestos)
Ceiling Void	Non Accessible Area - No manhole located in building					

Interior

B00H - R0001 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00H/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00H - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00H/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00H - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B00H/R0003/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2394/B001/Eaves Linings/S24				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior

B001 - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1995 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00K - R0001 - Access Shower/Toilet

No Asbestos

B00K - R0002 - Sound Cupboard

No Asbestos

B00K - R0003 - Sports Store

No Asbestos

B00K - R0004 - Toilets - Girls

No Asbestos

B00K - R0005 - General Storeroom

No Asbestos

B00K - R0006 - Cleaning Distributed Store

No Asbestos

B00K - R0007 - Communal/Performance Store

No Asbestos

B00K - R0008 - Communal Space

No Asbestos

B00K - R0009 - Raised Platform

No Asbestos

B00K - R0010 - Movement

No Asbestos

B00K - R0011 - Ramp

No Asbestos

B00K - R0012 - Movement

No Asbestos

B00K - R0013 - Hall Chair Store

No Asbestos

B00K - R0014 - Main Switch Board

No Asbestos

B00K - R0015 - Toilets - Boys

No Asbestos

B00K - R0016 - Garden Store

No Asbestos

B00K - R0017 - P.E. Store

No Asbestos

B00K - R0018 - General Assistant/Bulk Store

No Asbestos

B00K - R0019 - Stairs

No Asbestos

B00K - R0020 - Canteen

No Asbestos

B00K - R0021 - Canteen Office/Store

No Asbestos

B00K - R0022 - Covered Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10180 - Learning Unit - Standard With P.A.A. : Placement Date - 26/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10708 - Learning Unit - Standard With P.A.A. : Placement Date - 29/10/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10961 - Learning Unit - Standard With P.A.A. : Placement Date - 27/01/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D11733 - Learning Unit - Standard/Withdrawal : Placement Date - 24/01/2008

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D12443 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2013

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12736 - Learning Unit - Standard With P.A.A. : Placement Date - 29/04/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 501 - D13346 - Admin Staff/Principal/Deputy/Dup/Clinic : Placement Date - 5/10/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	31.68 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				25 m2
R10 - Staff Toilet						
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
R11 - Cleaning Supplies						
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
R12 - Handicap toilet						
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
R13 - Clerk						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R2 - Clinic-Waiting						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R3 - Security Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R4 - Duplicating Wookroom						
Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
R5 - Clerical Office						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R6 - Staff Room						
Ceiling	Flat AC Sheet	Assumed Asbestos				58 m2
R7 - Deputy Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R8 - Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				20 m2
R9 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
OS 602 - D13492 - Learning Unit - Standard With P.A.A. : Placement Date - 22/01/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D14054 - Learning Unit - Standard/Withdrawal : Placement Date - 24/09/1996						
Exterior						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

OS 751 - D14367 - Learning Unit - ESL : Placement Date - 30/06/1995

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

R2 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

OS 603 - D16834 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 24/07/2008

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D18236 - Learning Unit - Standard With P.A.A. : Placement Date - 27/01/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2394_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017