


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lindfield East Public School (2404)
Region : Northern Sydney
State Electorate : Davidson
Local Government Area : Ku-Ring-Gai

Initial Survey : Noel Arnold & Associates : 23 - Feb - 2008
Reviewed By : AECOM : 28 - Jun - 2016

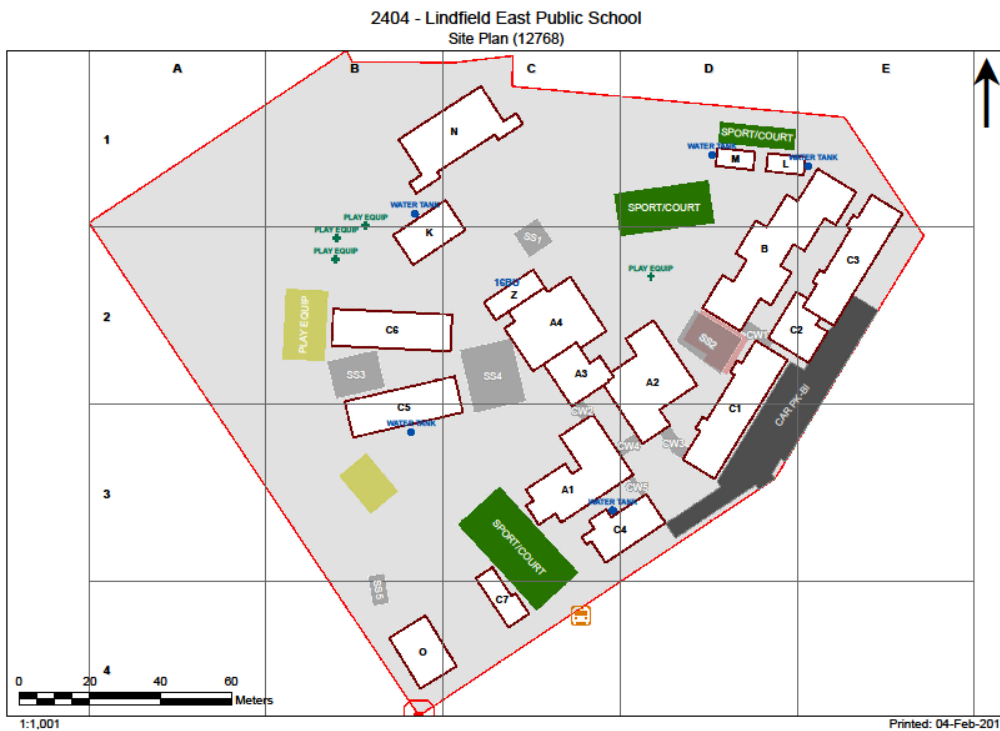

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1929 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Practical Activities - 1hb

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Practical Activities - 1hb

No Asbestos

B00B - R0007 - Cleaning Distributed Store

No Asbestos

B00B - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0009 - General Storeroom

No Asbestos

B00B - R0010 - Home Base

No Asbestos

B00B - R0011 - Practical Activities - 1hb

No Asbestos

B00B - R0012 - Home Base


No Asbestos

B00B - R0013 - Practical Activities - 1hb

No Asbestos

B00B - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	235m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

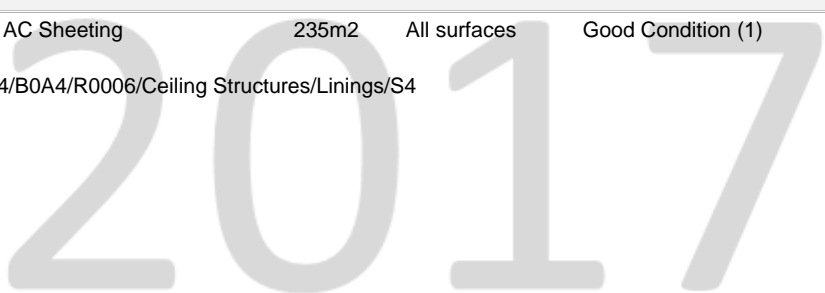

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1929 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00K - R0001 - Uniform Shop

No Asbestos

B00K - R0002 - Special Programs Room

No Asbestos

B00K - R0003 - Home Base

No Asbestos

B00K - R0004 - Home Base Store

No Asbestos

B00K - R0005 - Staff Room Annexe

No Asbestos

B00K - R0006 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00L - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2404/B00Z/R0001/Partition Walls (Cubicles)/S1					
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00M - R0001 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	2404/B00Z/R0001/Partition Walls (Cubicles)/S1					
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Home Base

No Asbestos

B00N - R0002 - Home Base

No Asbestos

B00N - R0003 - Home Base

No Asbestos

B00N - R0004 - Practical Activities

No Asbestos

B00N - R0005 - Withdrawal Space - 1hb

No Asbestos

B00N - R0006 - Home Base Store

No Asbestos

B00N - R0007 - Home Base Store

No Asbestos

B00N - R0008 - Practical Activities

No Asbestos

B00N - R0009 - Withdrawal Space - 2hb

No Asbestos

B00N - R0010 - Practical Activities

No Asbestos

B00N - R0011 - Home Base Store

No Asbestos

B00N - R0012 - External Movement

No Asbestos

B00N - R0013 - External Stairs

No Asbestos

B00N - R0014 - External Stairs

No Asbestos

B00N - R1001 - Home Base

No Asbestos

B00N - R1002 - Home Base

No Asbestos

B00N - R1003 - Home Base

No Asbestos

B00N - R1004 - Practical Activities

No Asbestos

B00N - R1005 - Withdrawal Space - 1hb

No Asbestos

B00N - R1006 - Home Base Store

No Asbestos

B00N - R1007 - Home Base Store

No Asbestos

B00N - R1008 - Practical Activities

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R1009 - Withdrawal Space - 2hb						
No Asbestos						
B00N - R1010 - Practical Activities						
No Asbestos						
B00N - R1011 - Home Base Store						
No Asbestos						
B00N - R1012 - External Movement						
No Asbestos						
B00N - R1013 - External Stairs						
No Asbestos						
B00N - R1014 - External Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Other-After School Care - 2006 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - Other-After School Care	No Asbestos
B000 - R0002 - Other-After School Care	No Asbestos
B000 - R0003 - Other-After School Care	No Asbestos
B000 - R0004 - Other-After School Care	No Asbestos
B000 - R0005 - Other-After School Care	No Asbestos
B000 - R0006 - Other-After School Care	No Asbestos
B000 - R0007 - Other-After School Care	No Asbestos
B000 - R0008 - Other-After School Care	No Asbestos
B000 - R0009 - Other-After School Care	No Asbestos
B000 - R0010 - Other-After School Care	No Asbestos
B000 - R0011 - Other-After School Care	No Asbestos
B000 - R0012 - Other-After School Care	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void hatch located.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable Ends	Flat AC Sheeting	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C7/Gable Verge Lining/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00Z - R0001 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 2404/B00Z/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00Z - R0002 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00Z - R0003 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00Z - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 2404/B00Z/R0001/Partition Walls (Cubicles)/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B00Z/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Administration - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction Area inaccessible

Interior

B0A1 - R0001 - Interview

No Asbestos

B0A1 - R0002 - Sick Bay

No Asbestos

B0A1 - R0003 - General Storeroom

No Asbestos

B0A1 - R0004 - Staff Toilet

No Asbestos

B0A1 - R0005 - Staff Toilet

No Asbestos

B0A1 - R0006 - Cleaning Distributed Store

No Asbestos

B0A1 - R0007 - Toilets - Boys/Girls

No Asbestos

B0A1 - R0008 - Community Clinic

No Asbestos

B0A1 - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A1 - R0010 - Main Switch Board

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A1 - R0011 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	2.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A1 - R0012 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	2.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A1 - R0013 - Staff Room

No Asbestos

B0A1 - R0014 - Movement

No Asbestos

B0A1 - R0015 - Duplicating Workroom

No Asbestos

B0A1 - R0016 - General Storeroom

No Asbestos

B0A1 - R0017 - Principal

No Asbestos

B0A1 - R0018 - Deputy Principal

No Asbestos

B0A1 - R0019 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0A1 - R0020 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B0A1 - R0021 - Cleaning Supplies						
No Asbestos						
B0A1 - R0022 - Deputy Principal						
No Asbestos						
B0A1 - R0023 - Clerical Office						
No Asbestos						
B0A1 - R0024 - Entry Vestibule						
No Asbestos						
B0A1 - R0025 - Entry Vestibule						
No Asbestos						
B0A1 - R0026 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A2 - Library - 1929 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B0A2 - R0001 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

B0A2 - R0002 - Toilets - Boys/Girls

No Asbestos

B0A2 - R0003 - Staff Toilet

No Asbestos

B0A2 - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

B0A2 - R0005 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

B0A2 - R0006 - Library Office/Workroom

No Asbestos

B0A2 - R0007 - Library Office/Workroom

No Asbestos

B0A2 - R0008 - Communications Room

No Asbestos

B0A2 - R0009 - Reading Area

No Asbestos

B0A2 - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A2 - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B0A2 - R0013 - Reading Area

No Asbestos

B0A2 - R0014 - Reading Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A3 - Pupil Facilities - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible void hatch unable to accessed
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B0A3 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	83m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A3 - R0002 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A2/R0001/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)	

B0A3 - R0003 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2404/B0A3/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B0A3 - R0005 - Staff Toilet

No Asbestos

B0A3 - R0006 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2404/B0A3/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B0A3 - R0007 - General Assistant/Bulk Store

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2404/B0A3/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B0A3 - R0008 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	40m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2404/B0A3/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

B0A3 - R0009 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A4 - Communal Facilities - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B0A4 - R0001 - Hall Chair Store

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A4 - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A4 - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A4 - R0004 - Raised Platform

No Asbestos

B0A4 - R0005 - Communal Space

No Asbestos

B0A4 - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A4 - R0007 - Music Store

No Asbestos

B0A4 - R0008 - P.E. Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0A4 - R0009 - P.E. Store

No Asbestos

B0A4 - R0010 - General Assistant/Bulk Store

No Asbestos

B0A4 - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B0A4 - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

Interior

B0C1 - R0001 - Home Base						
No Asbestos						
B0C1 - R0002 - Home Base Store						
No Asbestos						
B0C1 - R0003 - Practical Activities - 1hb						
No Asbestos						
B0C1 - R0004 - General Storeroom						
No Asbestos						
B0C1 - R0005 - Movement						
No Asbestos						
B0C1 - R0006 - General Storeroom						
No Asbestos						
B0C1 - R0007 - Home Base Store						
No Asbestos						
B0C1 - R0008 - Home Base						
No Asbestos						
B0C1 - R0009 - Home Base						
No Asbestos						
B0C1 - R0010 - Home Base Store						
No Asbestos						
B0C1 - R0011 - Practical Activities - 1hb						
No Asbestos						
B0C1 - R0012 - General Storeroom						
No Asbestos						
B0C1 - R0013 - Movement						
No Asbestos						
B0C1 - R0014 - General Storeroom						
No Asbestos						
B0C1 - R0015 - Home Base Store						
No Asbestos						
B0C1 - R0016 - Home Base						
No Asbestos						
B0C1 - R0017 - Personal Effects Storage						
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C1/R0017/Wall Linings Internal/S11					Chrysotile (white asbestos)	
B0C1 - R0018 - Personal Effects Storage						
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C1/R0017/Wall Linings Internal/S11					Chrysotile (white asbestos)	
B0C1 - R0019 - Movement						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C1/R0019/Ceiling Structures/Linings/S12					Clerical Error - No Sample Taken	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C2 - General Learning - 1929 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible void hatch sealed shut					
Eaves Linings	Flat AC Sheeting	16m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

Interior

B0C2 - R0001 - Home Base

No Asbestos

B0C2 - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0C2 - R0003 - Staff Room Annexe

No Asbestos

B0C2 - R0004 - Movement

No Asbestos

B0C2 - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2404/B0C2/R0007/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	

B0C2 - R0006 - Toilets - Boys/Girls

No Asbestos

B0C2 - R0007 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C2/R0007/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	

B0C2 - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B0C2 - R0009 - Access Shower/Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C3 - General Learning - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible no void hatch located
Ceiling Voids - Flat Roof	No Asbestos Found

Interior

B0C3 - R0001 - Home Base

No Asbestos

B0C3 - R0002 - Home Base Store

No Asbestos

B0C3 - R0003 - Practical Activities - 1hb

No Asbestos

B0C3 - R0004 - General Storeroom

No Asbestos

B0C3 - R0005 - Movement

No Asbestos

B0C3 - R0006 - General Storeroom

No Asbestos

B0C3 - R0007 - Home Base Store

No Asbestos

B0C3 - R0008 - Home Base

No Asbestos

B0C3 - R0009 - Home Base

No Asbestos

B0C3 - R0010 - Home Base Store

No Asbestos

B0C3 - R0011 - Practical Activities - 1hb

No Asbestos

B0C3 - R0012 - General Storeroom

No Asbestos

B0C3 - R0013 - Movement

No Asbestos

B0C3 - R0014 - General Storeroom

No Asbestos

B0C3 - R0015 - Home Base Store

No Asbestos

B0C3 - R0016 - Home Base

No Asbestos

B0C3 - R0017 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C1/R0017/Wall Linings Internal/S11					Chrysotile (white asbestos)	

B0C3 - R0018 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C1/R0017/Wall Linings Internal/S11					Chrysotile (white asbestos)	

B0C3 - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0A4/R0006/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C4 - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 4m					
Underfloor Voids	AC Fragments/Debris 2404/B0C4/Underfloor Voids/S21	1Unit	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior

B0C4 - R0001 - Movement

No Asbestos

B0C4 - R0002 - Home Base

No Asbestos

B0C4 - R0003 - Movement

No Asbestos

B0C4 - R0004 - Special Programs Room

No Asbestos

B0C4 - R0005 - Practical Activities - 1hb

No Asbestos

B0C4 - R0006 - Withdrawal Space - 1hb

No Asbestos

B0C4 - R0007 - Movement

No Asbestos

B0C4 - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
2404/B0C4/R0009/Ceiling Structures/Linings/S13						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C5 - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
infill panels under window	Compressed AC Sheet	16Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C5/R0011/infill panels under window/S14					Chrysotile (white asbestos)	

Interior

B0C5 - R0001 - Home Base

No Asbestos

B0C5 - R0002 - Home Base Store

No Asbestos

B0C5 - R0003 - Practical Activities - 1hb

No Asbestos

B0C5 - R0005 - Home Base Store

No Asbestos

B0C5 - R0006 - Home Base

No Asbestos

B0C5 - R0007 - Home Base

No Asbestos

B0C5 - R0008 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2404/B0C5/R0008/Wall Linings Internal/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0C5 - R0009 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2404/B0C5/R0008/Wall Linings Internal/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0C5 - R0010 - Practical Activities - 1hb

No Asbestos

B0C5 - R0011 - Movement

Ceiling Structures/Linings	Corrugated AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C5/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		
infill panels under window	Compressed AC Sheet	14Unit(s)	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2404/B0C5/R0011/infill panels under window/S14					Chrysotile (white asbestos)	

B0C5 - R9001 - Home Base

No Asbestos

B0C5 - R9002 - Practical Activities - 1hb

No Asbestos

B0C5 - R9003 - Movement

No Asbestos

B0C5 - R9004 - Toilets - Boys/Girls

No Asbestos

B0C5 - R9005 - Sports Store

No Asbestos

B0C5 - R9006 - Sports Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C6 - General Learning - 1975 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0A4/R0006/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)	
infill panels under window	Compressed AC Sheet	16Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C5/R0011/infill panels under window/S14				Chrysotile (white asbestos)	

Interior**B0C6 - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C6/R0001/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B0C6 - R0002 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C6/R0002/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B0C6 - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C6/R0001/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B0C6 - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C6/R0001/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B0C6 - R0005 - Staff Room Annexe

No Asbestos

B0C6 - R0006 - Practical Activities - 1hb

No Asbestos

B0C6 - R0007 - Home Base

No Asbestos

B0C6 - R0008 - Home Base

No Asbestos

B0C6 - R0009 - Home Base Store

No Asbestos

B0C6 - R0010 - Practical Activities - 1hb

No Asbestos

B0C6 - R0011 - Home Base Store

No Asbestos

B0C6 - R0012 - Home Base

No Asbestos

B0C6 - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C6/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Infill panels under window	Compressed AC Sheet	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C5/R0011/infill panels under window/S14				Chrysotile (white asbestos)	

B0C6 - R0014 - Home Base Store

No Asbestos

B0C6 - R0015 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B0C6 - R9001 - Home Base

No Asbestos

B0C6 - R9002 - Practical Activities - 1hb

No Asbestos

B0C6 - R9003 - Toilets - Boys/Girls

No Asbestos

B0C6 - R9004 - Home Base Store

No Asbestos

B0C6 - R9005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C7 - Other-After School Care - 1953 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C7/R0001/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2404/B0C7/Gable Verge Lining/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B0C7 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2404/B0C7/R0001/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	

B0C7 - R0002 - General Storeroom

No Asbestos

B0C7 - R0003 - Staff Toilet

No Asbestos

B0C7 - R0004 - Out Of School Hours Care Centre

No Asbestos

B0C7 - R0005 - Special Programs Room

No Asbestos

B0C7 - R0006 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017