


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lisarow Public School (2407)
Region : Hunter/Central Coast
State Electorate : The Entrance
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 29 - Mar - 2008
Reviewed By : AECOM : 28 - Jun - 2016

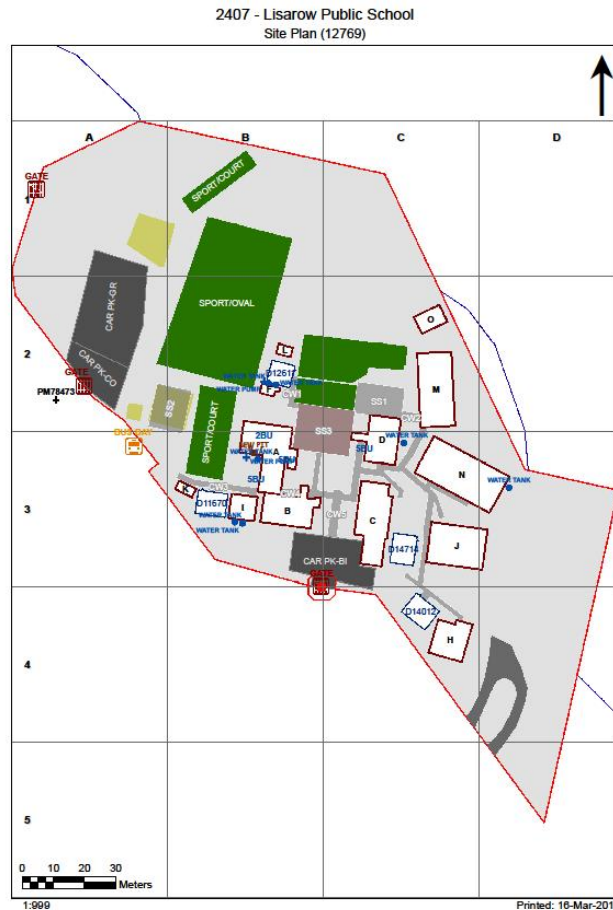

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Communal Facilities - 1928 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/Eaves Linings/S7					Chrysotile (white asbestos)

Interior

B00A - R0002 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/R0002/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/R0002/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00A - R0003 - Disabled Toilet

No Asbestos

B00A - R0004 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/R0004/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)

B00A - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/R0004/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00A/R0007/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Communal Space


Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2407/B00A/R0011/Ceiling Structures/Linings/S20					

B00A - R0010 - Communal/Performance Store

No Asbestos

B00A - R0011 - Communal/Performance Store

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2407/B00A/R0011/Ceiling Structures/Linings/S20					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2407/B00A/R0011/Wall Linings Internal/S21					

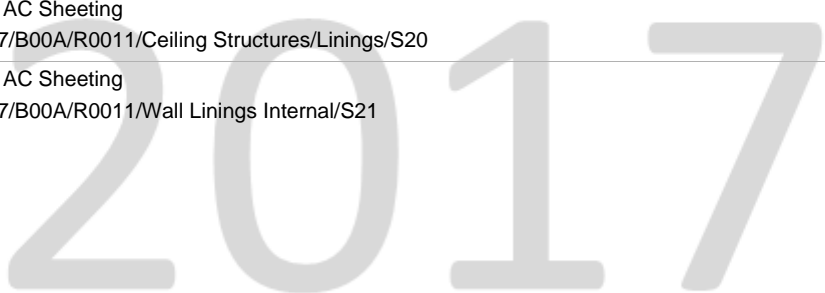

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1928 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no void entrance located. Height Restriction 4.2m					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Area inaccessible, no access to gable

Interior

B00B - R0001 - Home Base Store

No Asbestos

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Special Programs Room

No Asbestos

B00B - R0005 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
		2407/B00B/R0006/Floor Coverings Res/Textile/S11				No Asbestos Detected

B00B - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
		2407/B00B/R0006/Floor Coverings Res/Textile/S11				No Asbestos Detected

B00B - R0007 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		2407/B00B/R0007/Wall Linings Internal/S10				Chrysotile (white asbestos)

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Practical Activities - 1hb

No Asbestos

B00B - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		2407/Build+1/Room+1/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0011 - Shelter

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration - 1928 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Non Accessible Area – Area inaccessible, no manhole / no access points.					
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Area inaccessible, no access to gable

Interior

B00C - M0001 - Clerical/Printing

No Asbestos

B00C - R0001 - External Movement

No Asbestos

B00C - R0004 - Clerical Office

No Asbestos

B00C - R0008 - Staff Kitchen

No Asbestos

B00C - R0009 - Principal

Floor Coverings Res/Textile	Vinyl Sheet					
2407/B00C/R0007/Floor Coverings Res/Textile/S2					No Asbestos Detected	

B00C - R0010 - Staff Toilet

No Asbestos

B00C - R0011 - General Storeroom

No Asbestos

B00C - R0012 - Deputy Principal

No Asbestos

B00C - R0013 - Staff Room

No Asbestos

B00C - R0014 - Clerical Office

No Asbestos

B00C - R0015 - Sick Bay

No Asbestos

B00C - R0016 - Clerical/Printing

Ceiling Structures/Linings	Flat AC Sheeting	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	---------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction 4.2m

B00C - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
2407/B00C/R0018/Ceiling Structures/Linings/S22					No Asbestos Detected	

B00C - R0019 - Study Annexe

No Asbestos

B00C - R0020 - Staff Room

No Asbestos

B00C - R0021 - Staff Kitchen

No Asbestos

B00C - R0022 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1928 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3.3m					
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible, no access to gable						
Eaves Linings	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/Eaves Linings/S4		Chrysotile (white asbestos) , Amosite (brown asbestos)			

Interior

B00D - R0001 - Home Base Store

Floor Coverings Res/Textile	Vinyl Sheet					
	2407/B00D/R0001/Floor Coverings Res/Textile/S5				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/R0005/Ceiling Structures/Linings/S19		Chrysotile (white asbestos)			

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base

No Asbestos

B00D - R0004 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/R0005/Ceiling Structures/Linings/S19		Chrysotile (white asbestos)			
Floor Coverings Res/Textile	Vinyl Sheet					
	2407/B00D/R0001/Floor Coverings Res/Textile/S5				No Asbestos Detected	

B00D - R0005 - Practical Activities - 1hb


Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/R0005/Ceiling Structures/Linings/S19		Chrysotile (white asbestos)			

B00D - R0006 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/R0005/Ceiling Structures/Linings/S19		Chrysotile (white asbestos)			

B00D - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	11.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00D/R0005/Ceiling Structures/Linings/S19		Chrysotile (white asbestos)			

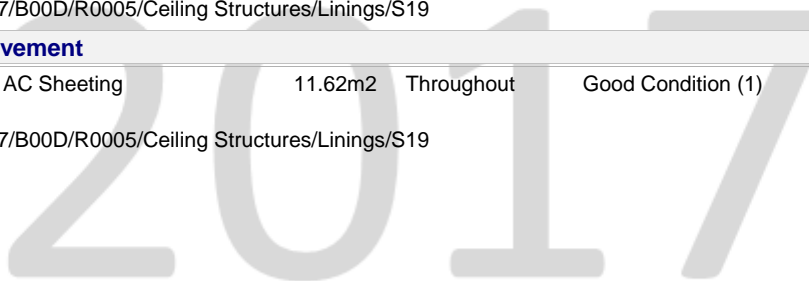

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1928 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Non Accessible Area – Area inaccessible, slab to ground / no access points.					
Ceiling Voids - Flat Roof	Non Accessible Area - Non Accessible Area – Area inaccessible, no manhole / no access points.					
Eaves Linings	Flat AC Sheeting 2407/B00F/Eaves Linings/S16	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00F - R0001 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2407/B00F/R0001/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Community Use - 1998 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00H/Eaves Linings/S17			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00H/Gable Verge Lining/S18			Chrysotile (white asbestos)		
Wall Cladding	Flat AC Sheeting	120m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2407/B00H/Wall Cladding/S1			Chrysotile (white asbestos)		
Gable Ends	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2407/B00H/Eaves Linings/S17			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00H - R0001 - Other-Community Use	No Asbestos					
B00H - R0002 - General Storeroom	No Asbestos					
B00H - R0003 - General Storeroom	No Asbestos					
B00H - R0004 - Toilets - Boys/Girls	No Asbestos					
B00H - R0005 - Uniform Shop	No Asbestos					
B00H - R0008 - External Movement	No Asbestos					
B00H - R0009 - Other-Community Use	No Asbestos					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 2001 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 2407/B001/R0001/Partition Walls (Cubicles)/S12	No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2407/B001/R0001/Ceiling Structures/Linings/S13	No Asbestos Detected

B001 - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 2407/B001/R0001/Partition Walls (Cubicles)/S12	No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2407/B001/R0001/Ceiling Structures/Linings/S13	No Asbestos Detected

B001 - R0003 - Access Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2407/B001/R0001/Ceiling Structures/Linings/S13	No Asbestos Detected
----------------------------	--------------------------------------------------------------------	----------------------

B001 - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2407/B001/R0001/Ceiling Structures/Linings/S13	No Asbestos Detected
----------------------------	--------------------------------------------------------------------	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00J - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00J - R0002 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00J - R0003 - Practical Activity Area

No Asbestos

B00J - R0004 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00J - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00J - R0006 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

B00J - R0007 - Practical Activity Area

No Asbestos

B00J - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 2007 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00K - R0001 - Interview

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 2005 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Non Accessible Area – Area inaccessible, slab to ground / no access points.
Ceiling Voids	No Asbestos Found

Interior

B00L - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Library/Staff Facilities - 2010 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Reading Area

No Asbestos

B00M - R0002 - Library Office/Workroom

No Asbestos

B00M - R0003 - Communications Room

No Asbestos

B00M - R0004 - K.L.A. Store

No Asbestos

B00M - R0005 - External Movement

No Asbestos

B00M - R0006 - Movement

No Asbestos

B00M - R0007 - Cleaning Distributed Store

No Asbestos

B00M - R0008 - Staff Toilet

No Asbestos

B00M - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Practical Activities - 1hb

No Asbestos

B00N - R0002 - Personal Effects Storage

No Asbestos

B00N - R0003 - Home Base

No Asbestos

B00N - R0004 - Withdrawal Space - 1hb

No Asbestos

B00N - R0005 - Home Base Store

No Asbestos

B00N - R0006 - Practical Activities - 1hb

No Asbestos

B00N - R0007 - Personal Effects Storage

No Asbestos

B00N - R0008 - Home Base Store

No Asbestos

B00N - R0009 - Home Base

No Asbestos

B00N - R0010 - Withdrawal Space - 2hb

No Asbestos

B00N - R0011 - Home Base

No Asbestos

B00N - R0012 - Home Base Store

No Asbestos

B00N - R0013 - Personal Effects Storage

No Asbestos

B00N - R0014 - Practical Activities - 1hb

No Asbestos

B00N - R0015 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0016 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Building Services/Communal Facilities - 2009 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Non Accessible Area – Area inaccessible, slab to ground / no access points.
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - P.E. Store

No Asbestos

B000 - R0002 - General Assistant/Bulk Store

No Asbestos

B000 - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D11670 - Learning Unit - Standard/Withdrawal : Placement Date - 29/03/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 801 - D12611 - FSU : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	45 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

OS 602 - D14012 - Learning Unit - Standard With P.A.A. : Placement Date - 4/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14714 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017